




Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

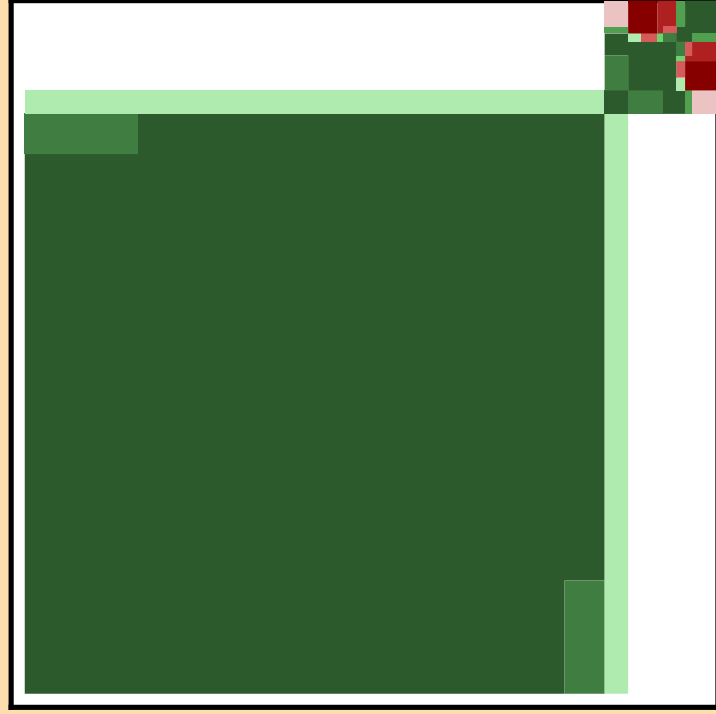

Correlation Matrix


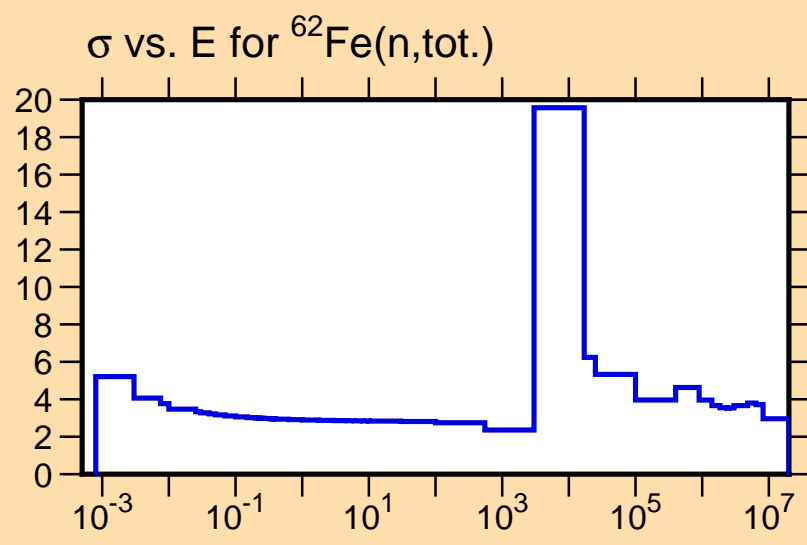


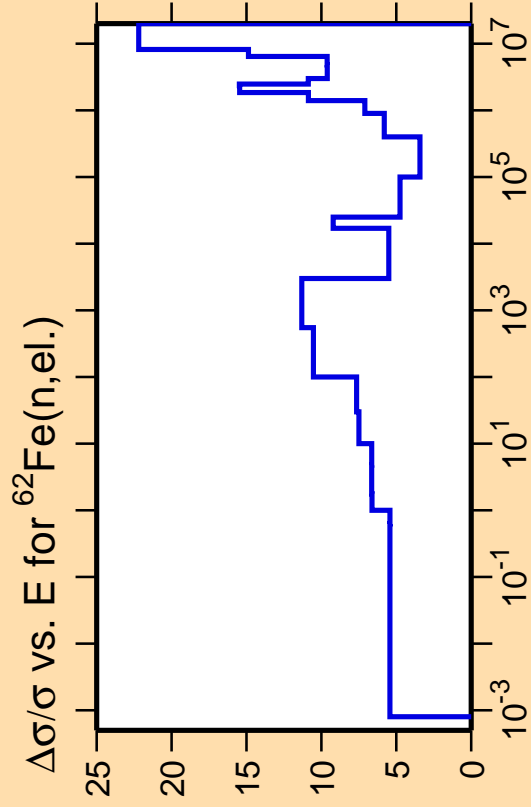

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,\text{tot.})$

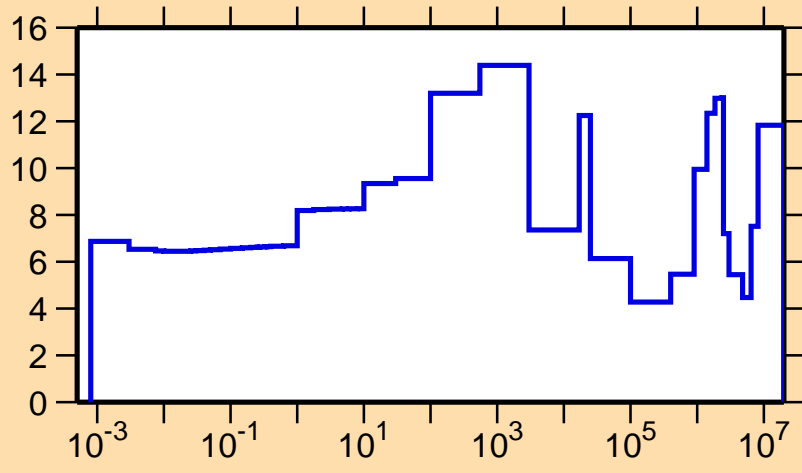

Correlation Matrix





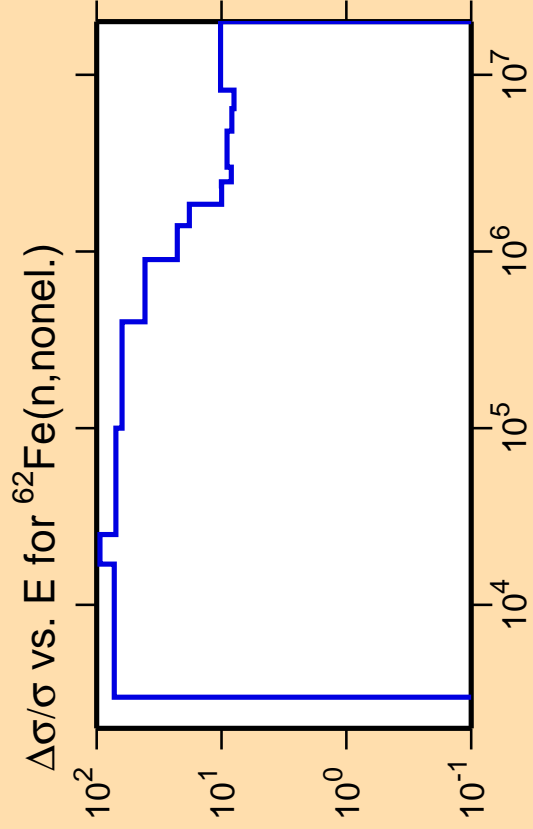

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,\text{tot.})$

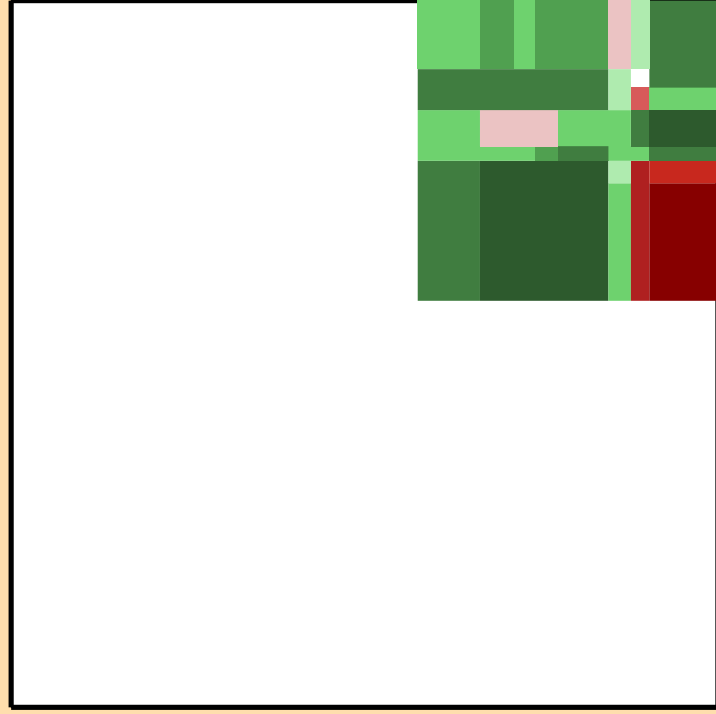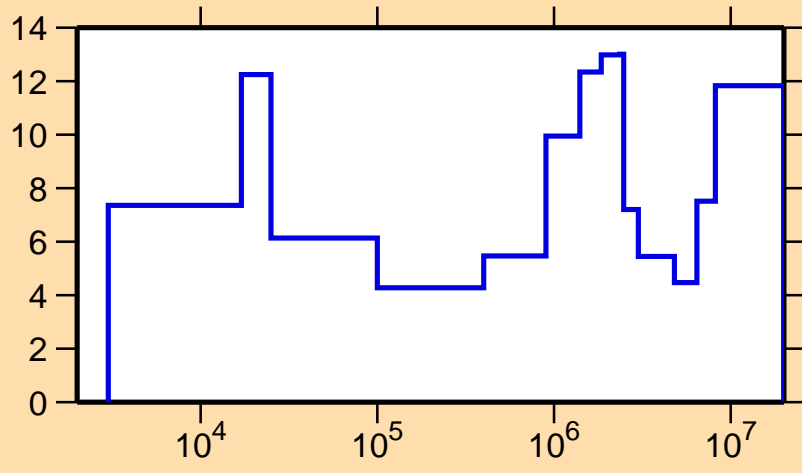

Correlation Matrix





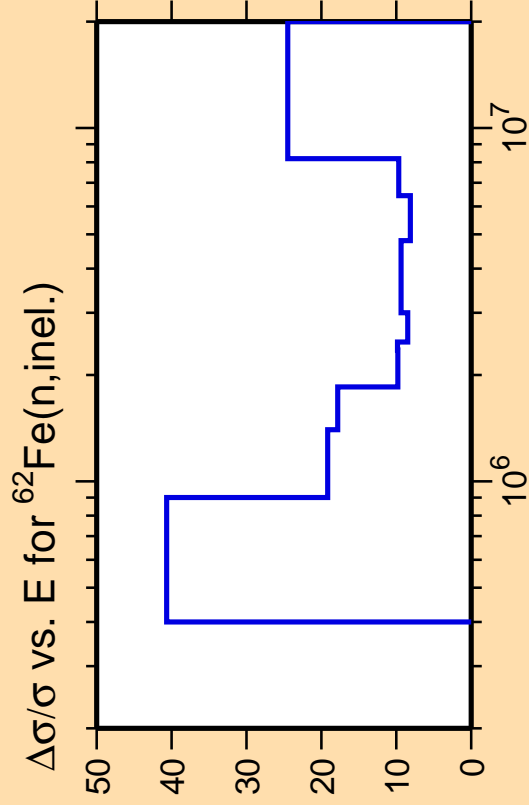

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,\text{tot.})$

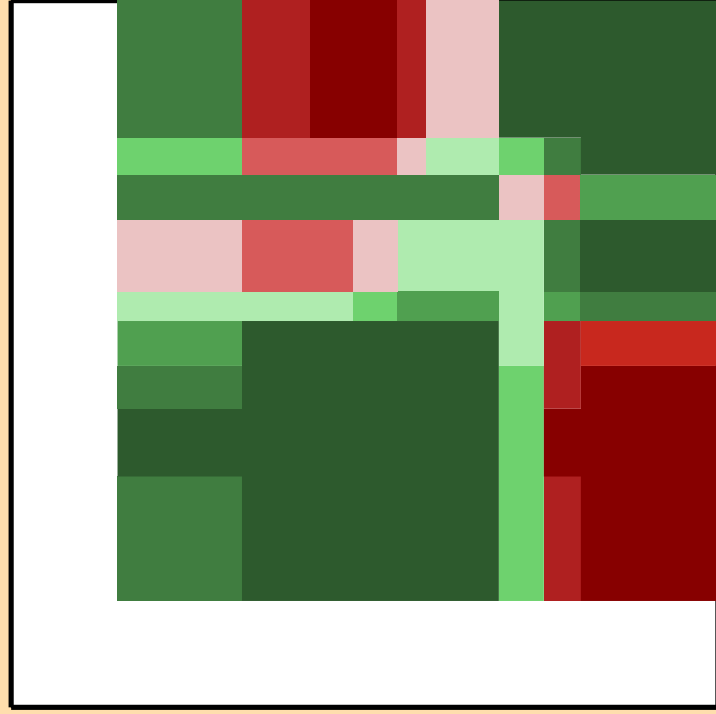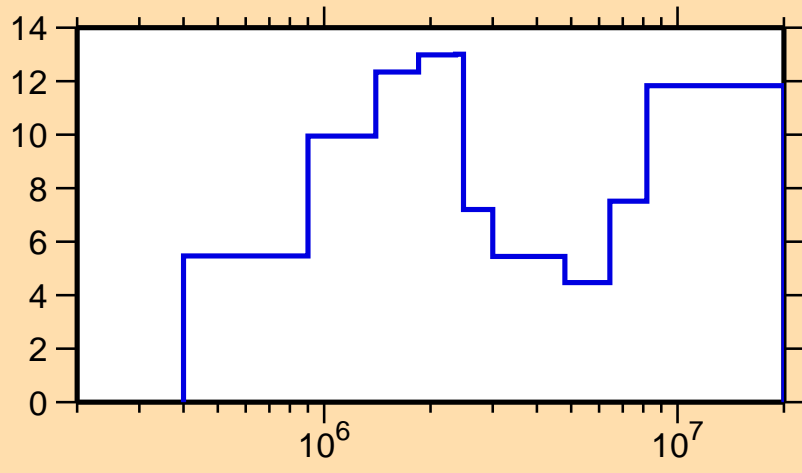

Correlation Matrix







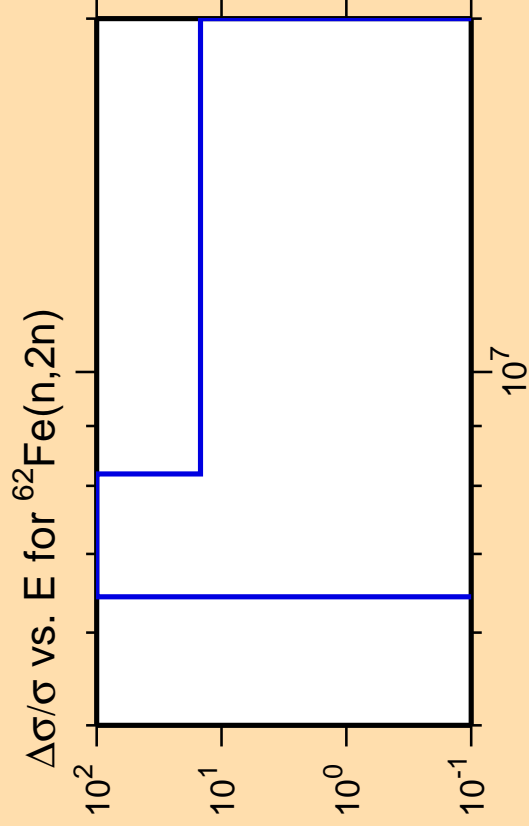


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

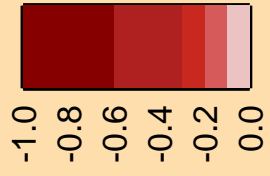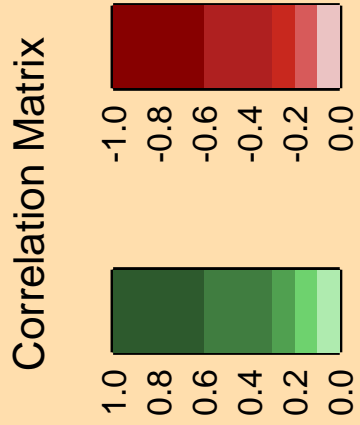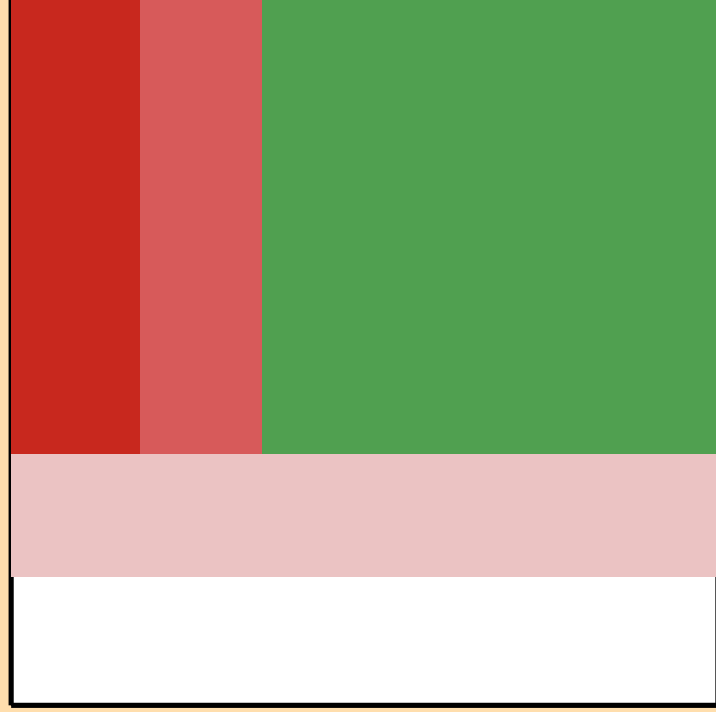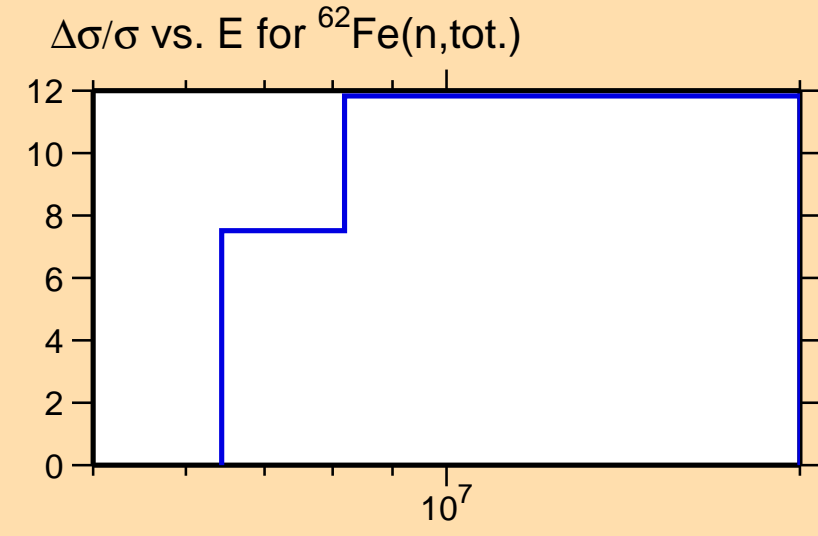


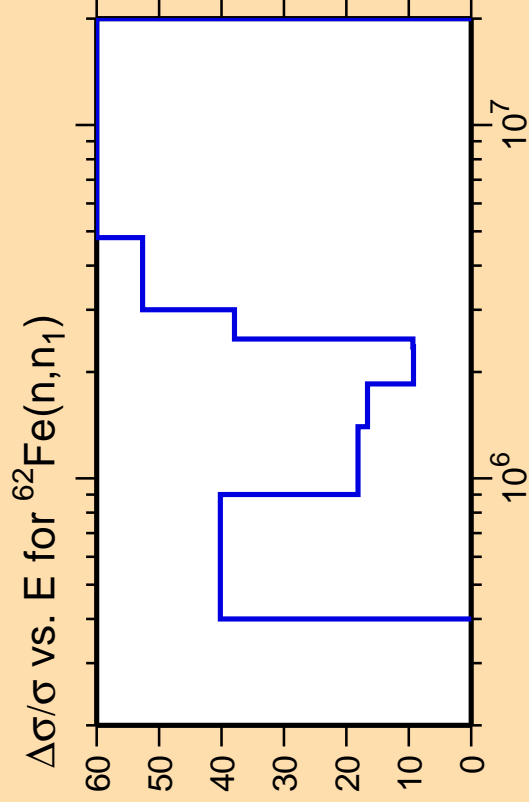


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,\text{tot.})$

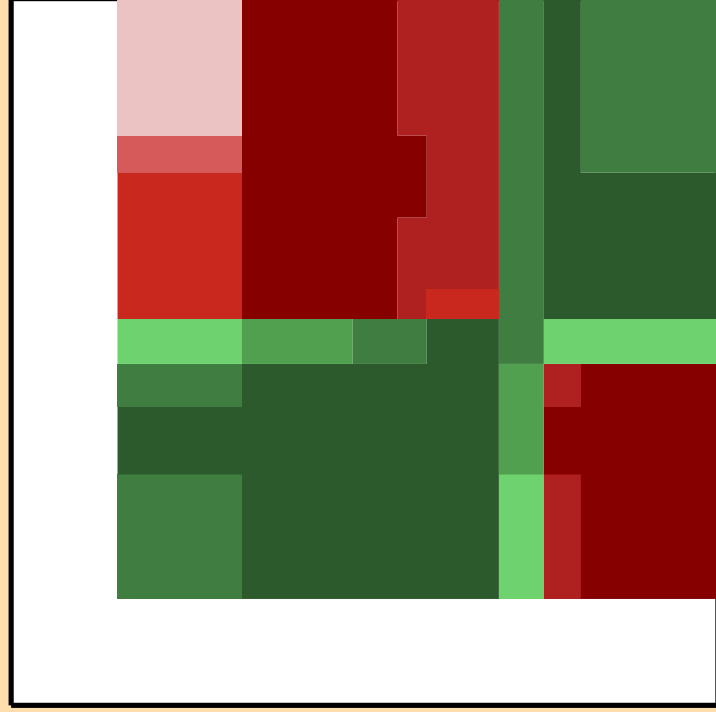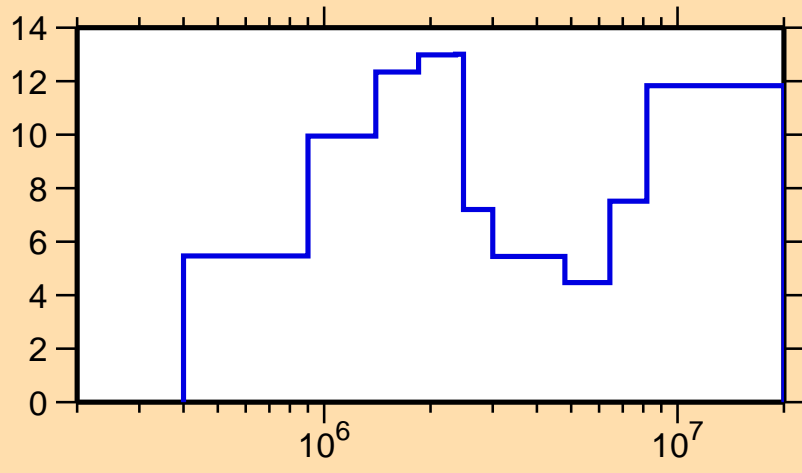



Correlation Matrix



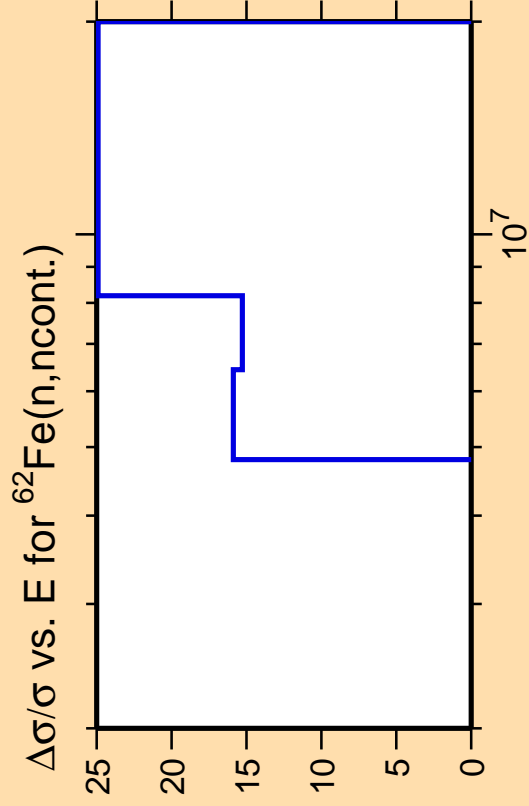



Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

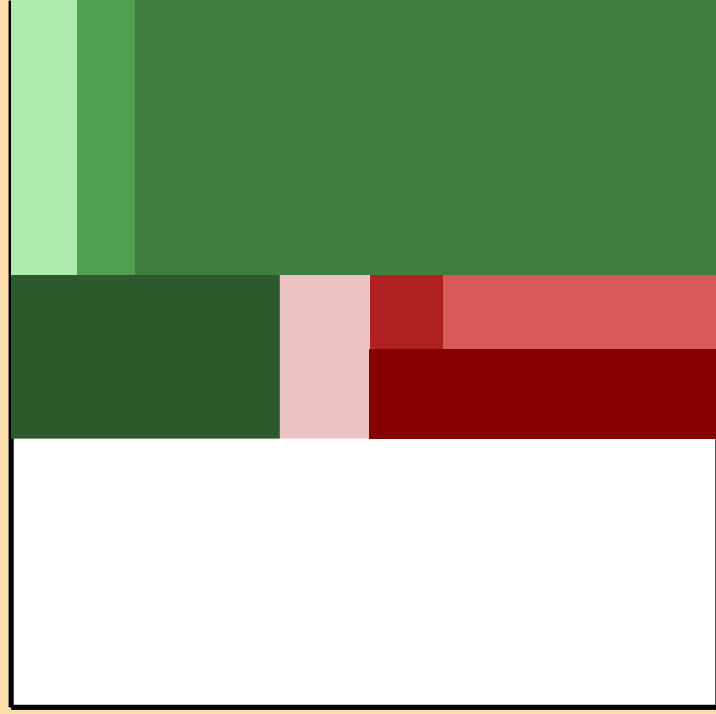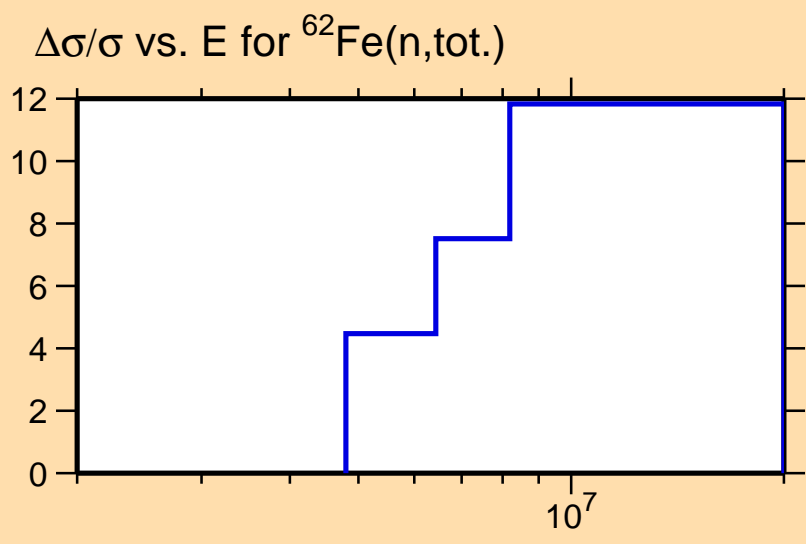

Correlation Matrix


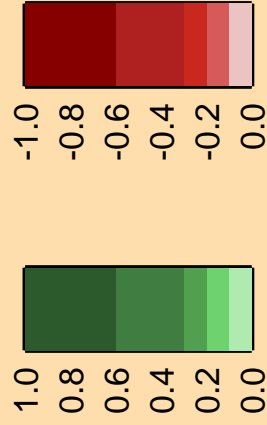


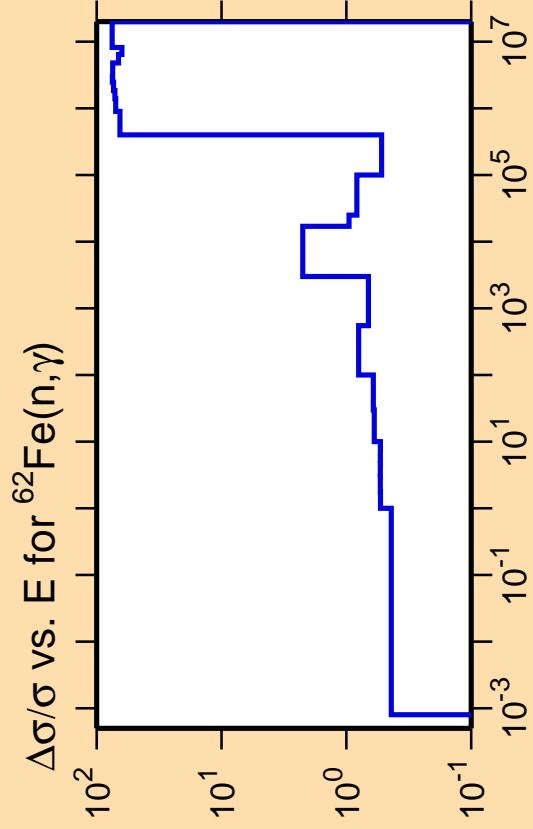

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,\text{tot.})$

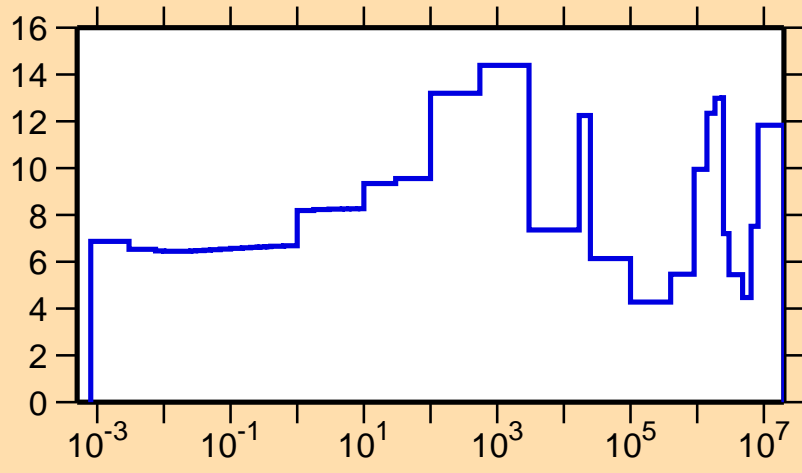

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,p)$


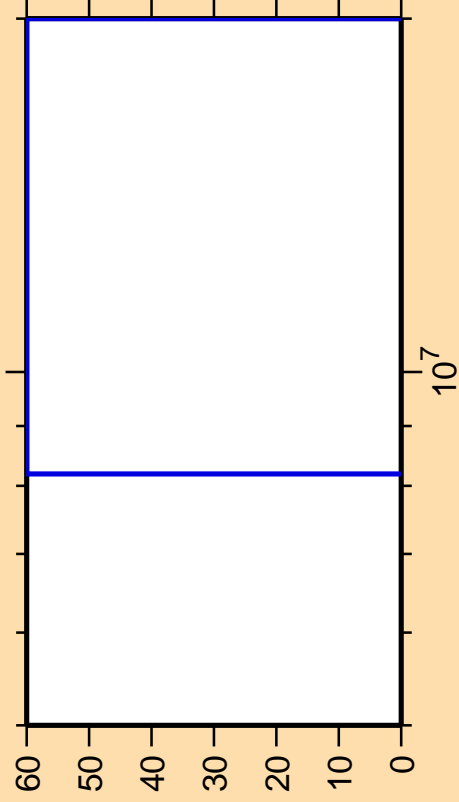


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,\text{tot.})$

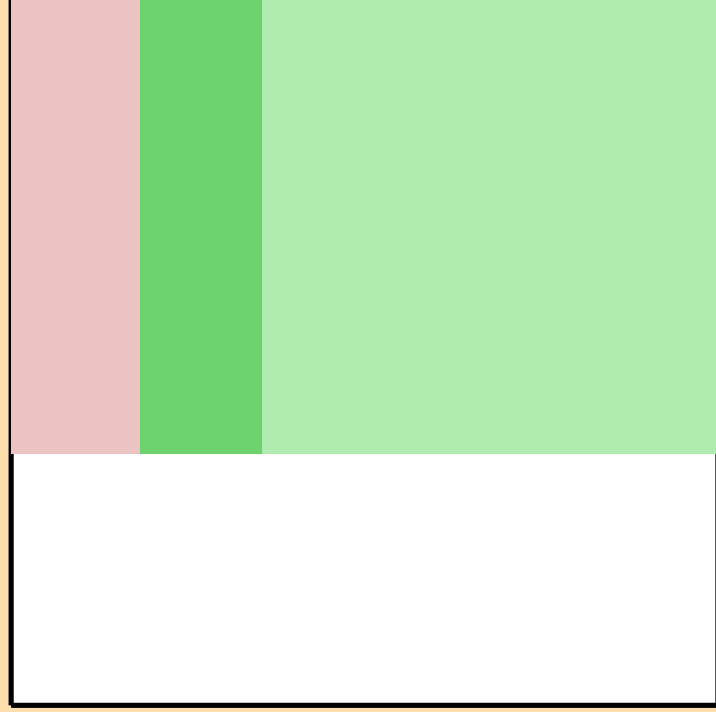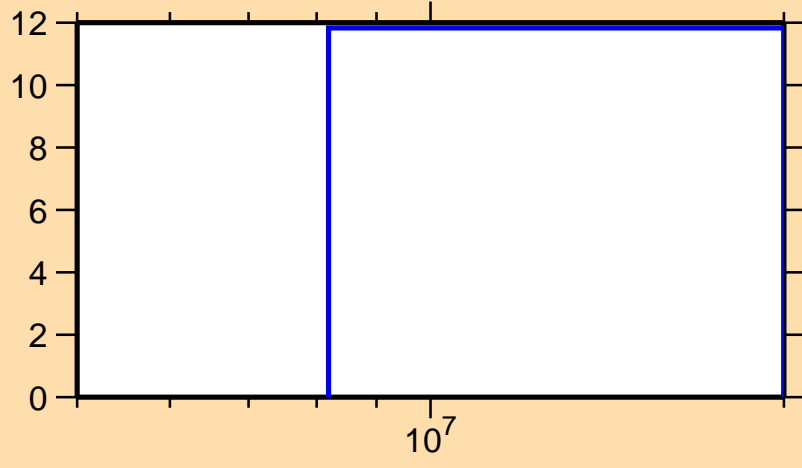

Correlation Matrix


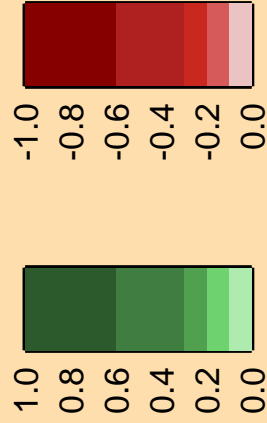


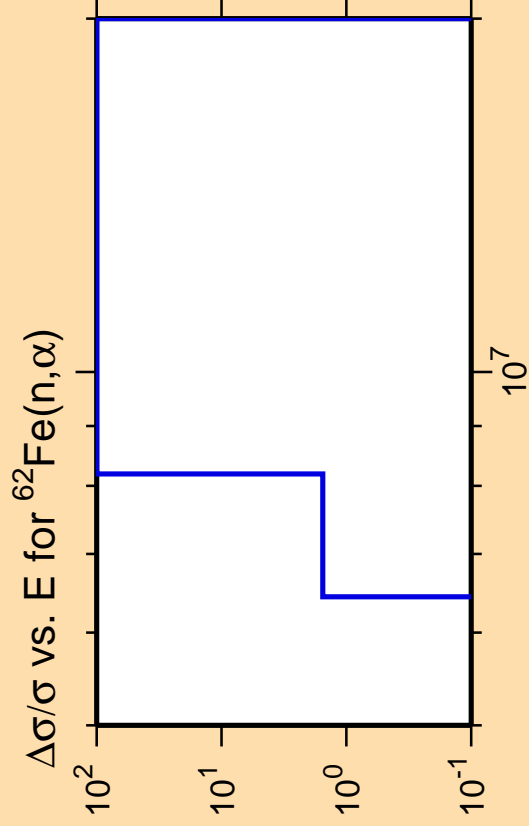


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

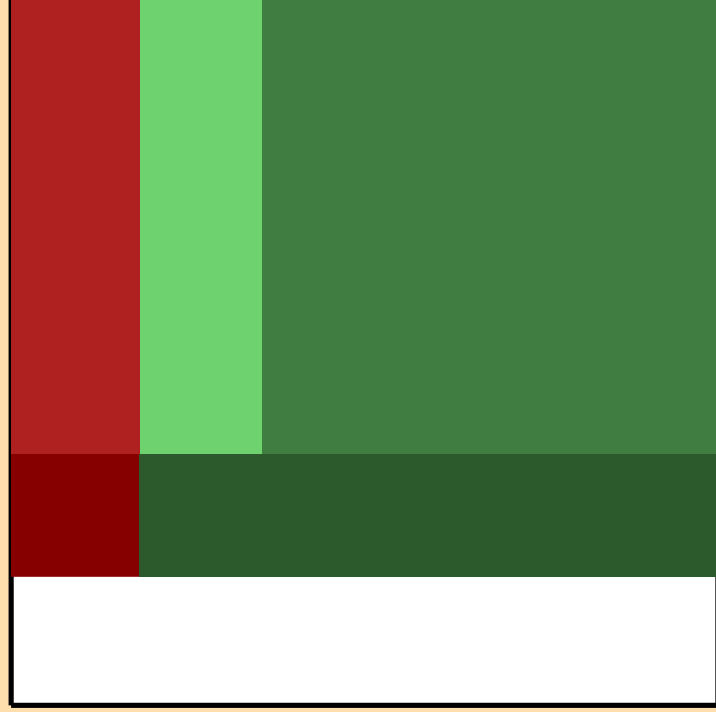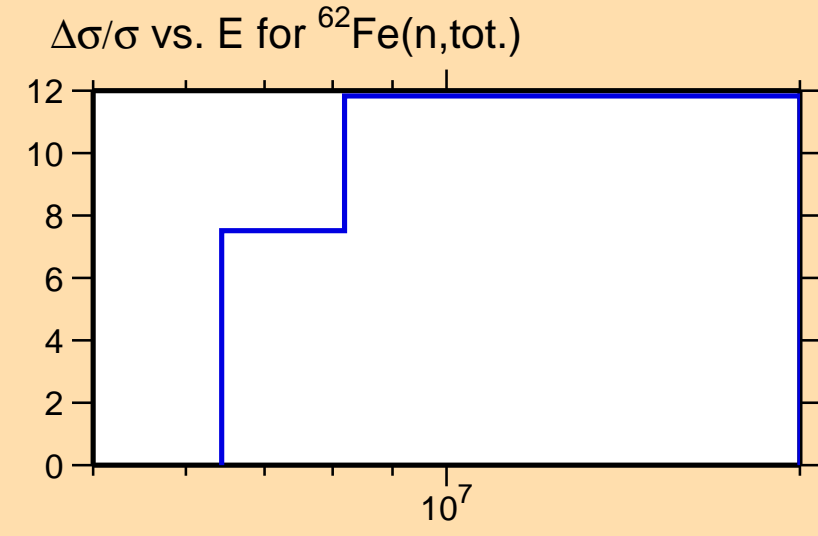

Correlation Matrix

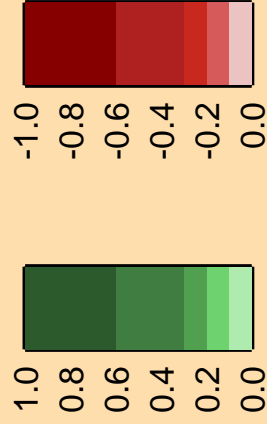



$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,\text{el.})$

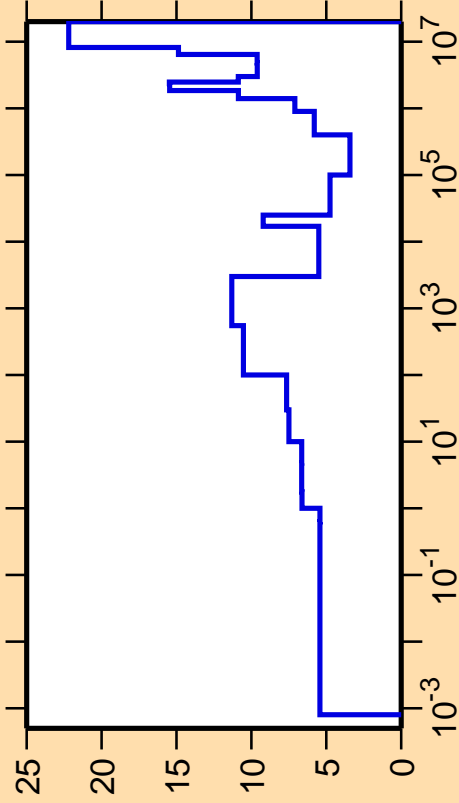

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

σ vs. E for $^{62}\text{Fe}(n,\text{el.})$

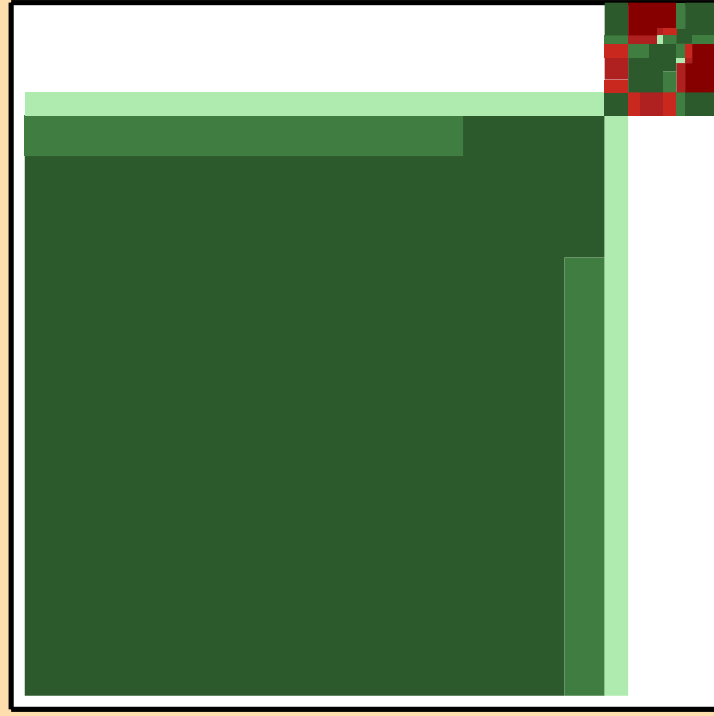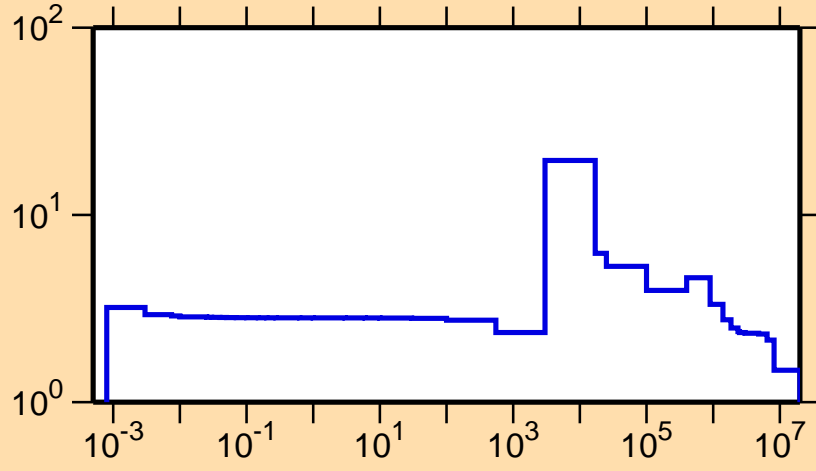

Correlation Matrix





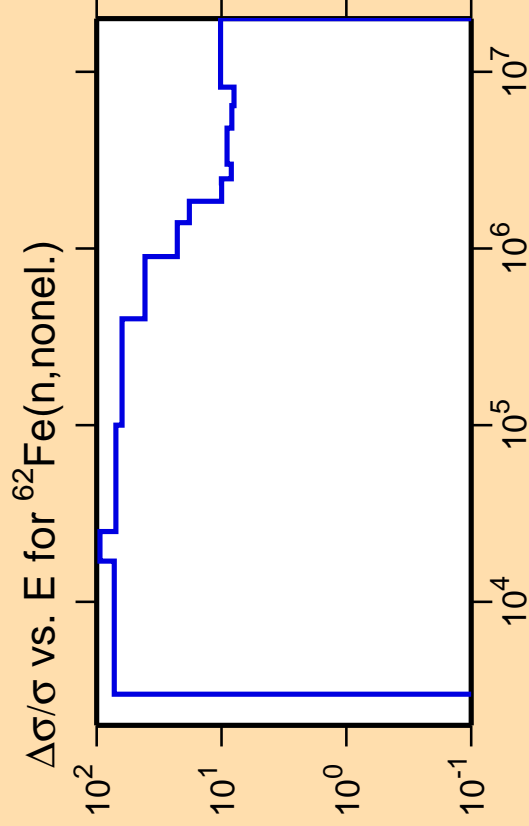


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,\text{el.})$

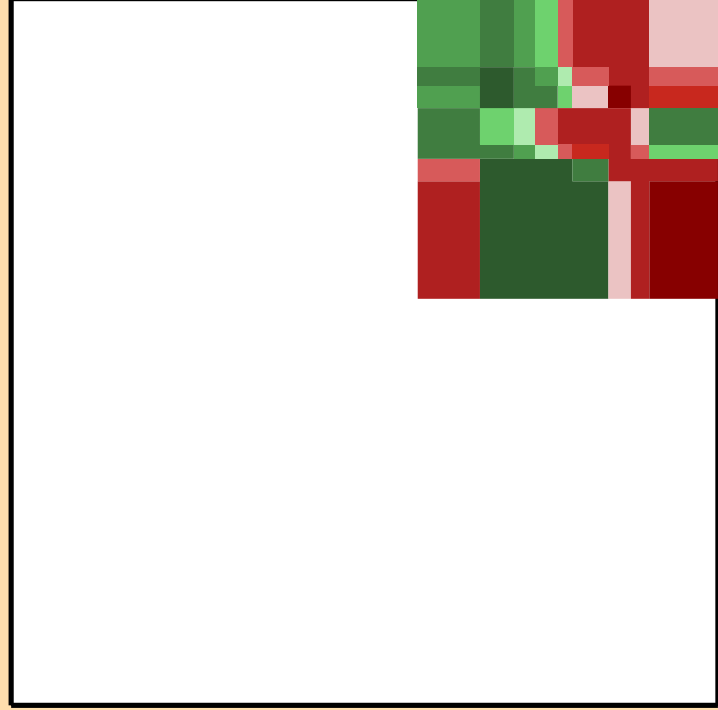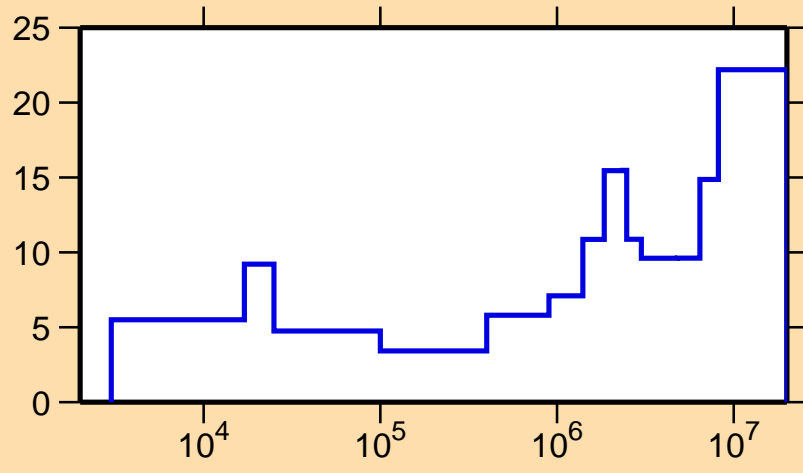

Correlation Matrix


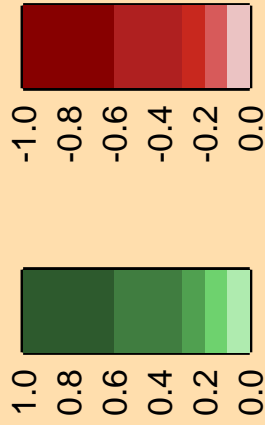


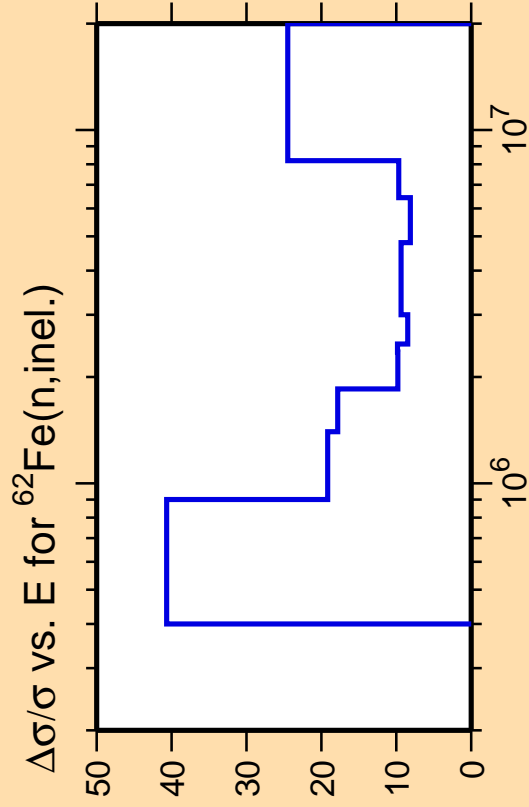


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,\text{el.})$

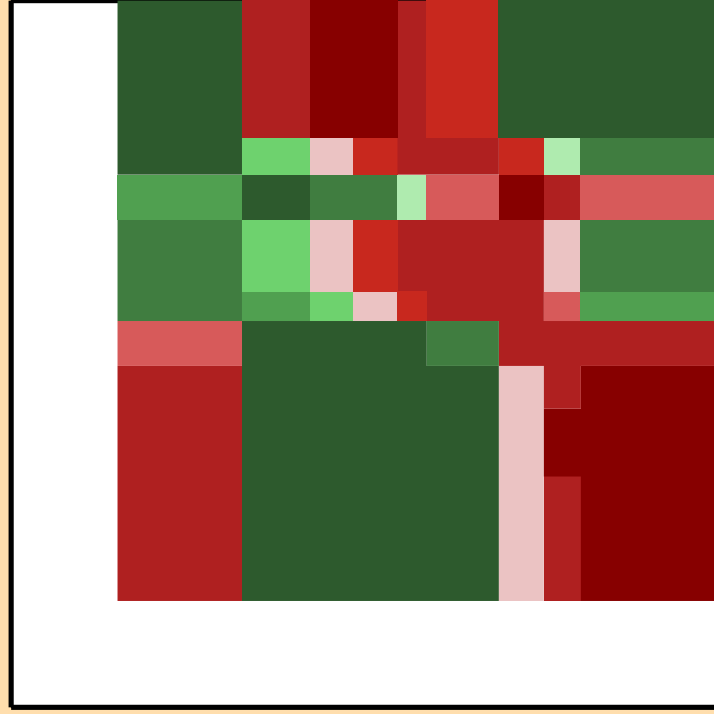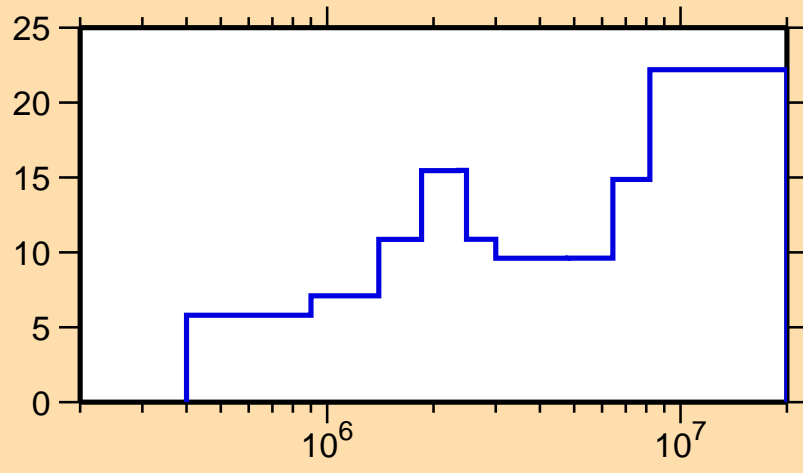

Correlation Matrix


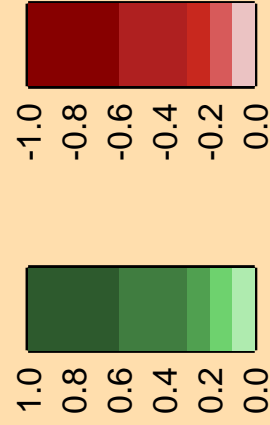


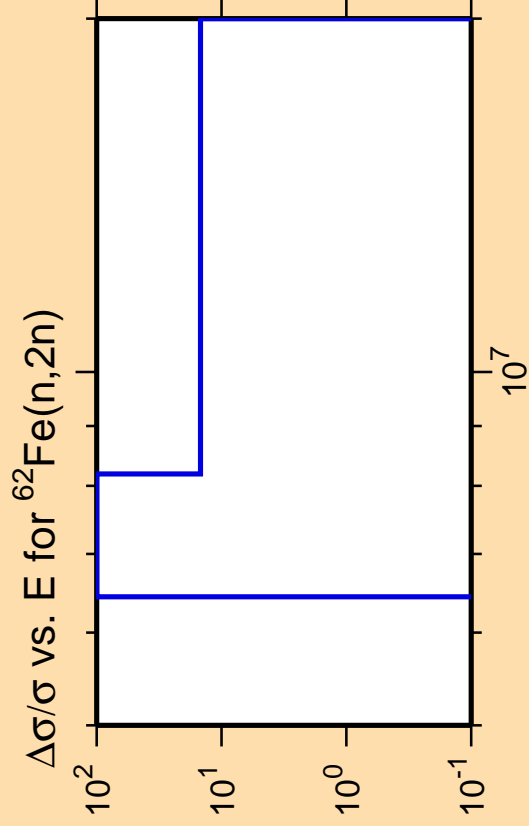


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

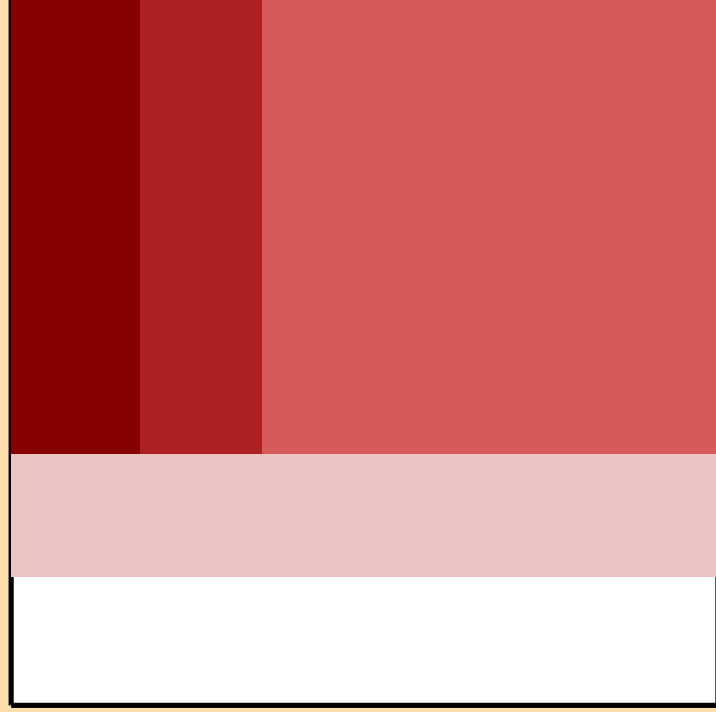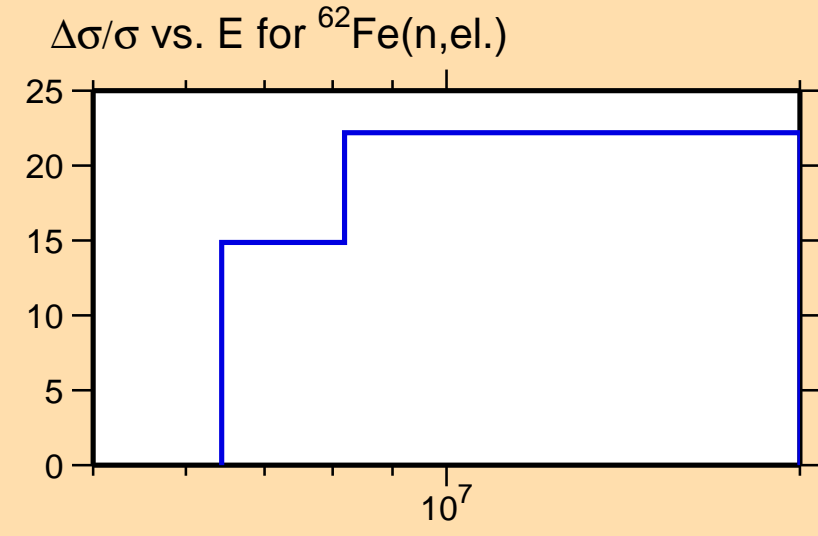

Correlation Matrix

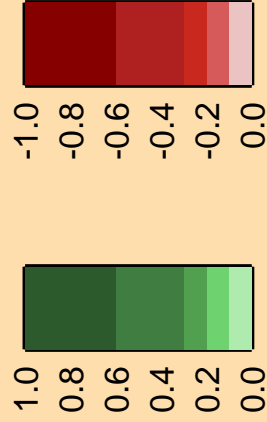


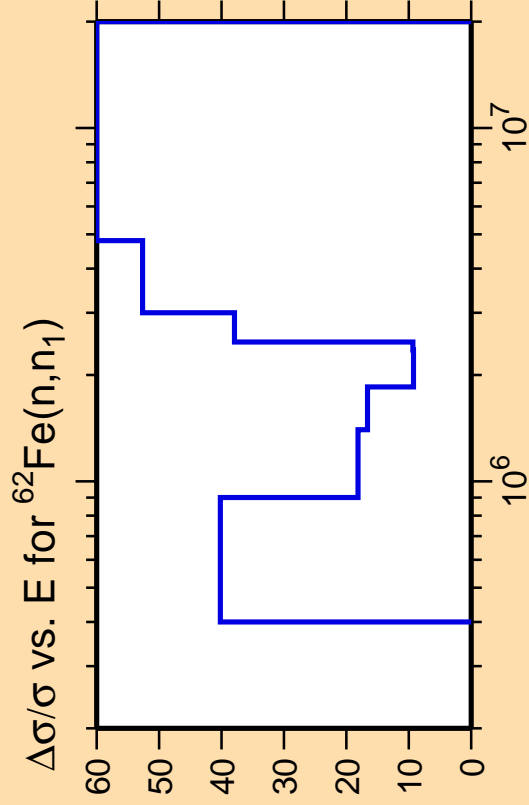


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,\text{el.})$

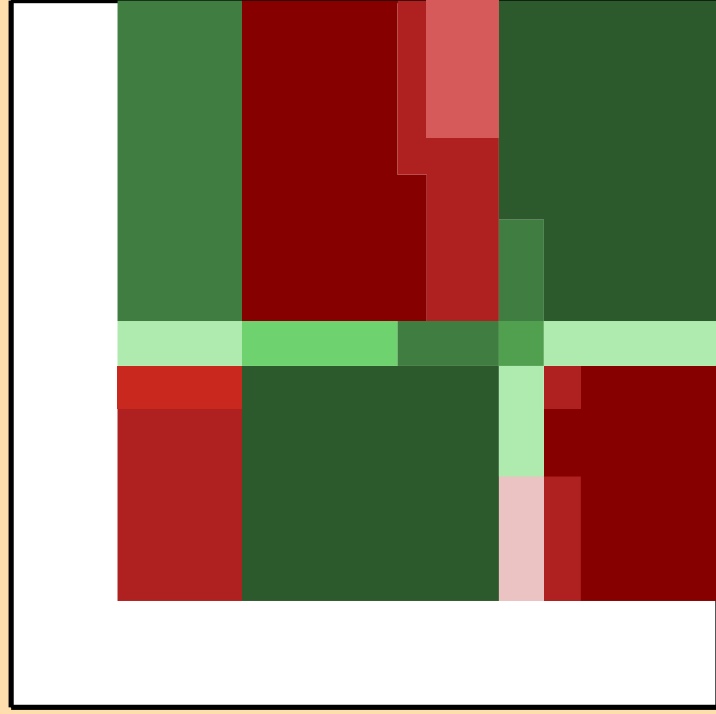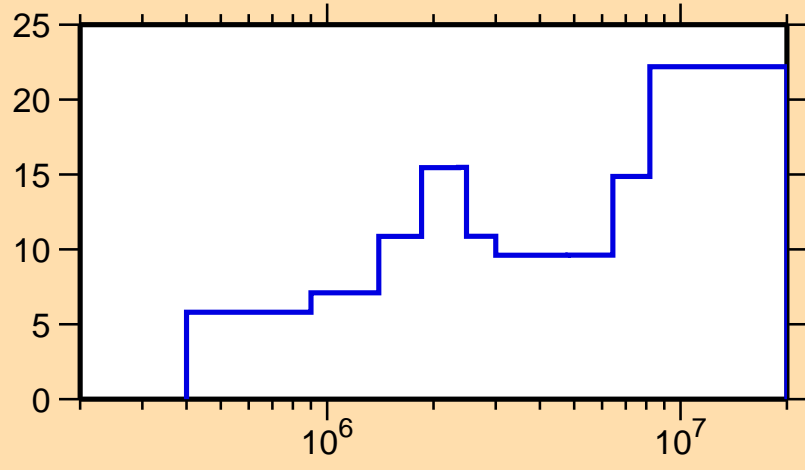



Correlation Matrix



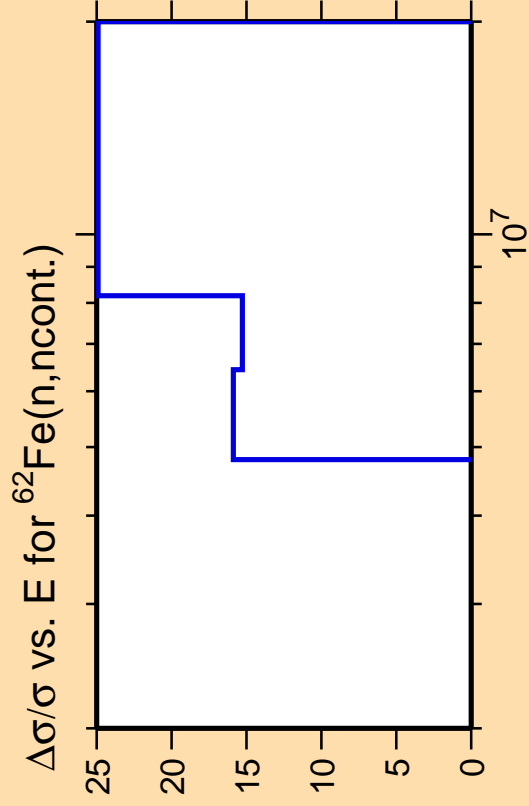



Ordinate scale is %
relative standard deviation.

Abcissa scales are energy (eV).

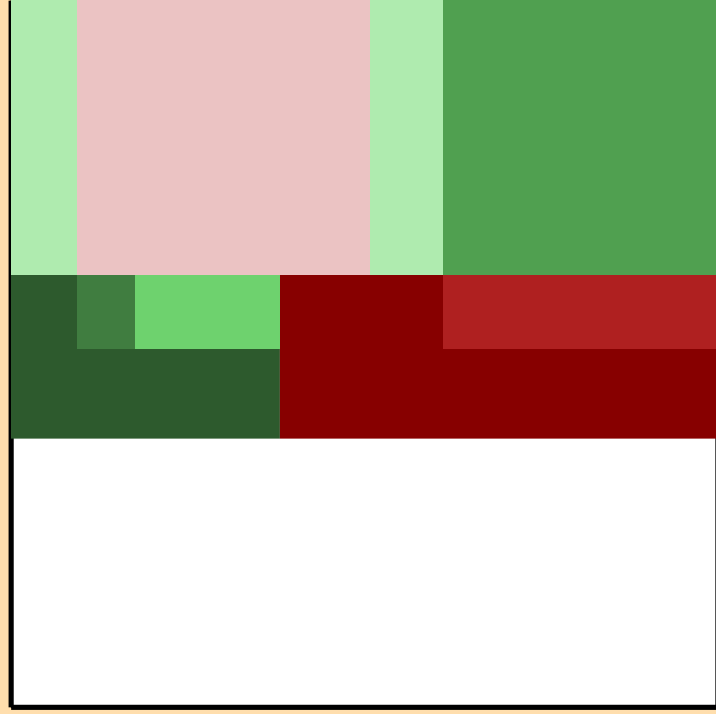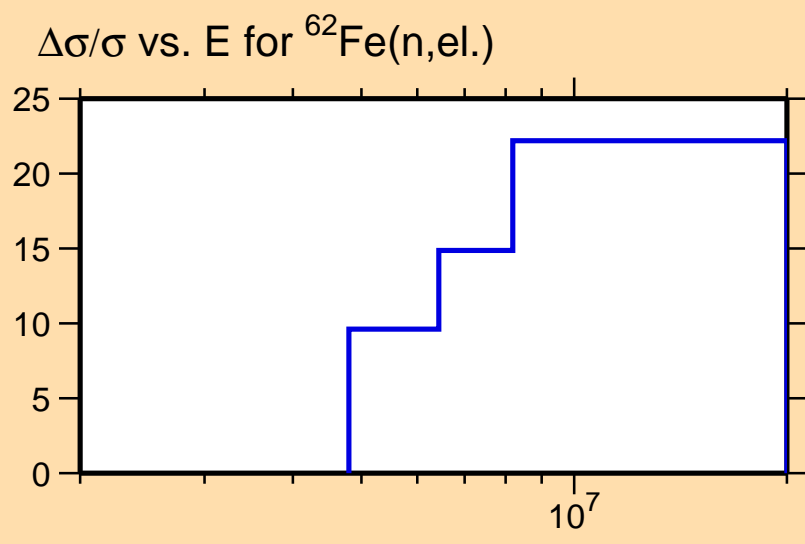

Correlation Matrix


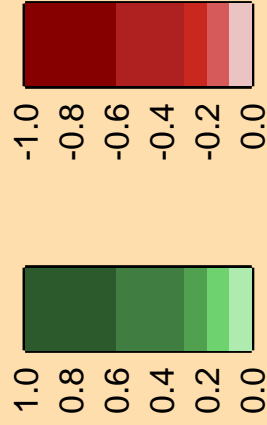


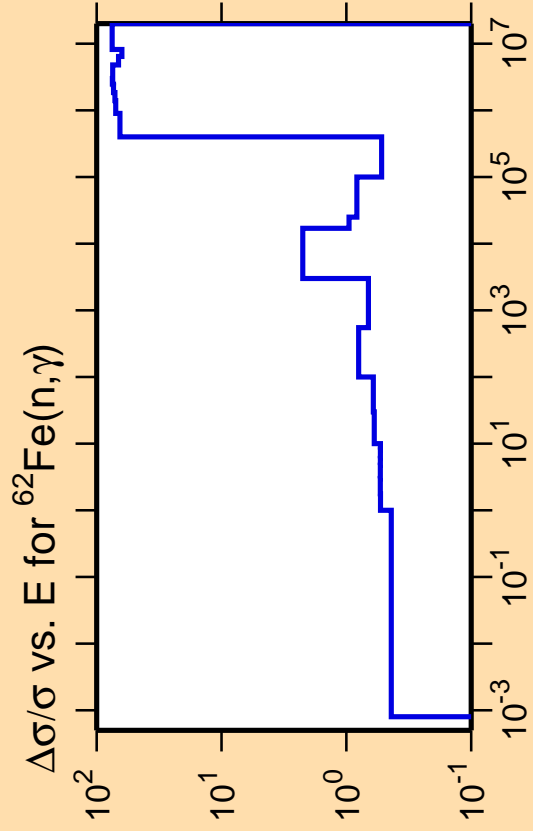

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,\text{el.})$

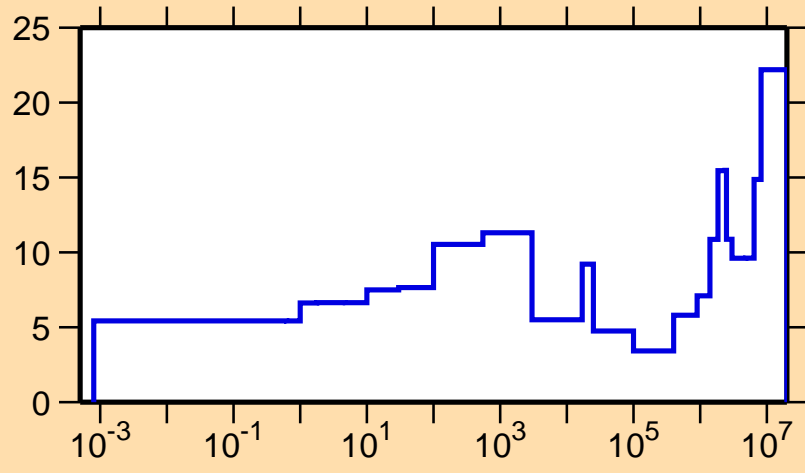

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,p)$


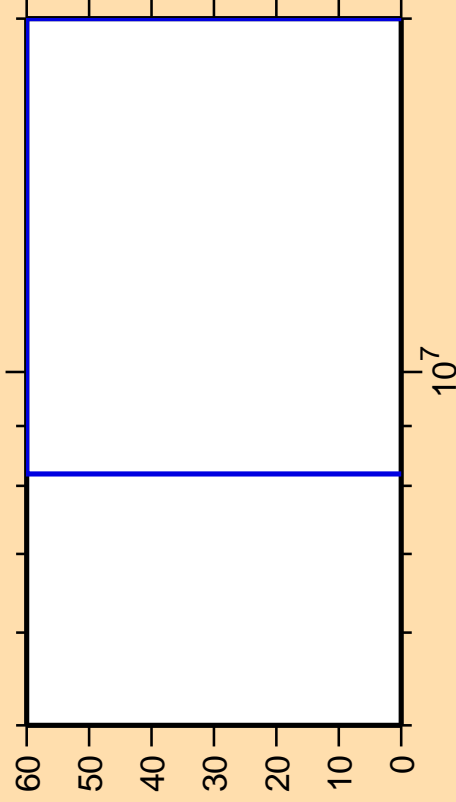


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,el.)$

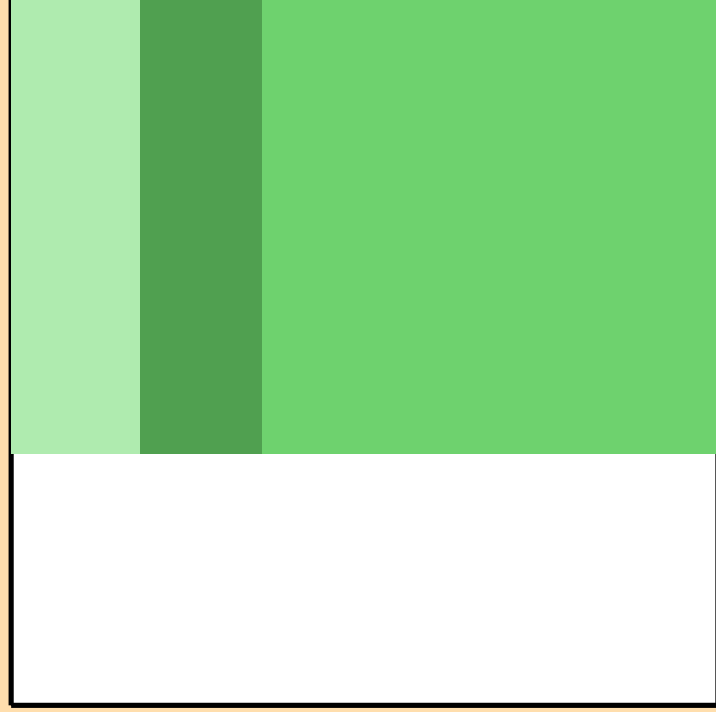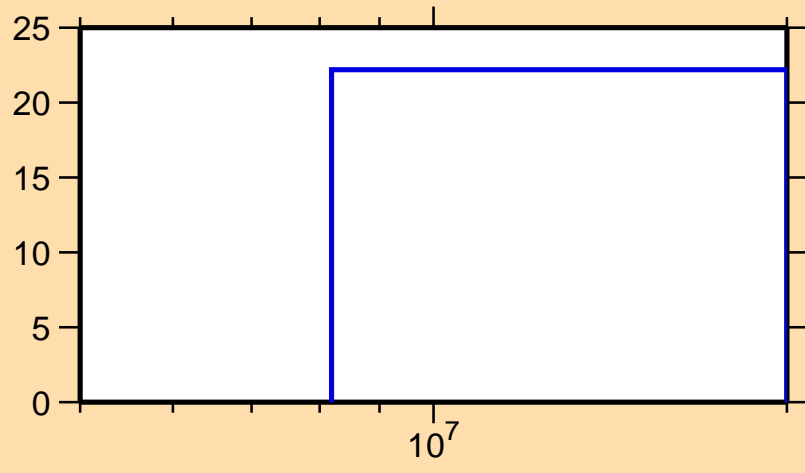

Correlation Matrix


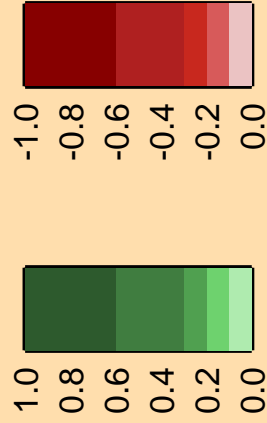


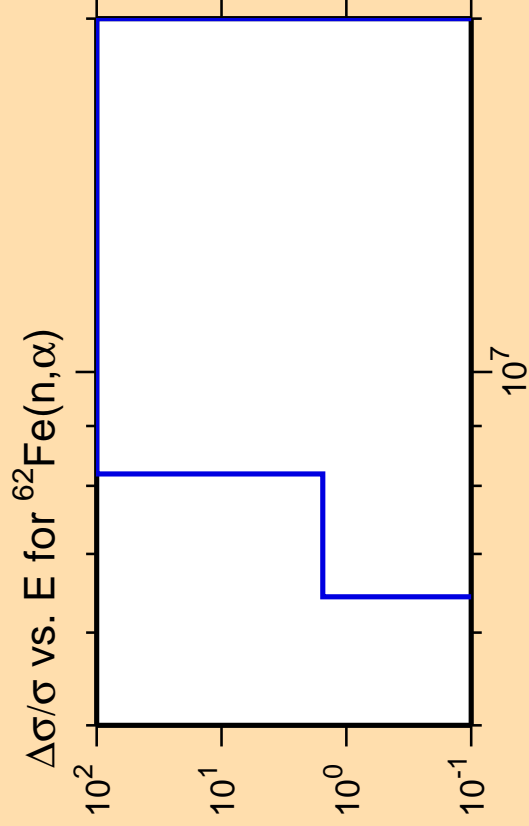


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

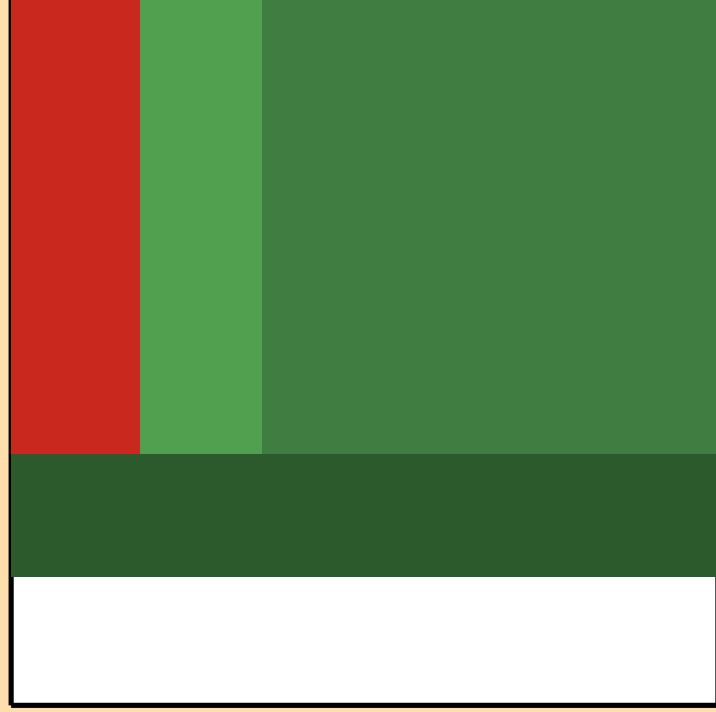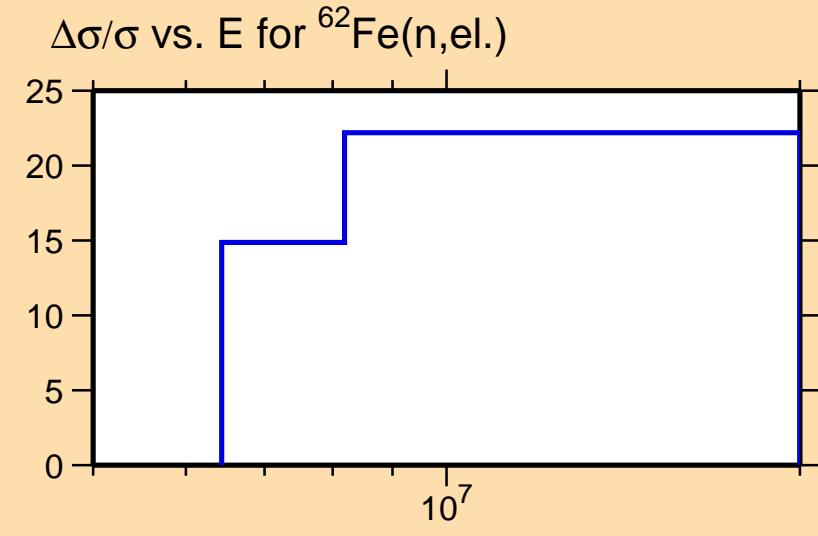



Correlation Matrix

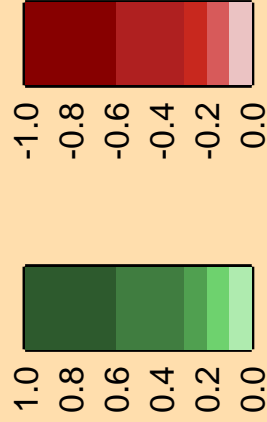

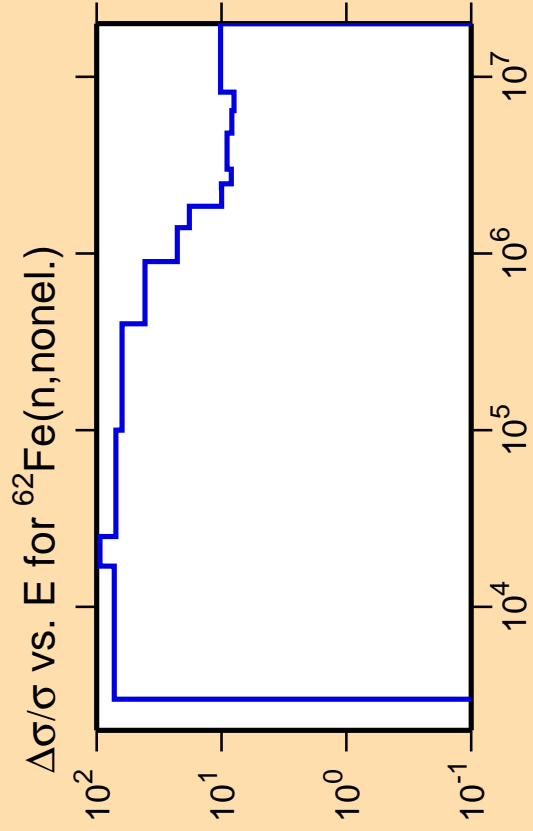


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

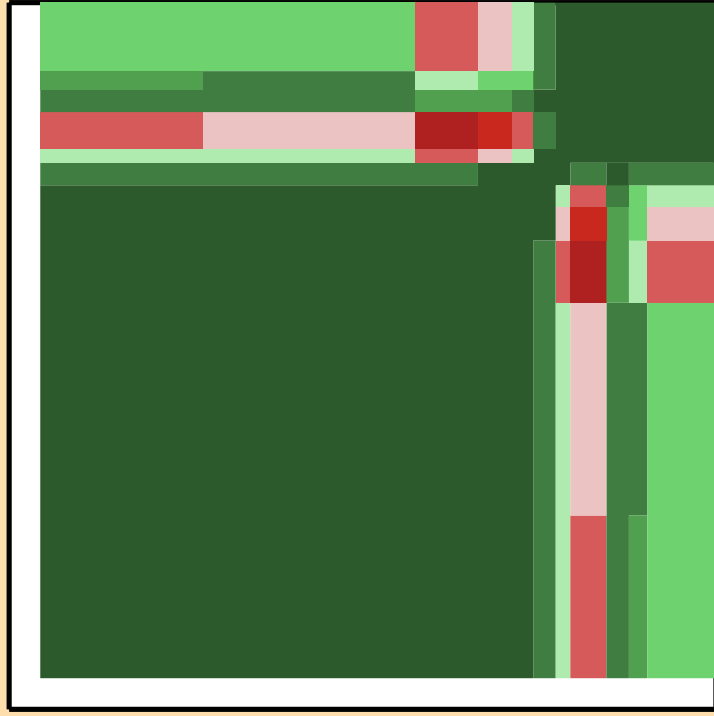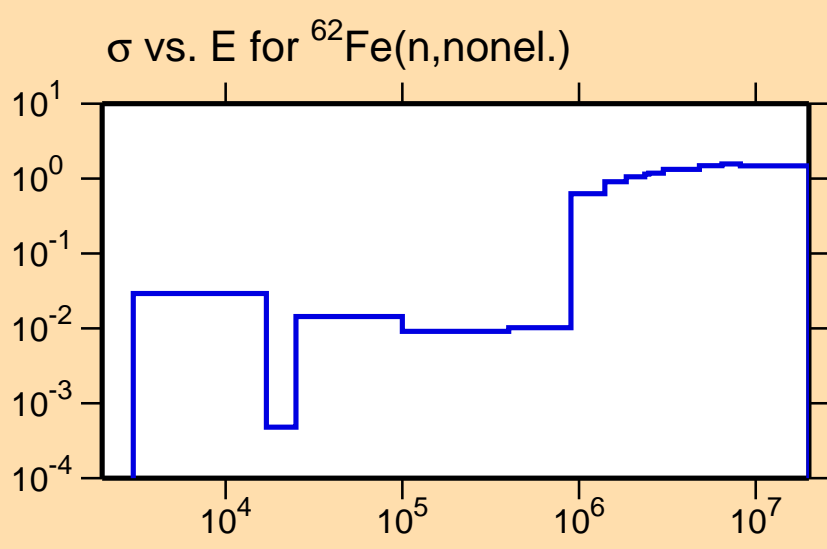

Correlation Matrix





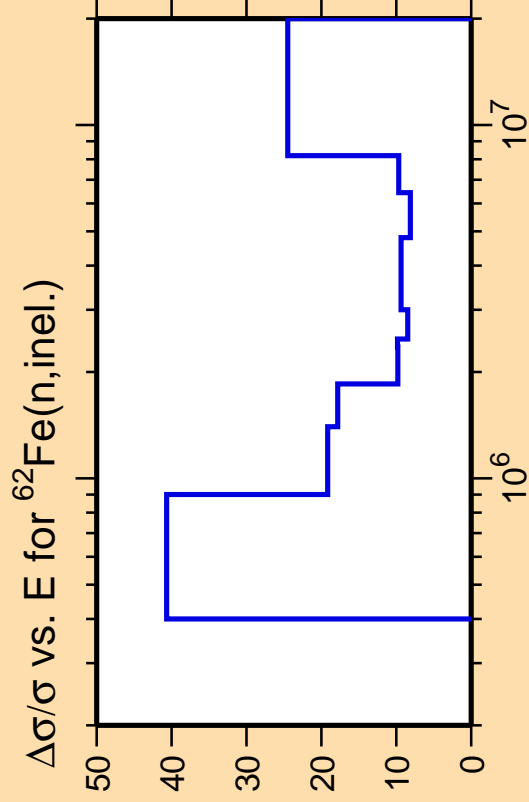

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,\text{nonel.})$

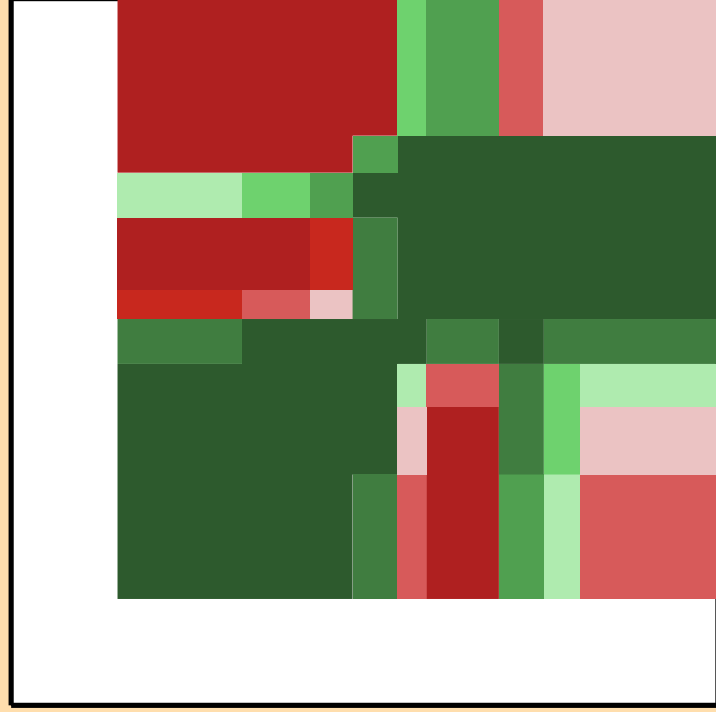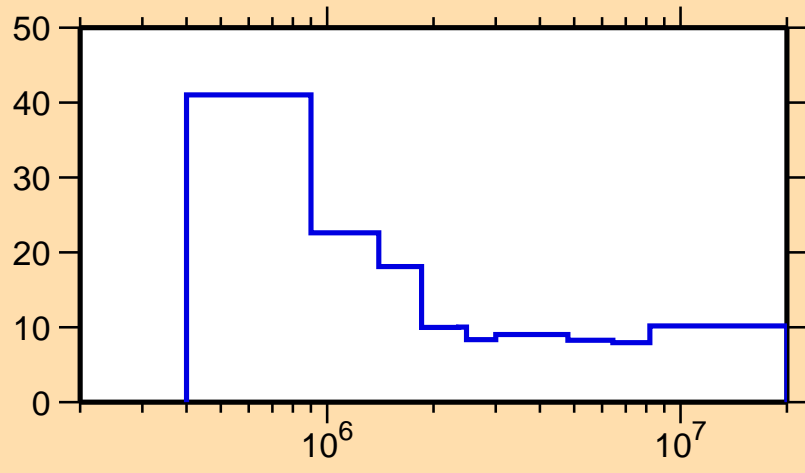

Correlation Matrix





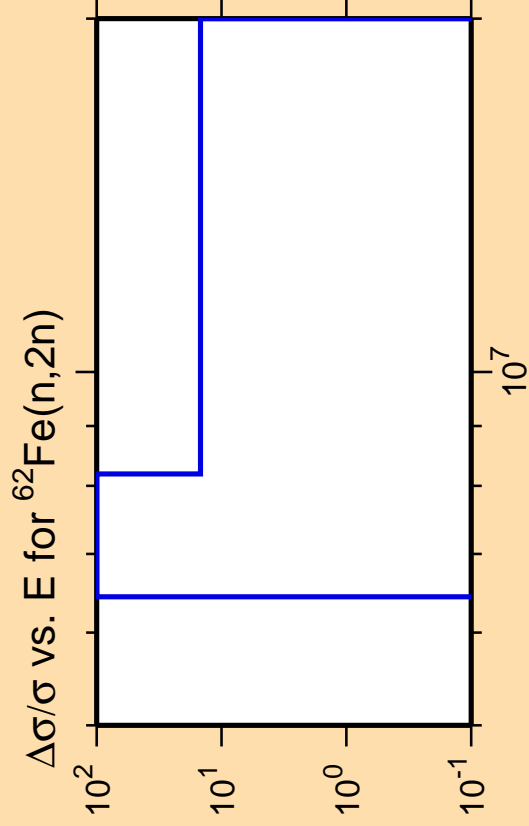


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

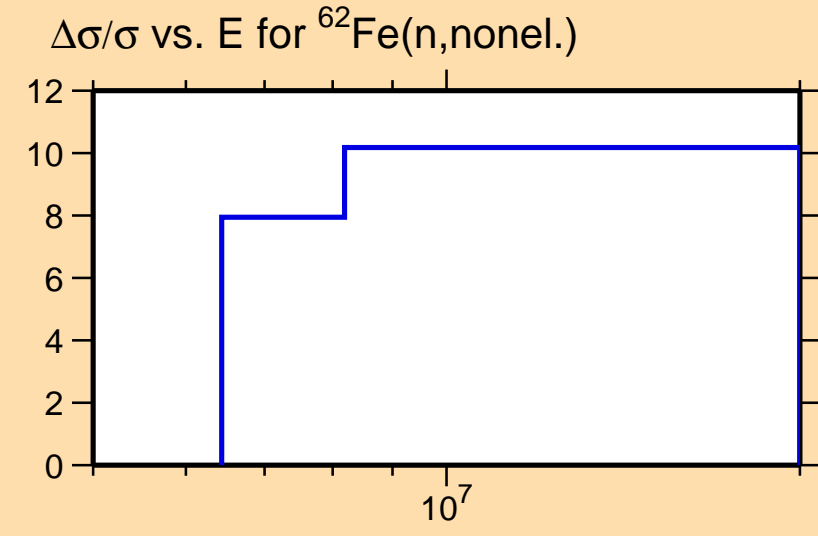

Correlation Matrix

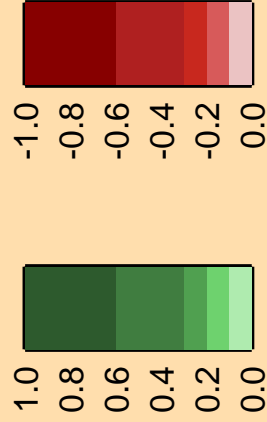


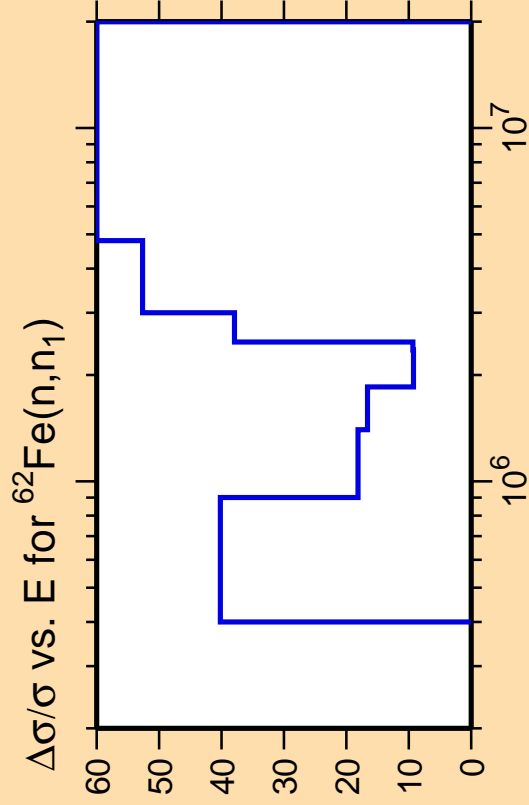


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,\text{nonel.})$

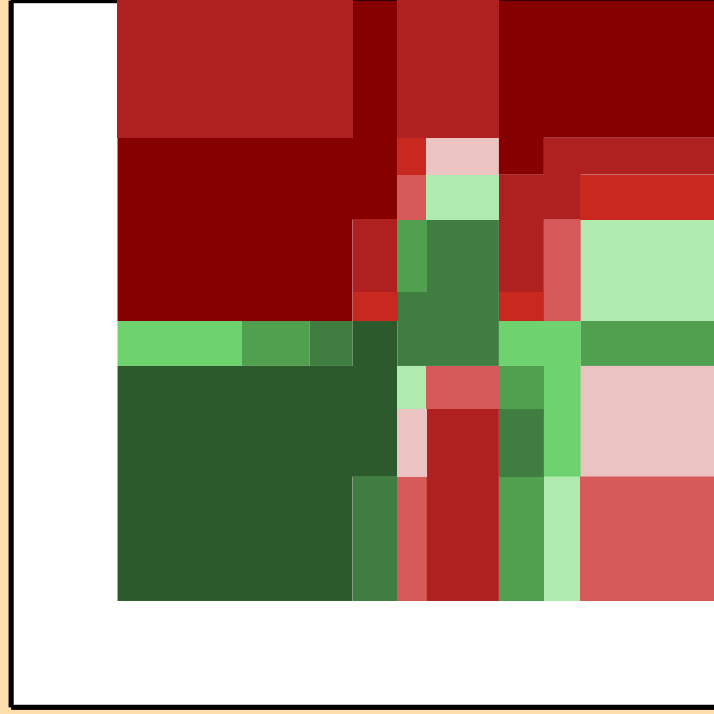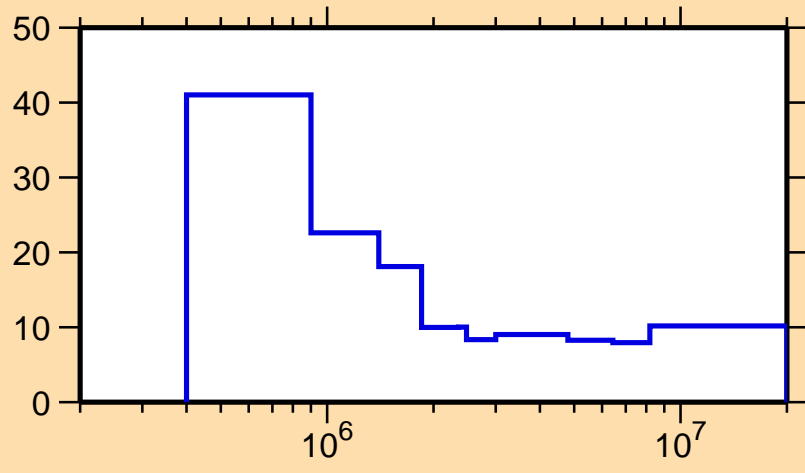



Correlation Matrix



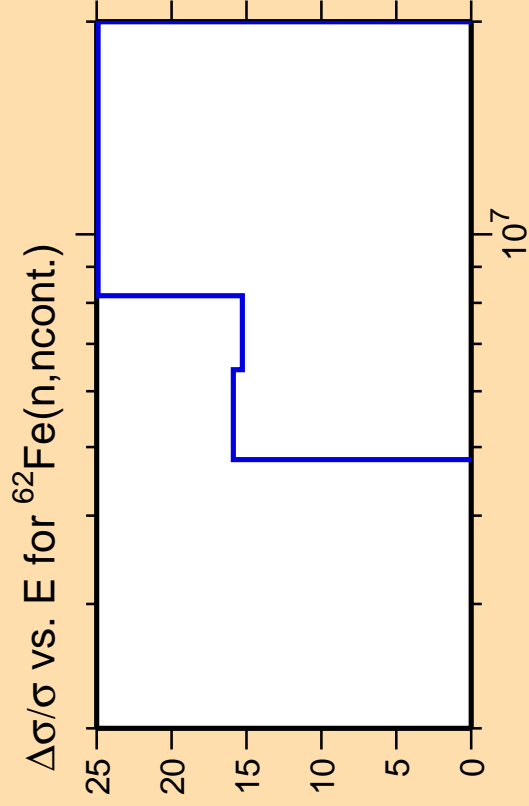



Ordinate scale is %
relative standard deviation.

Abcissa scales are energy (eV).

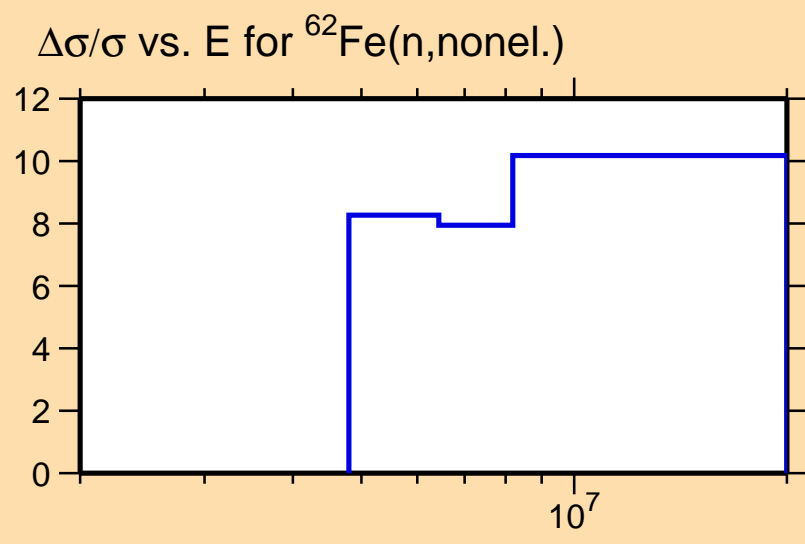



Correlation Matrix

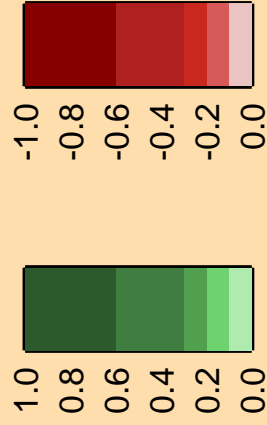

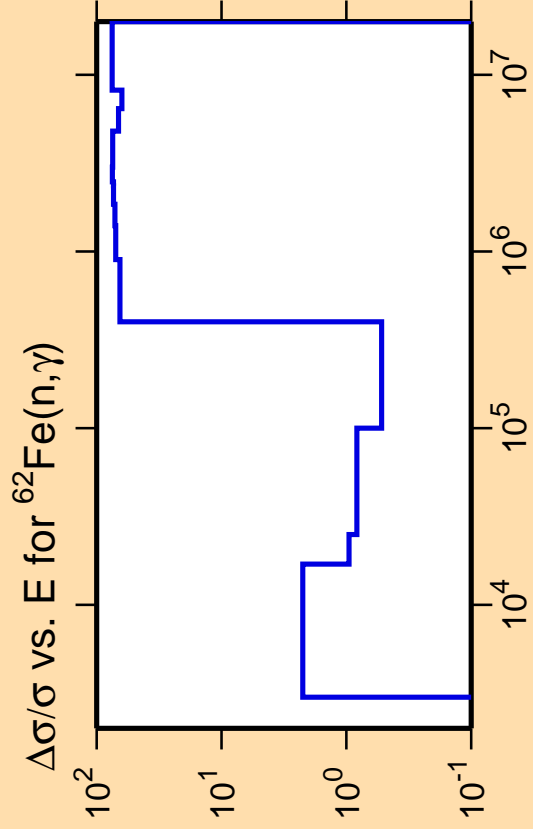


Ordinate scale is %
relative standard deviation.


Abcissa scales are energy (eV).

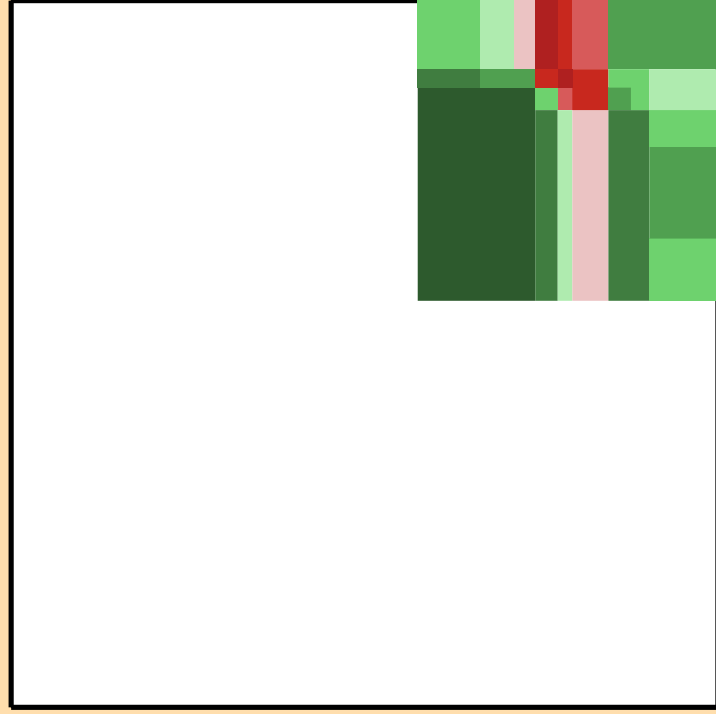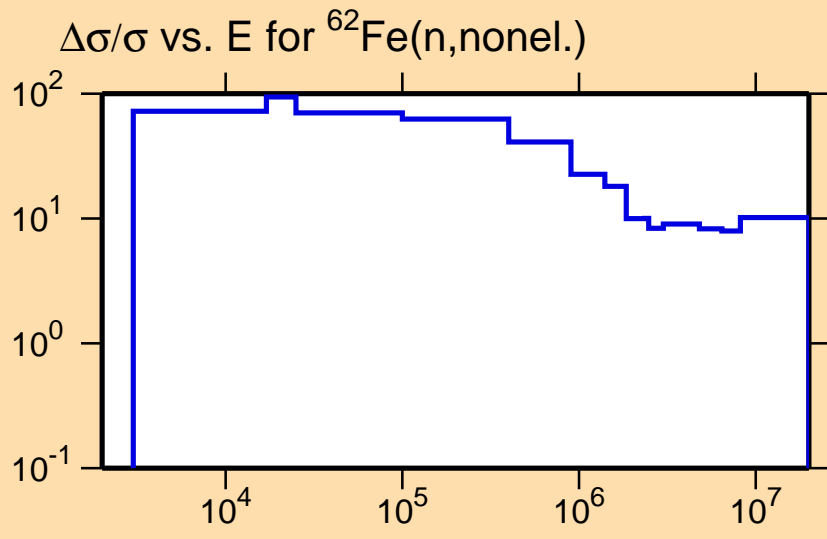

Correlation Matrix

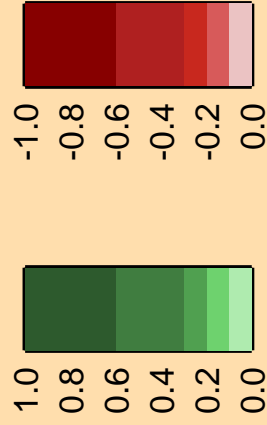

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,p)$

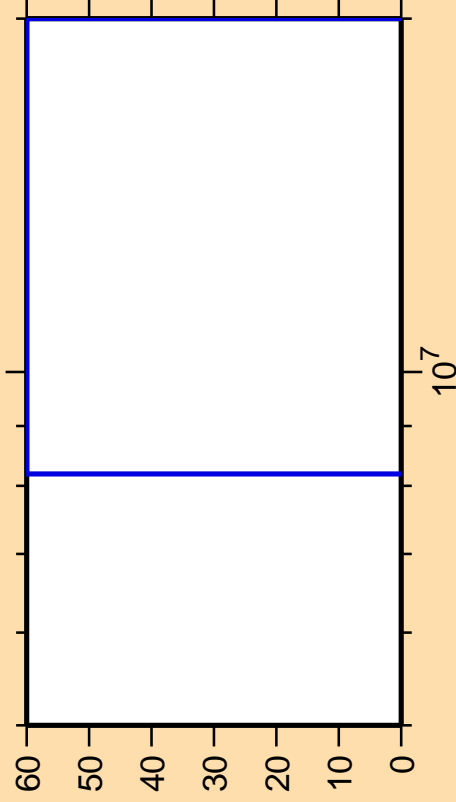


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,\text{nonel.})$

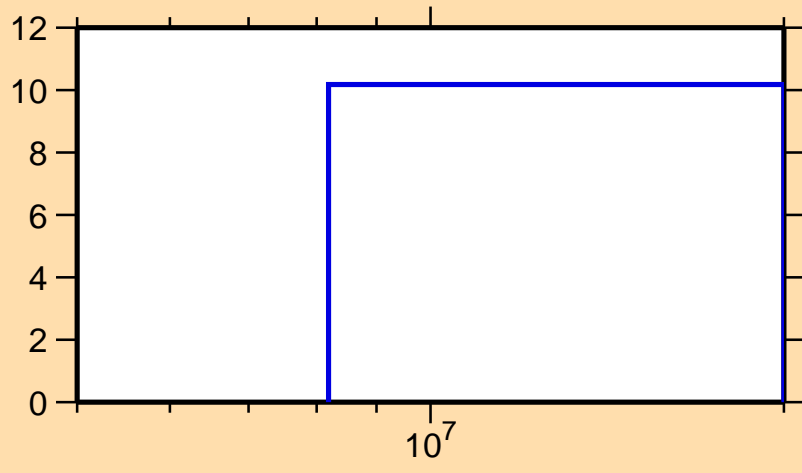

Correlation Matrix




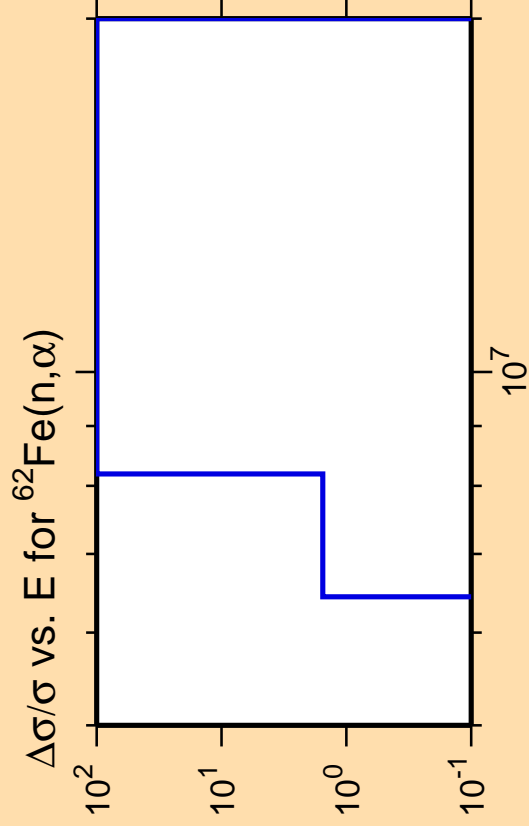


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,\text{nonel.})$

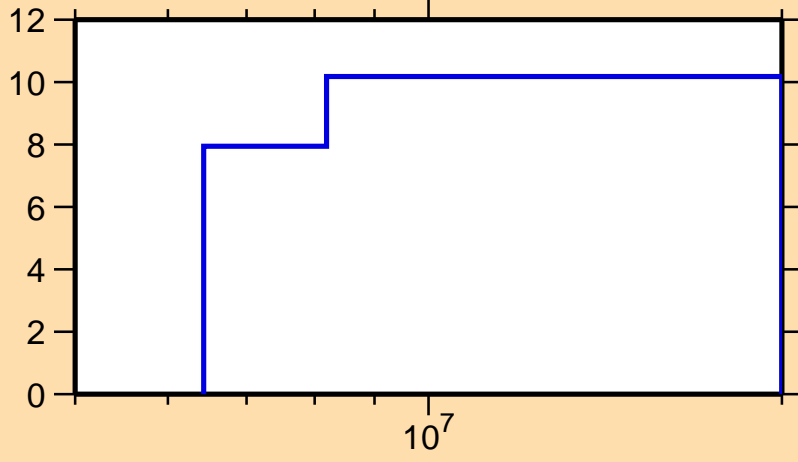



Correlation Matrix

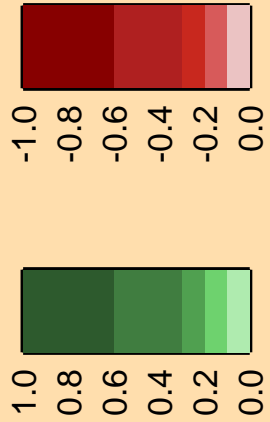

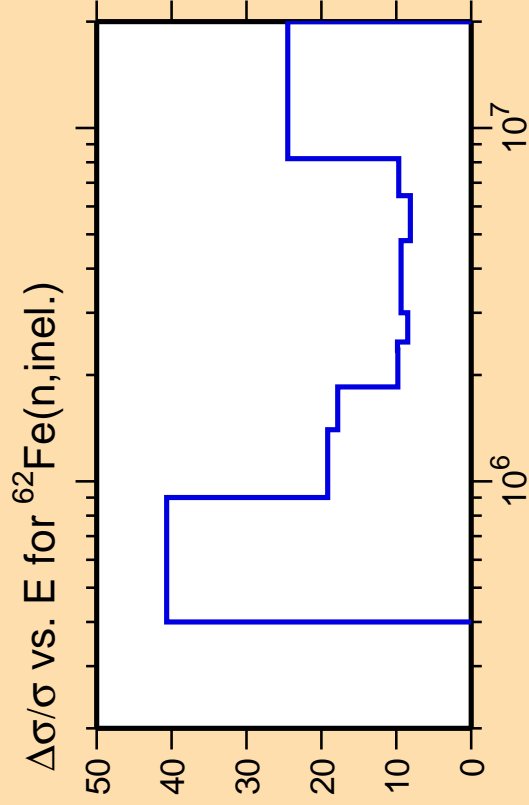


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

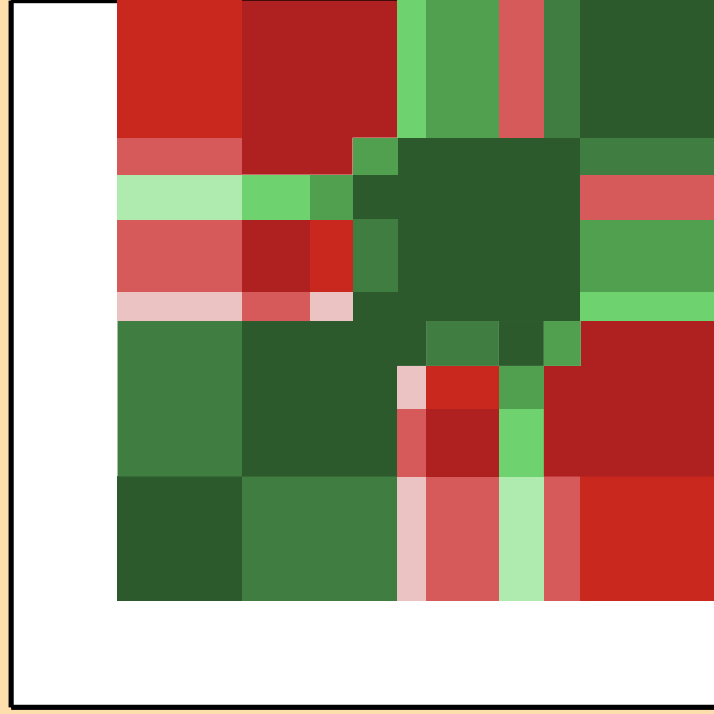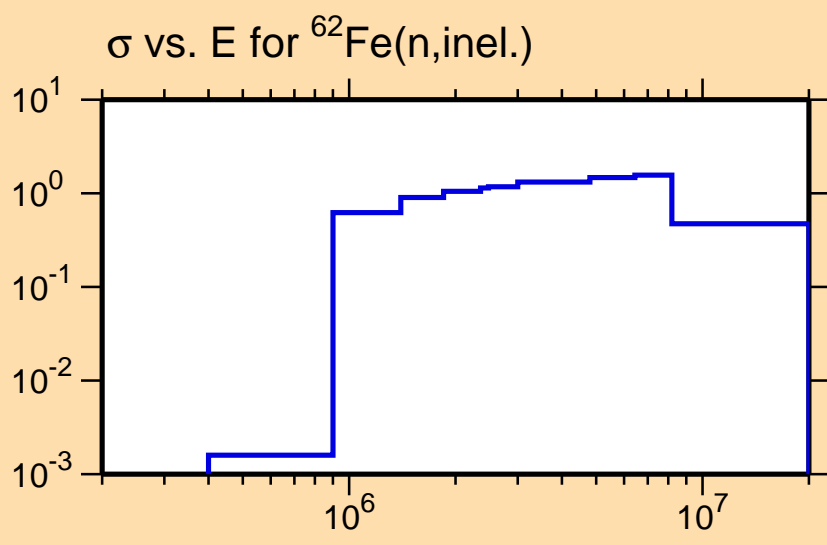

Correlation Matrix





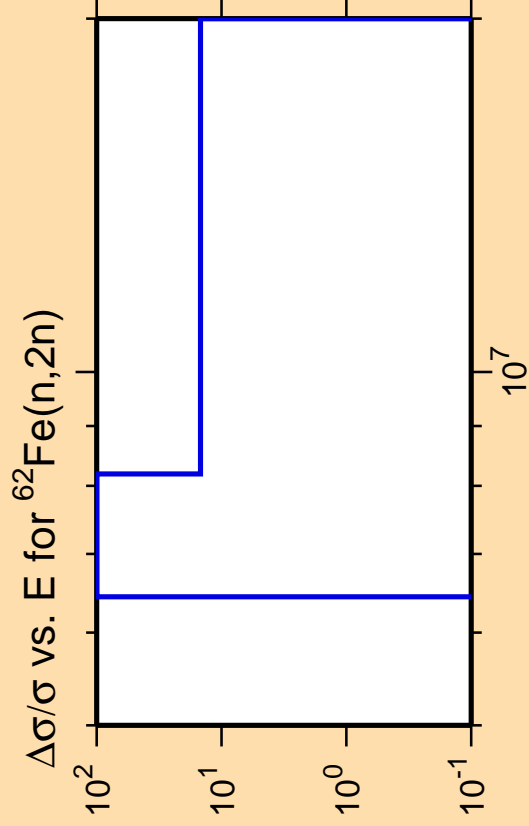


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

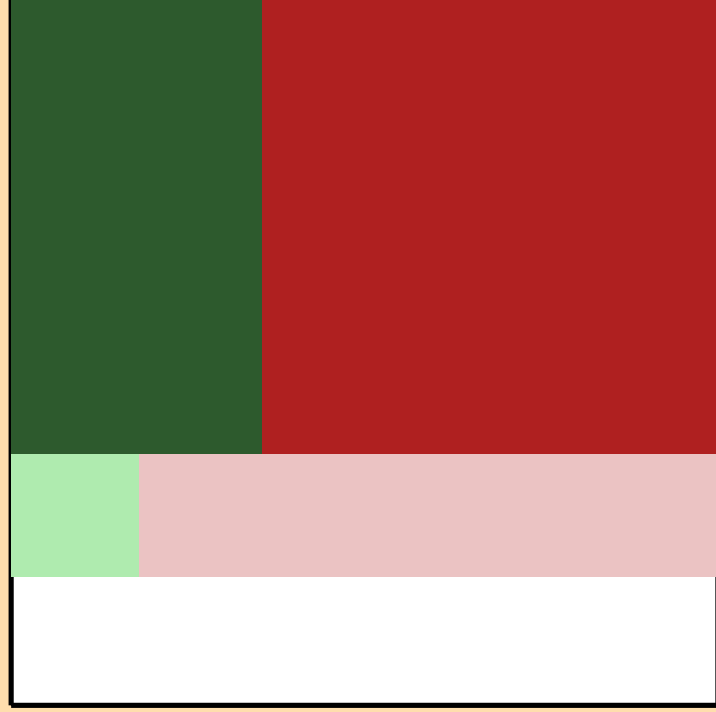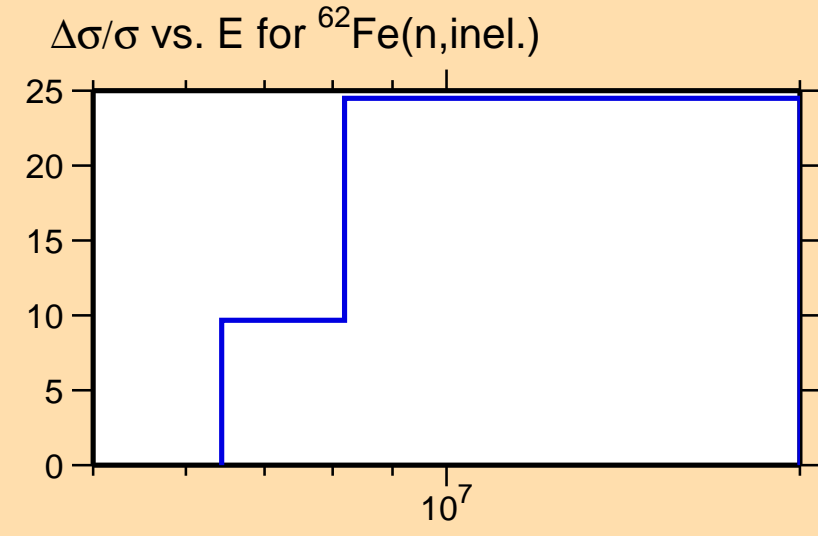

Correlation Matrix

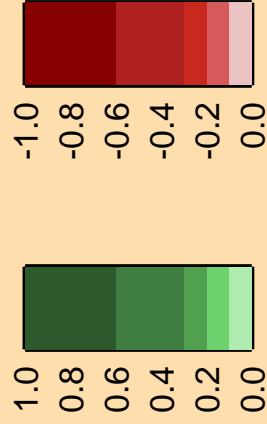


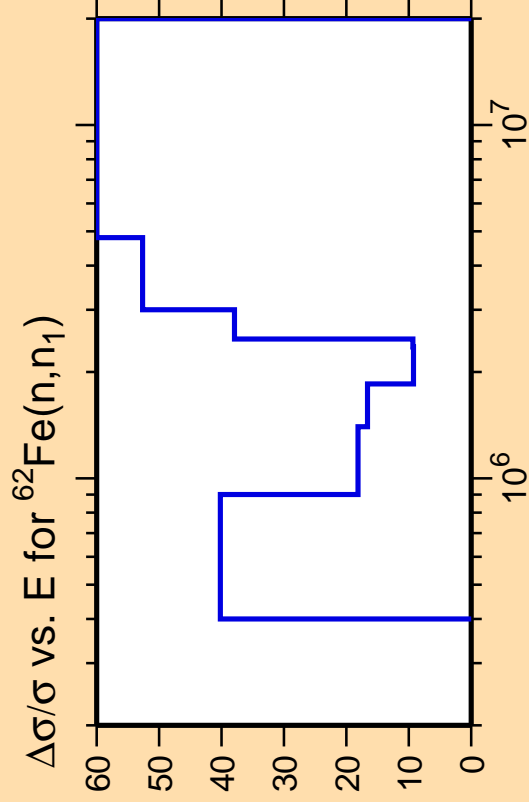


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,\text{inel.})$

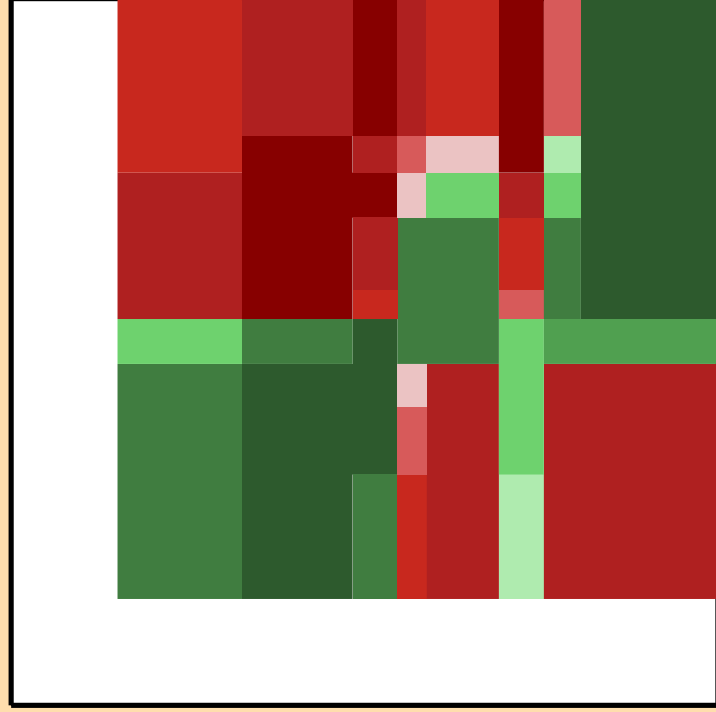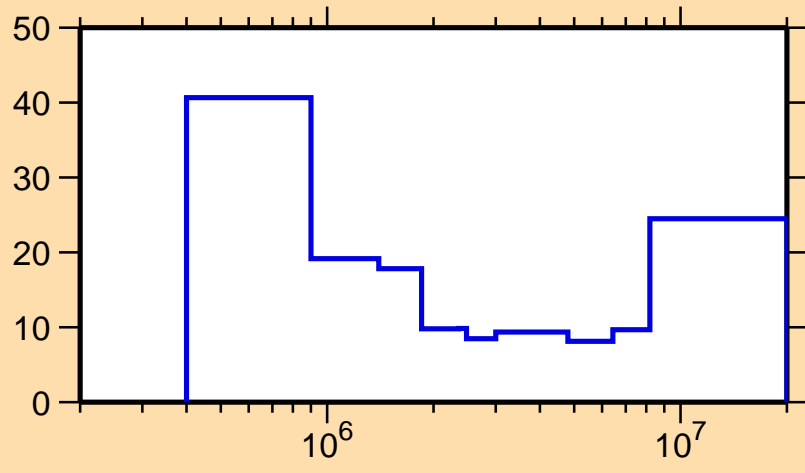



Correlation Matrix



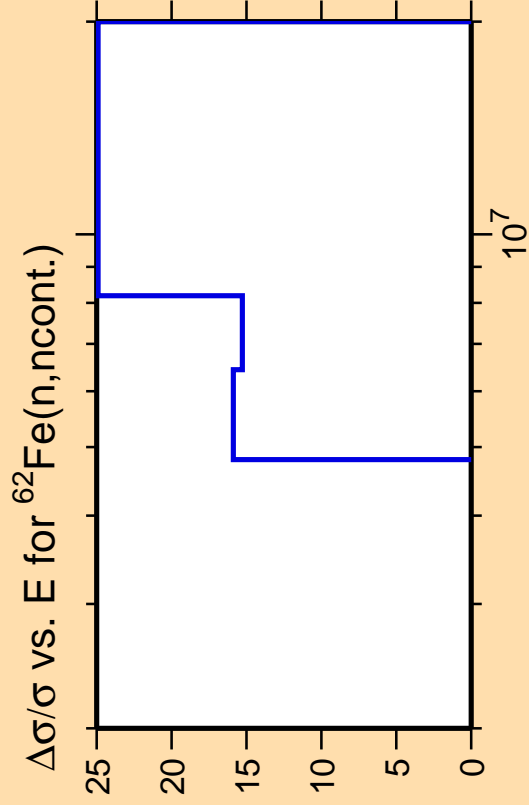



Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

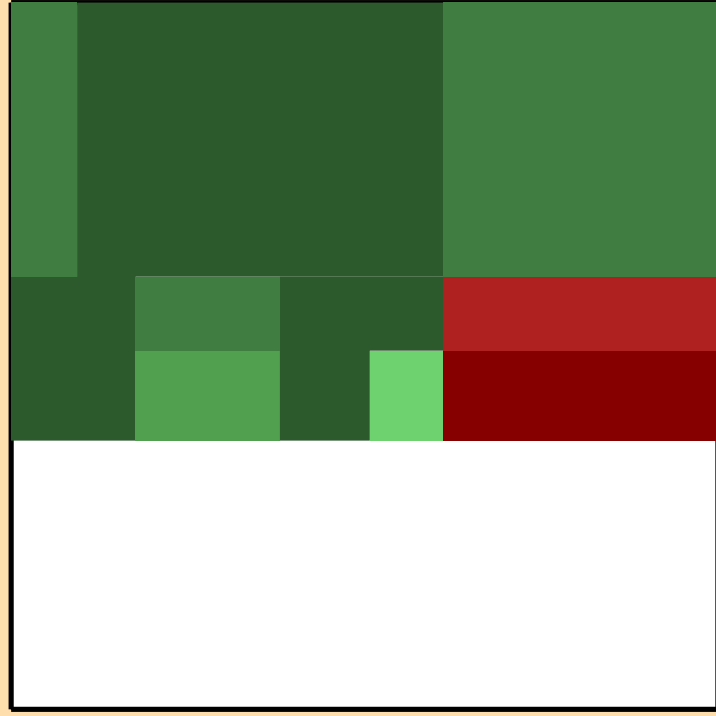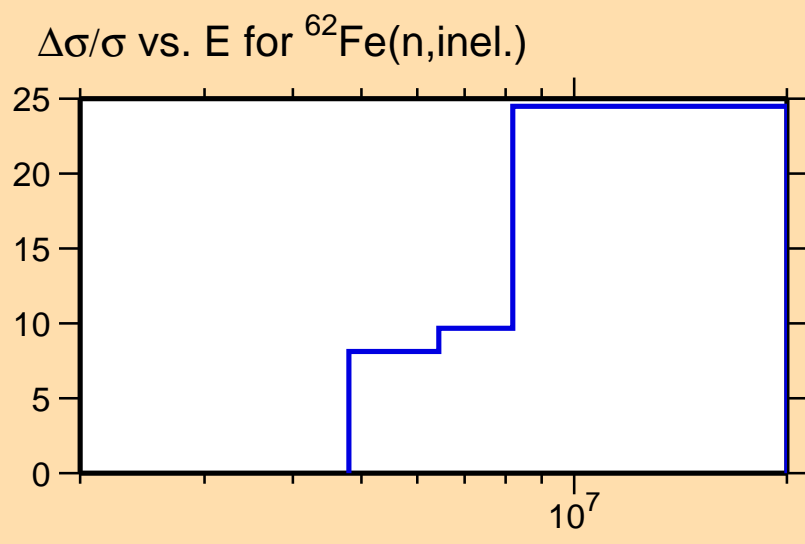

Correlation Matrix

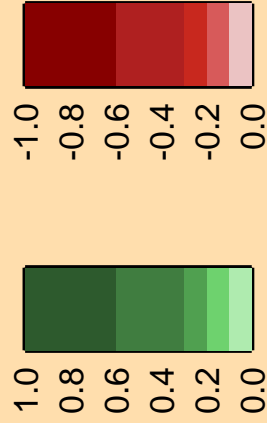


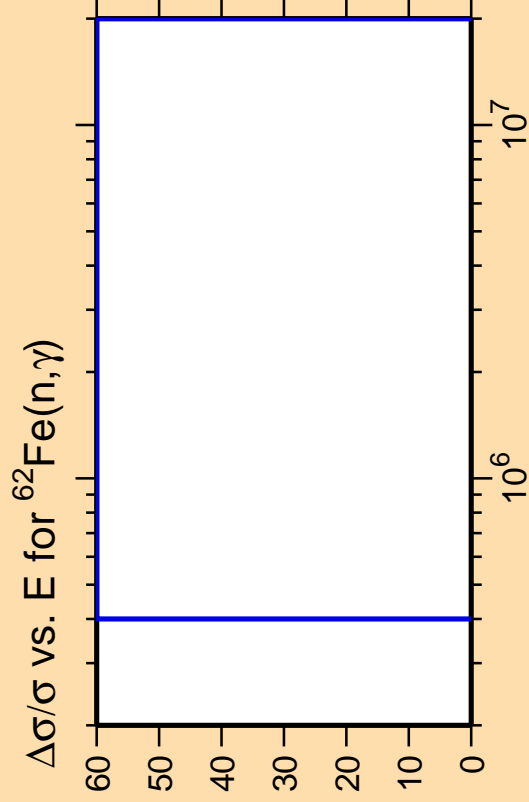


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,\text{inel.})$

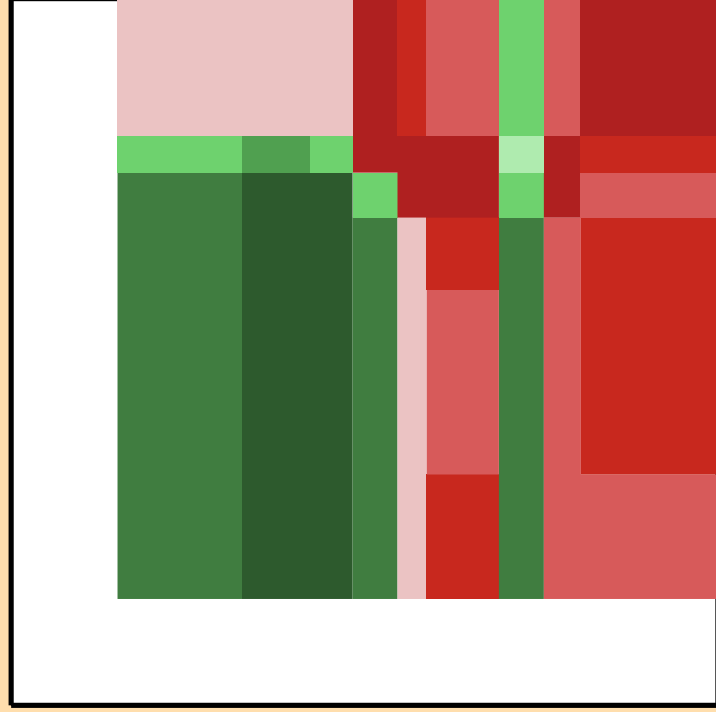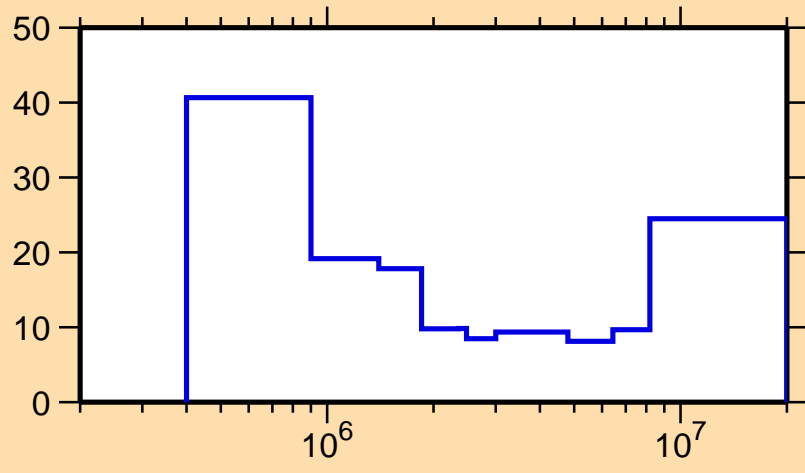

Correlation Matrix

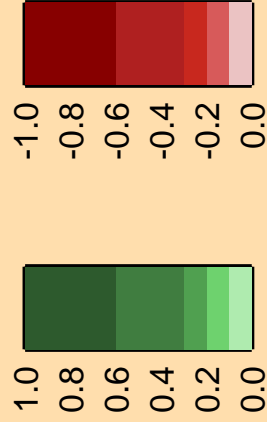

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,p)$


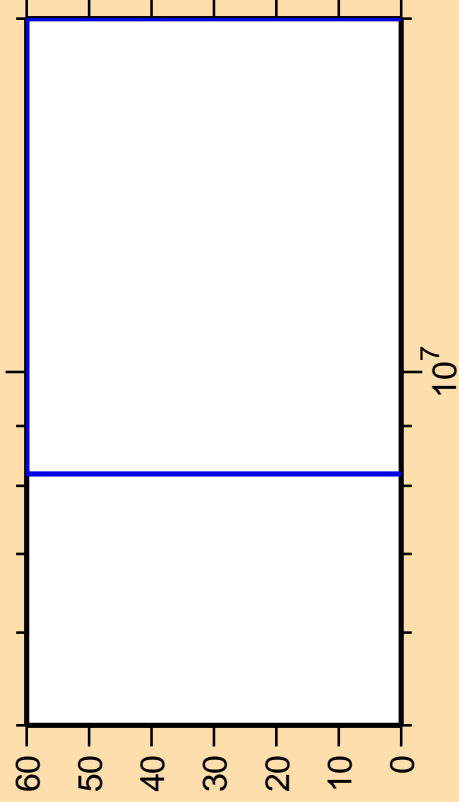


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,\text{inel.})$

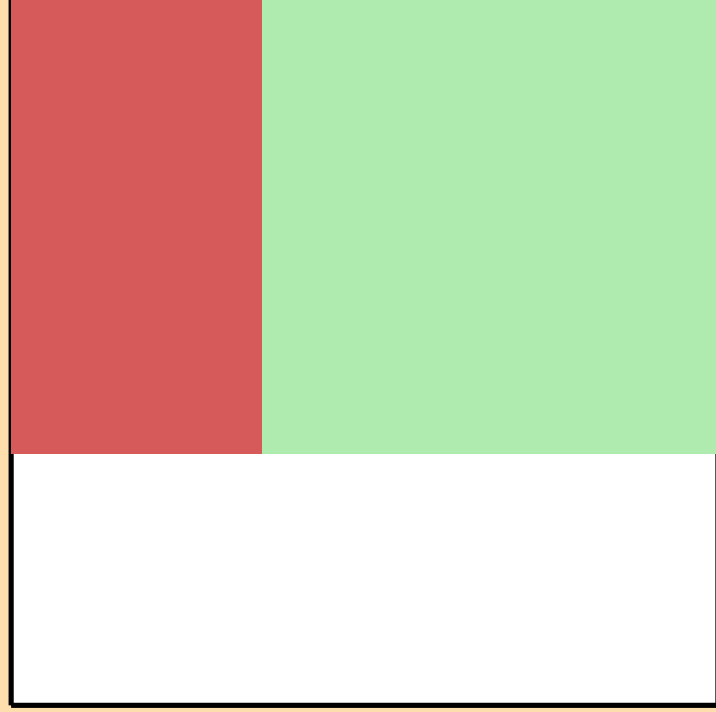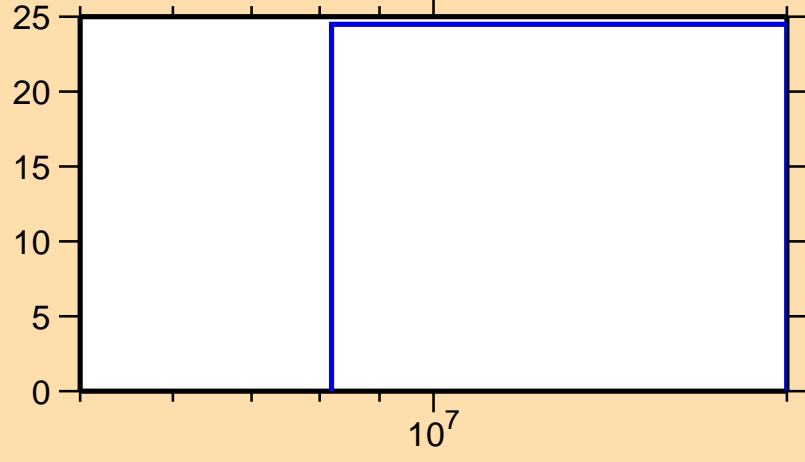

Correlation Matrix





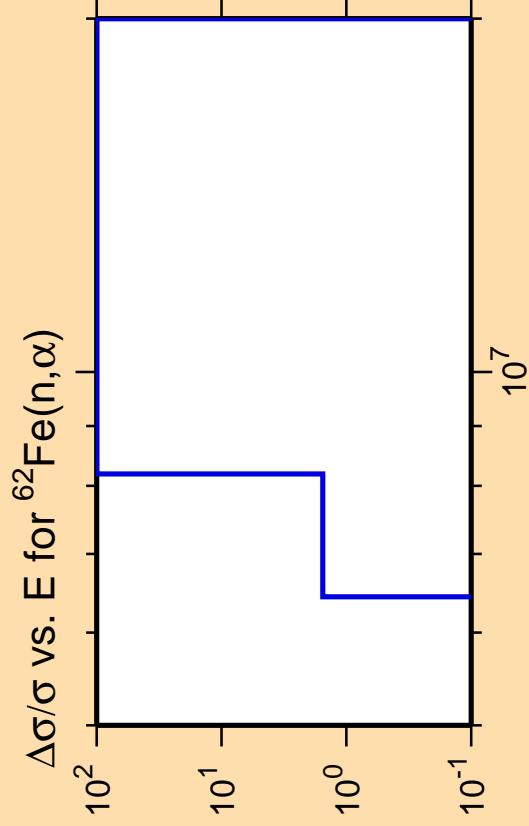


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

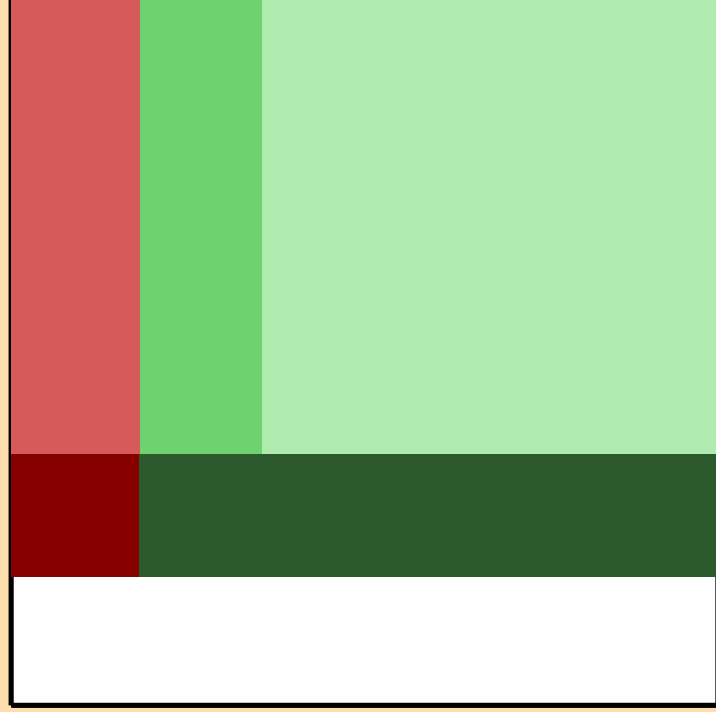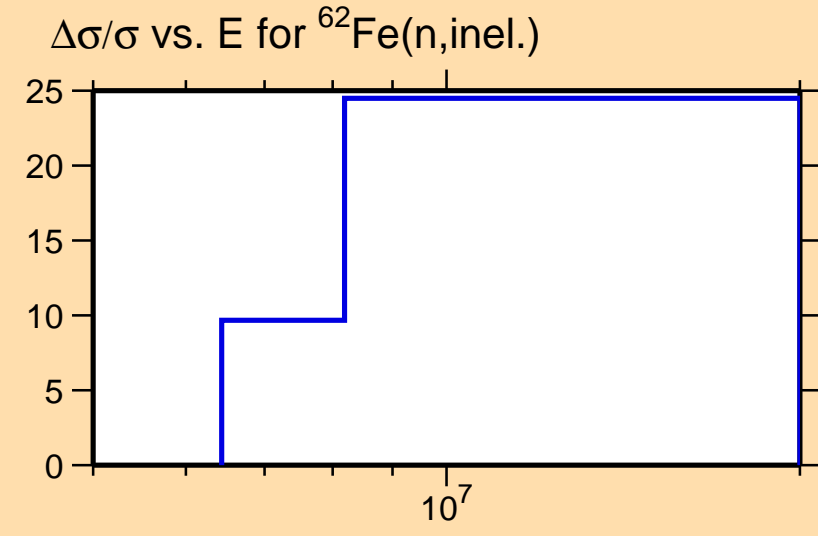

Correlation Matrix


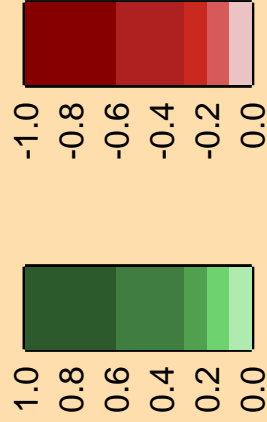


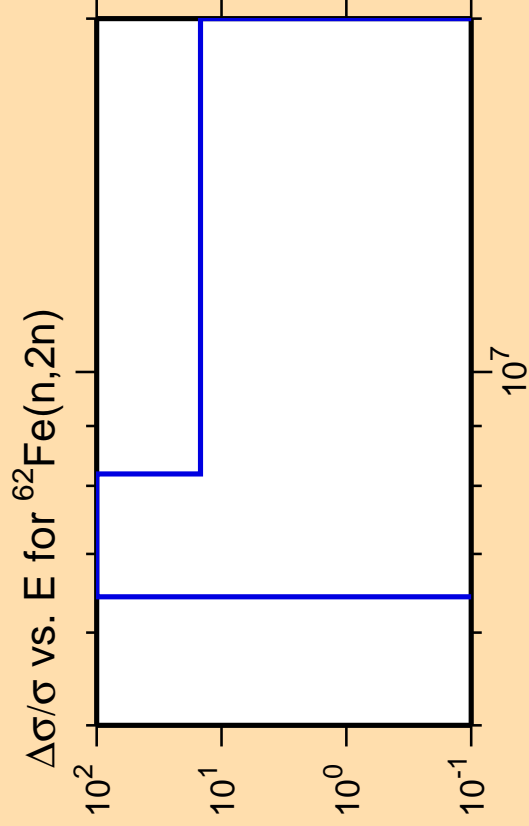


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

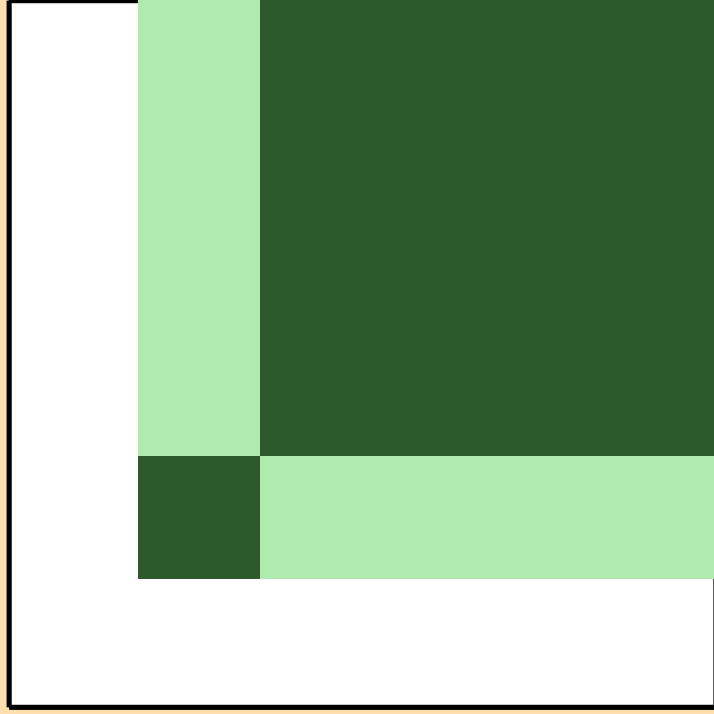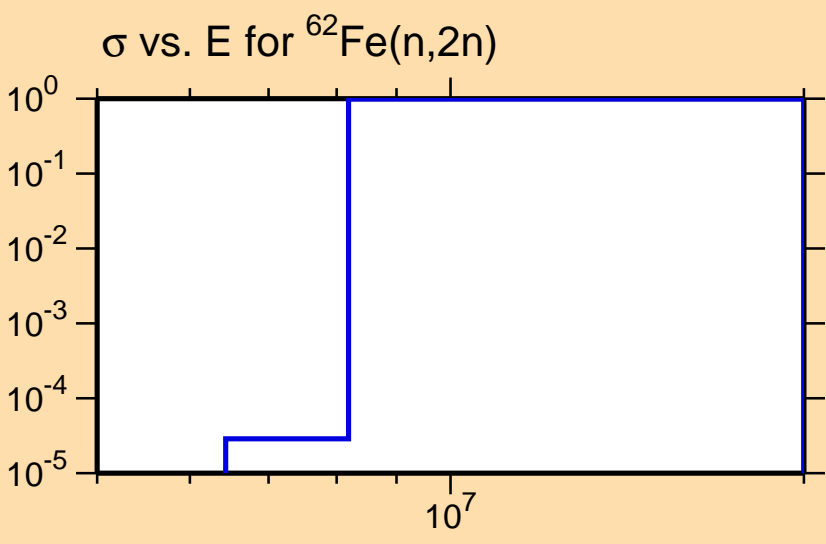

Correlation Matrix

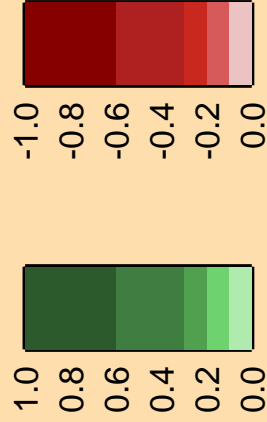

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,n_1)$


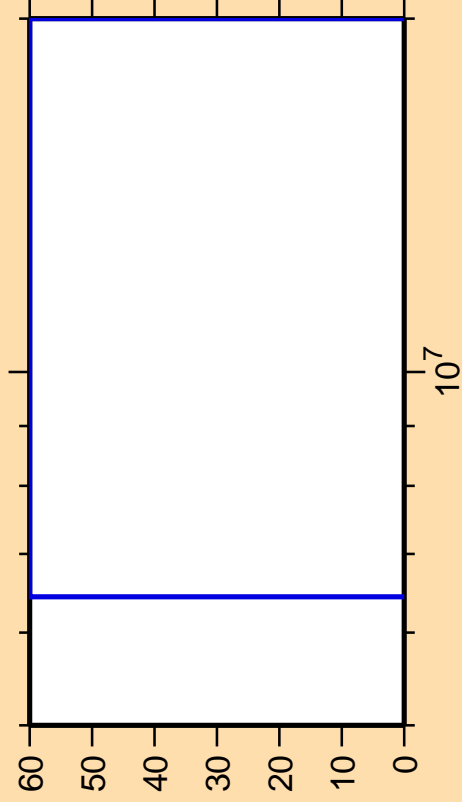


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,2n)$

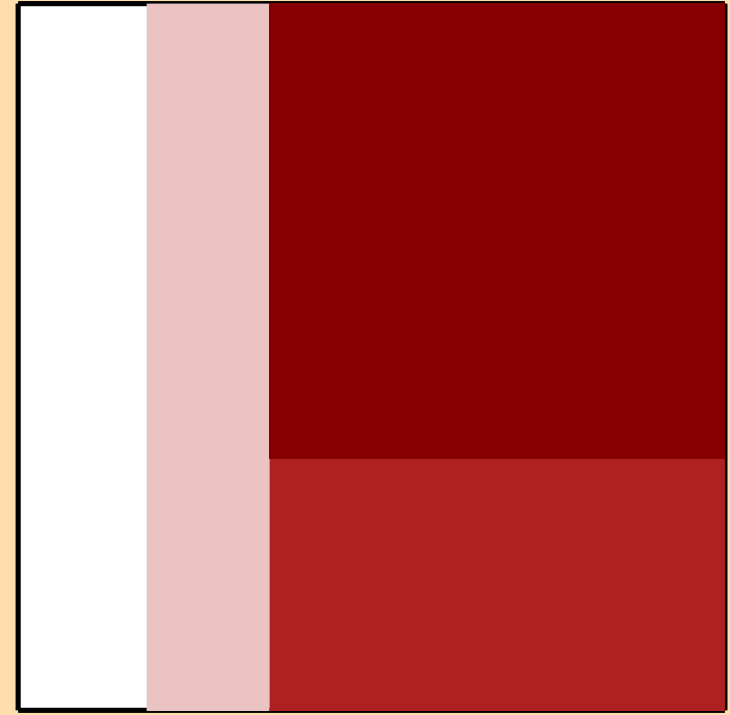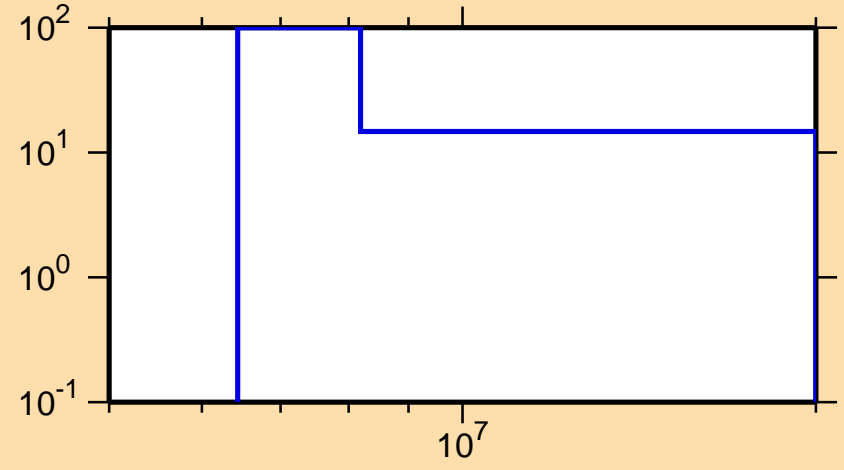

Correlation Matrix

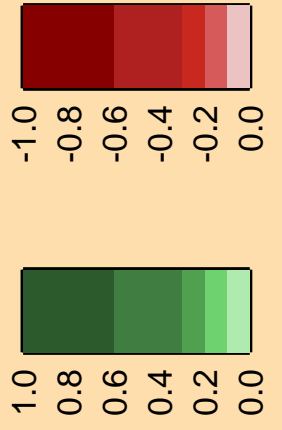

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,n\text{cont.})$


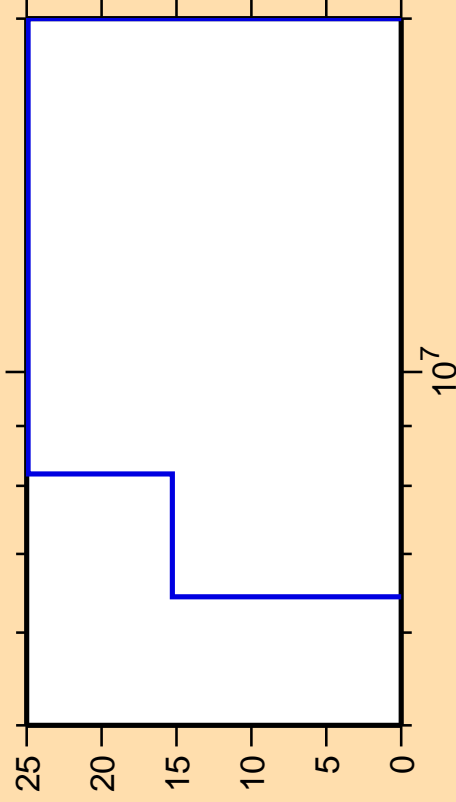


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,2n)$

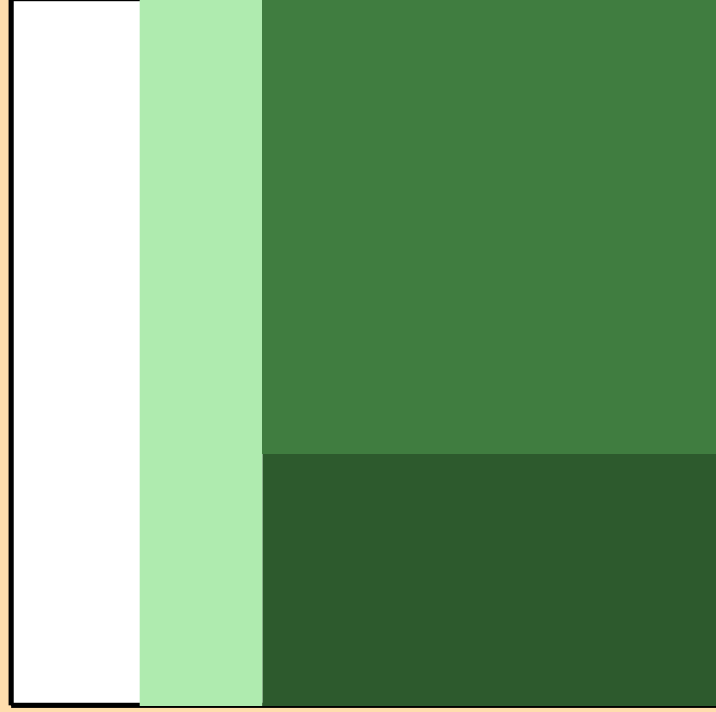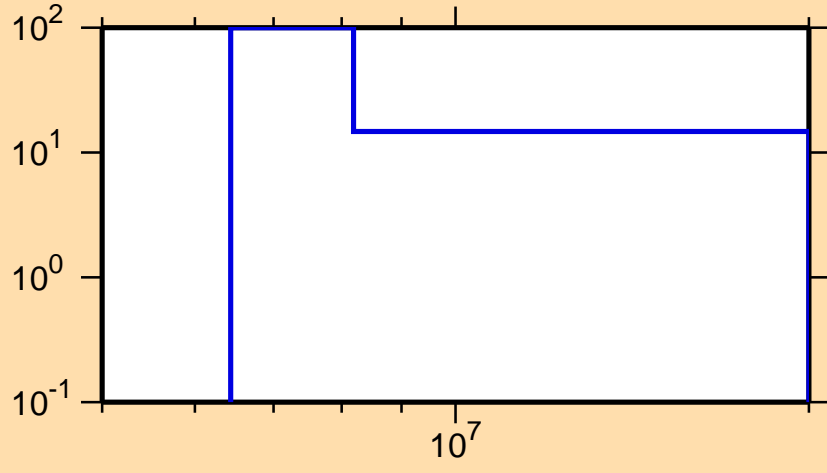

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,\gamma)$


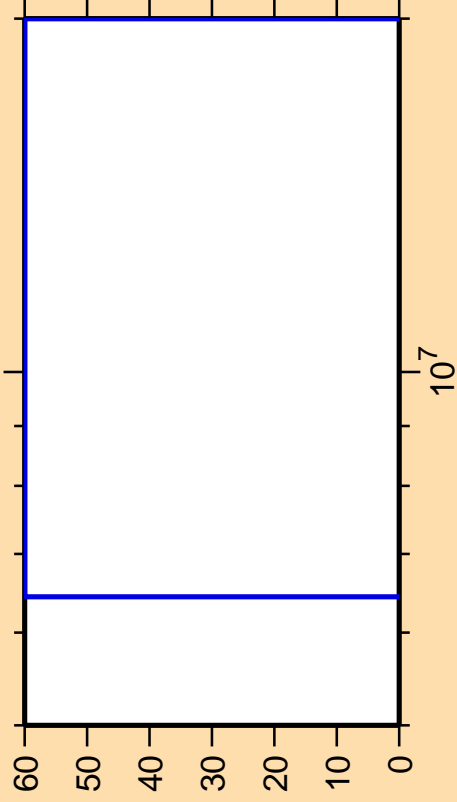


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,2n)$

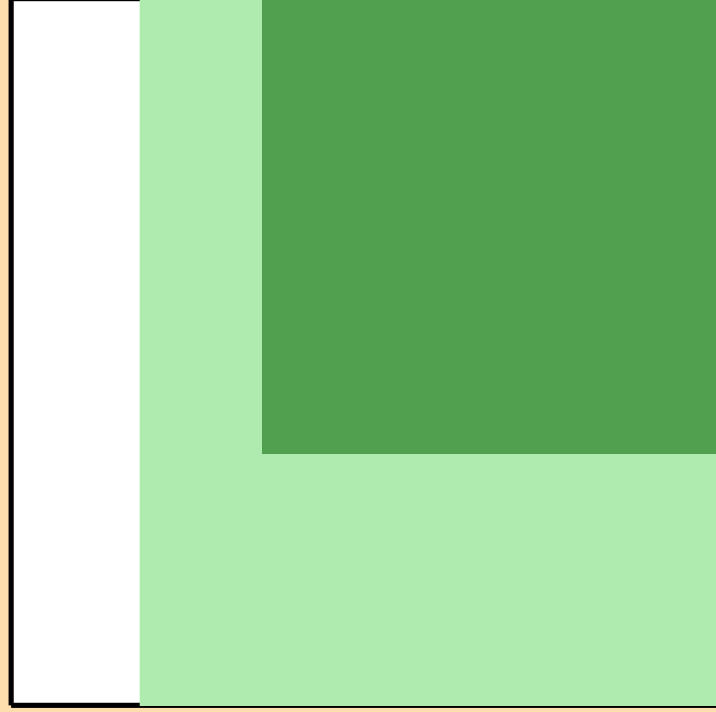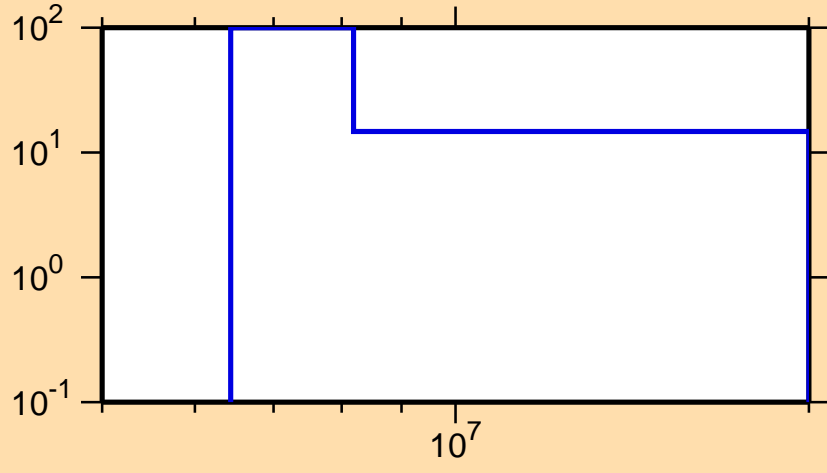

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,p)$





Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,2n)$

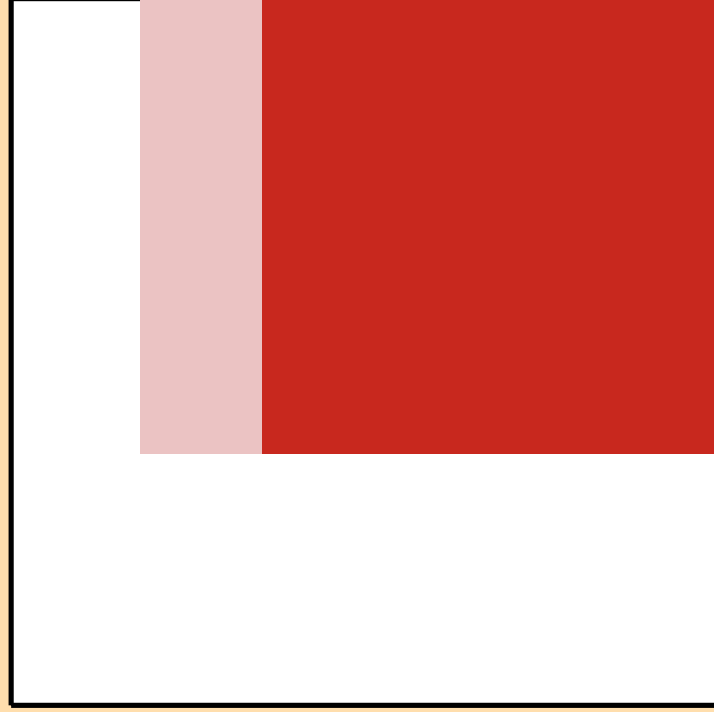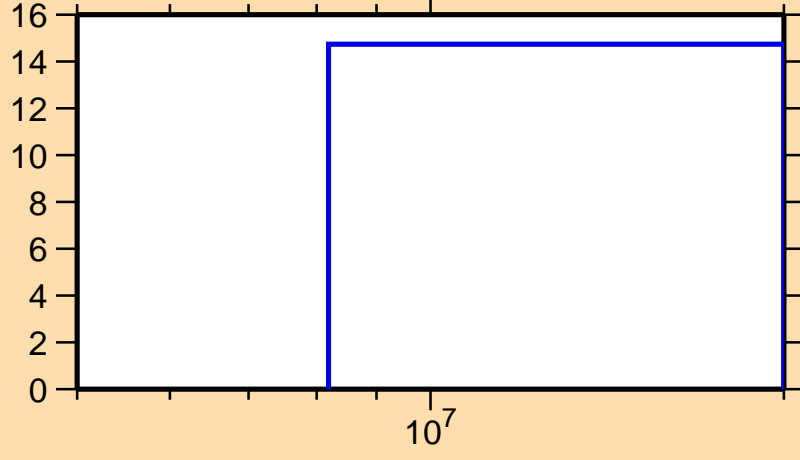

Correlation Matrix





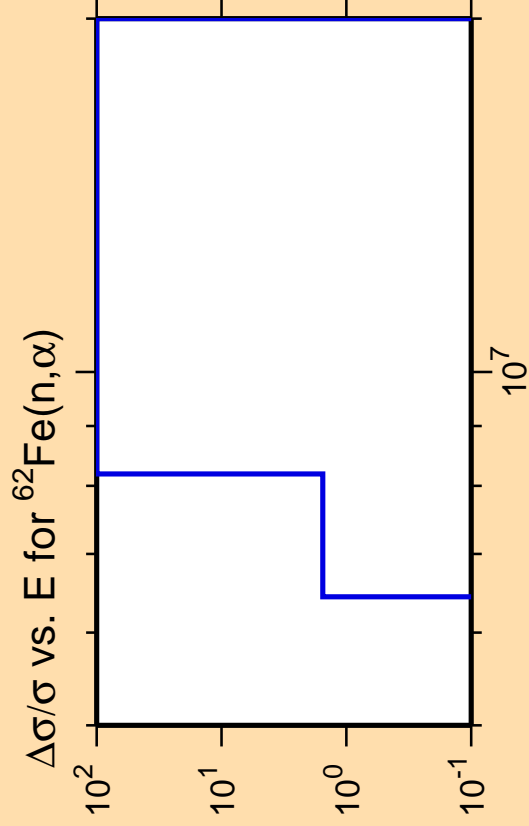


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

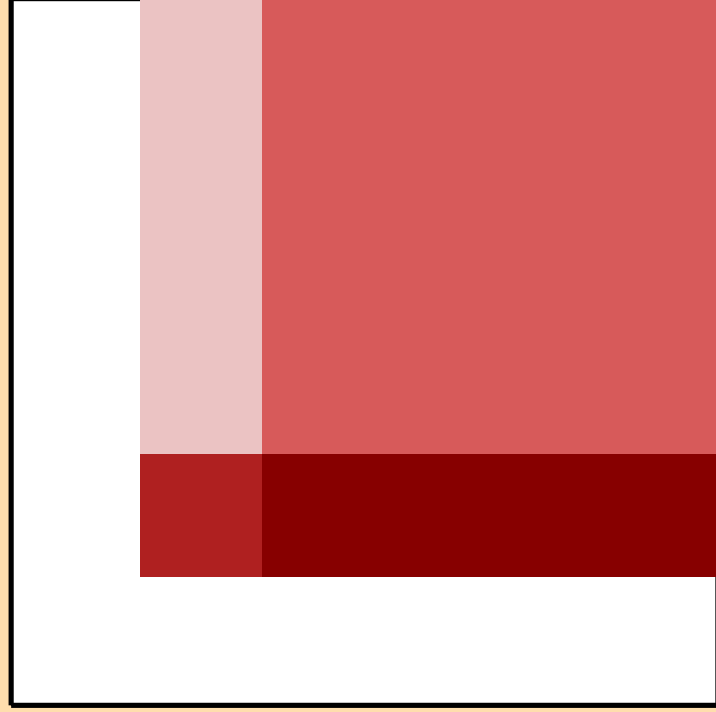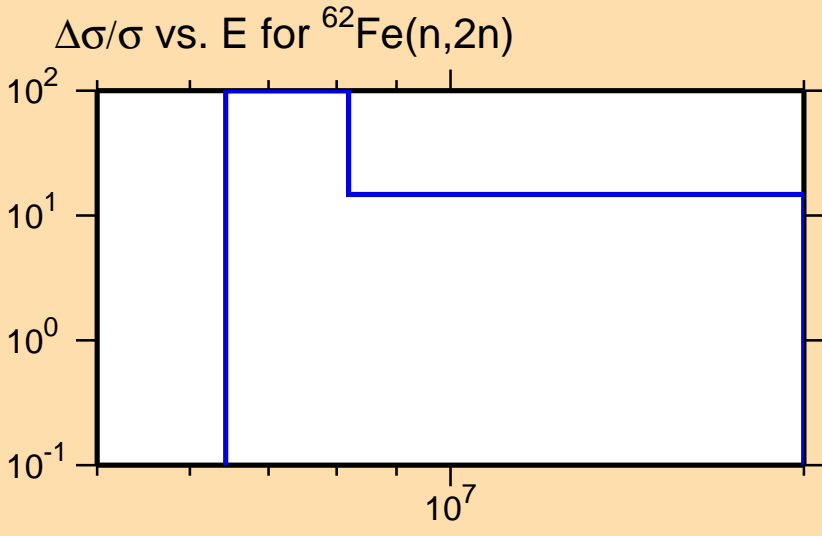



Correlation Matrix

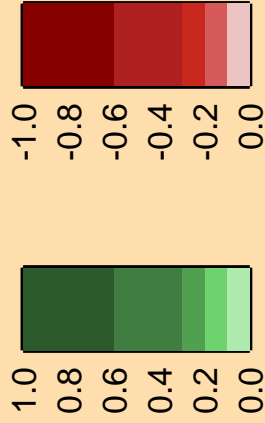


$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,3n)$

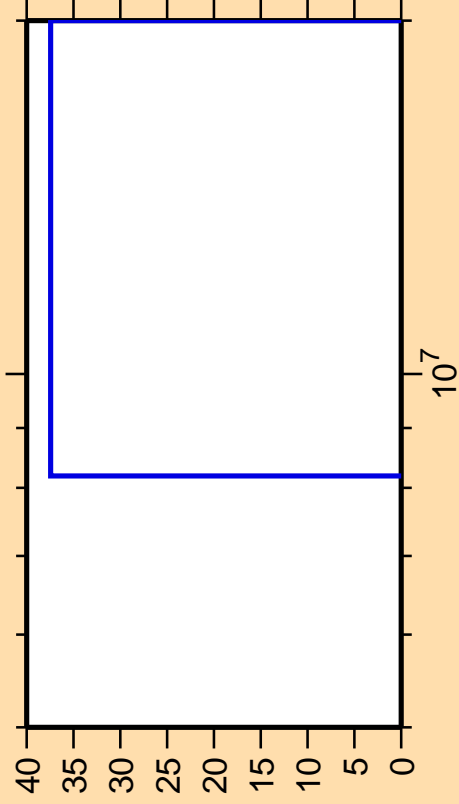


σ vs. E for $^{62}\text{Fe}(n,3n)$

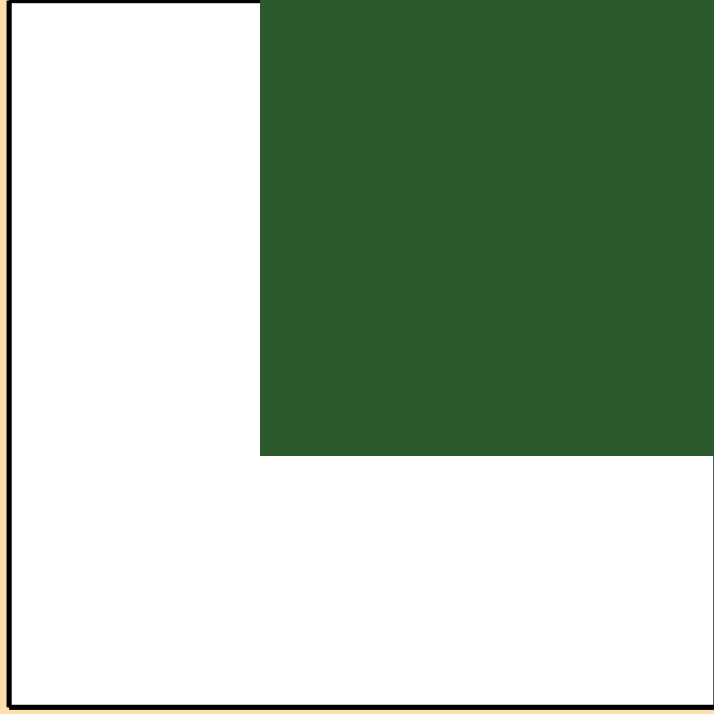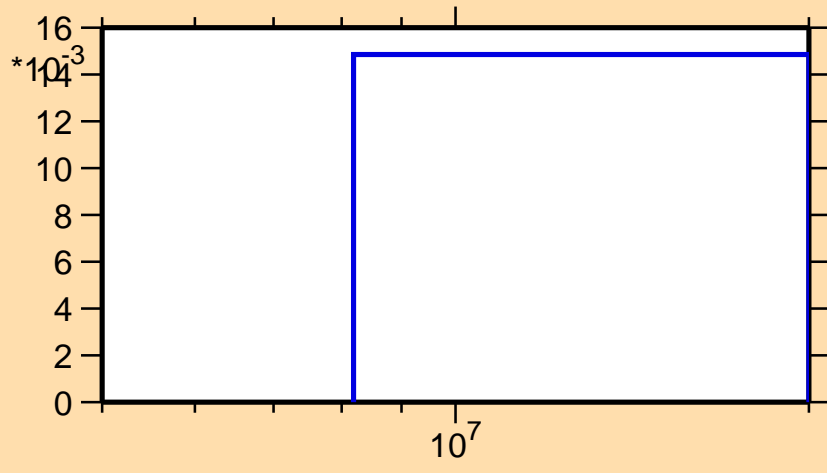

Correlation Matrix

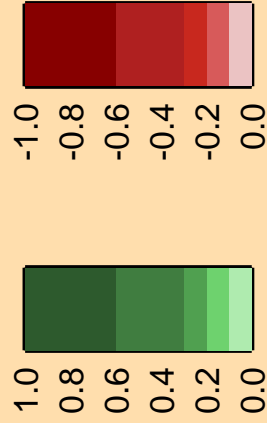

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,n\alpha)$


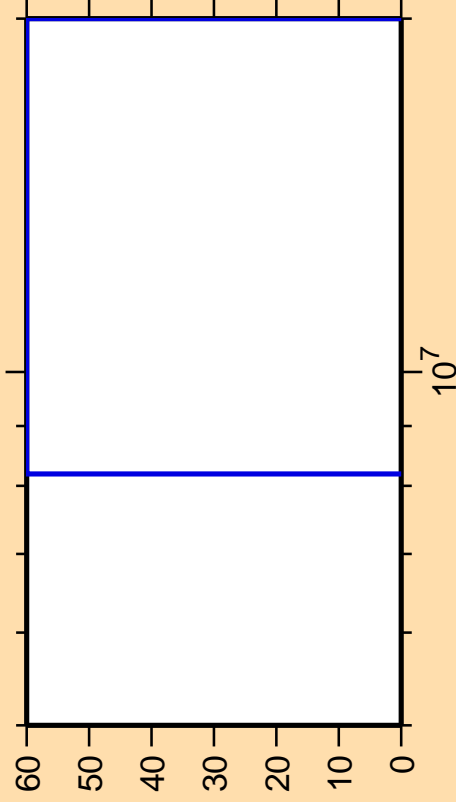


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.


σ vs. E for $^{62}\text{Fe}(n,n\alpha)$

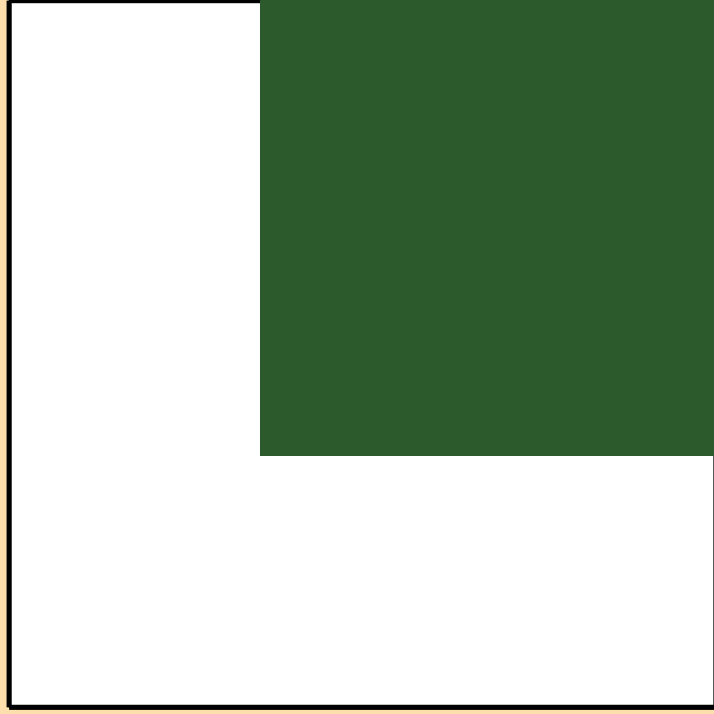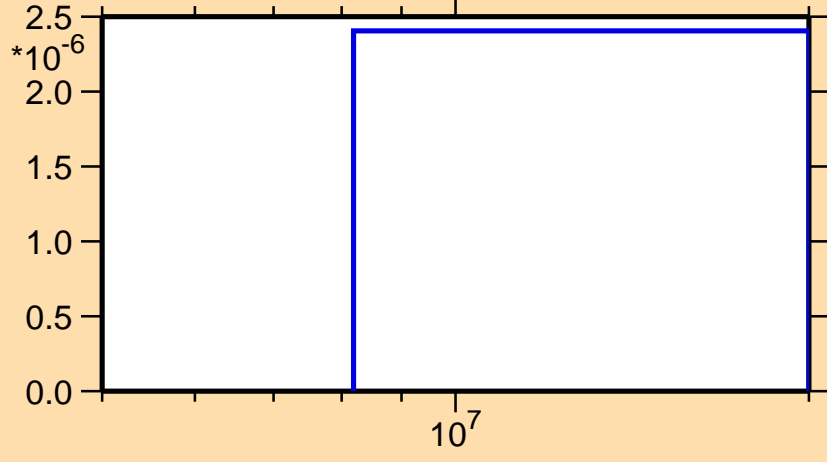

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,np)$

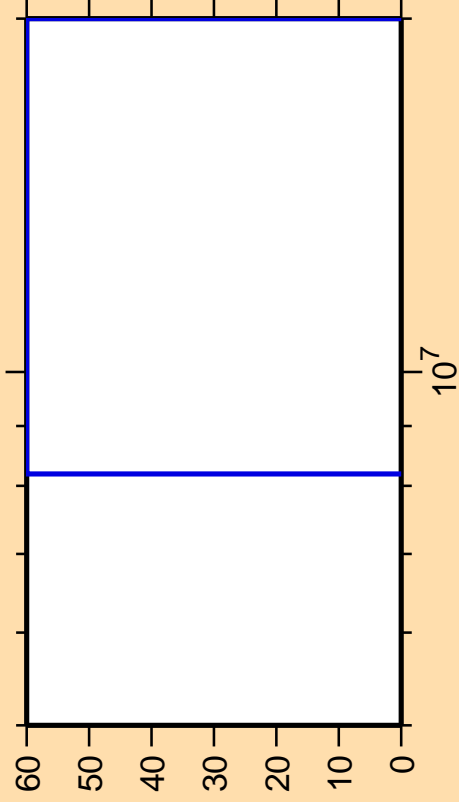


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

σ vs. E for $^{62}\text{Fe}(n,np)$

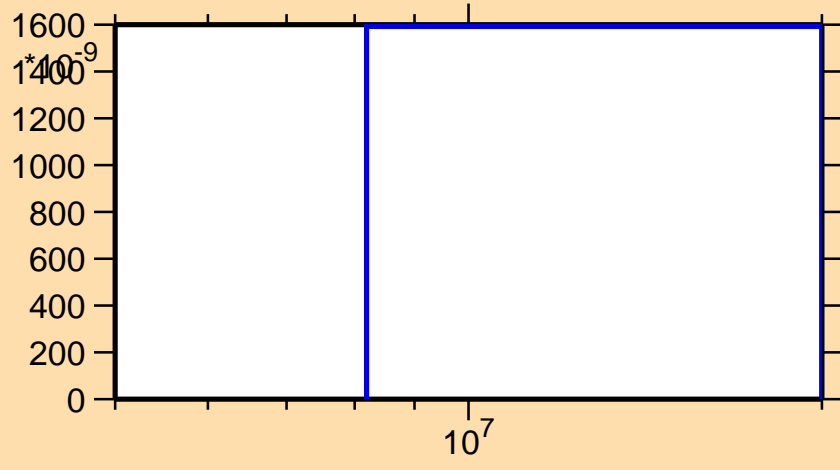


1600
1400
1200
1000
800
600
400
200
0


10^7

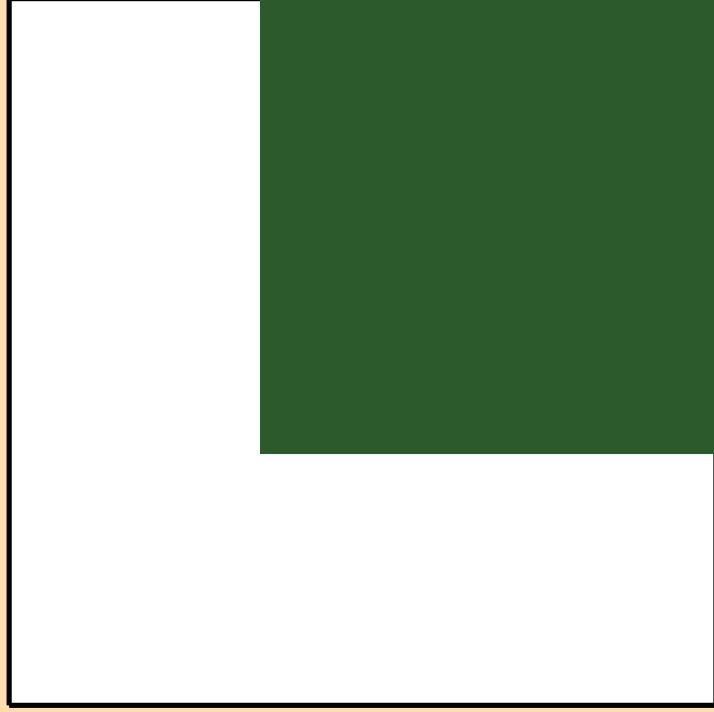

Correlation Matrix

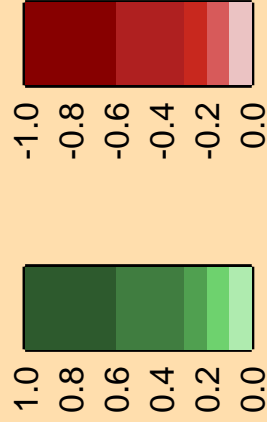


$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,\text{nd})$

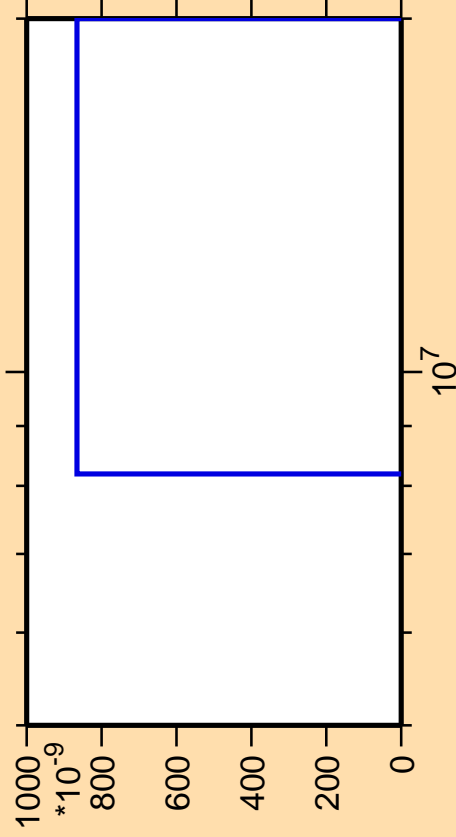

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

σ vs. E for $^{62}\text{Fe}(n,\text{nd})$

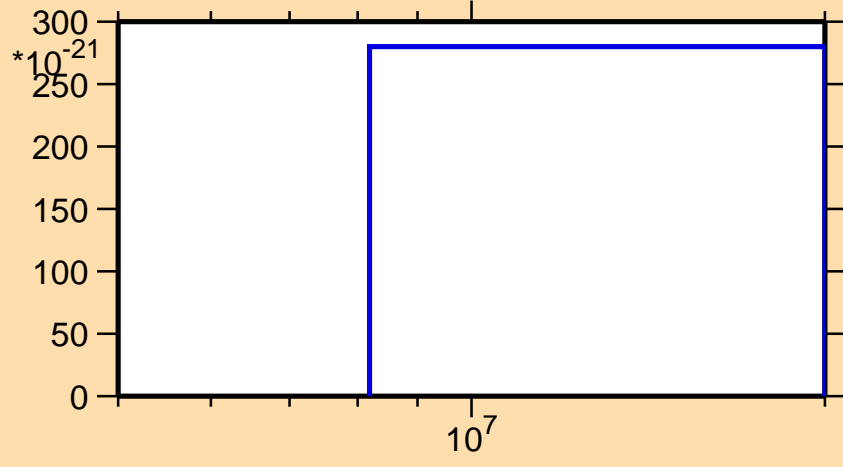


0 50 100 150 200 250 300


10^7

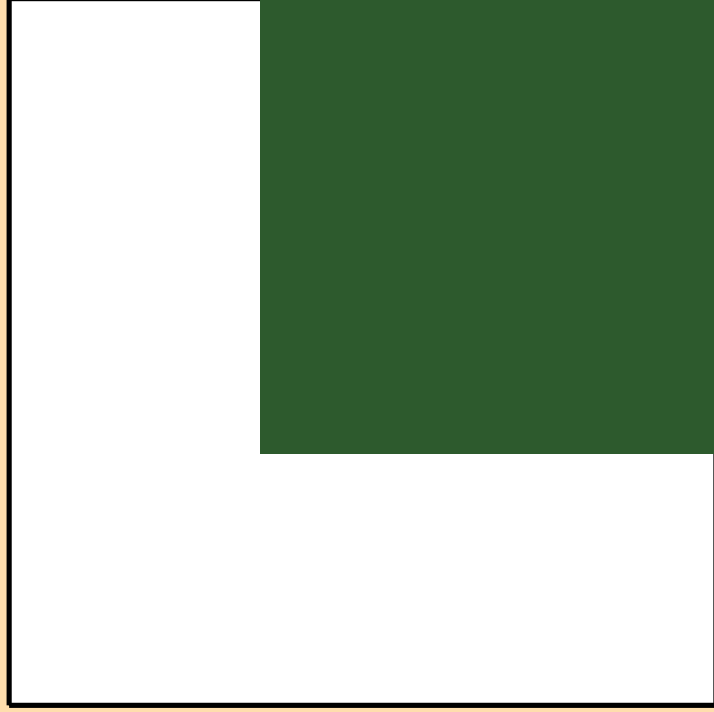

Correlation Matrix

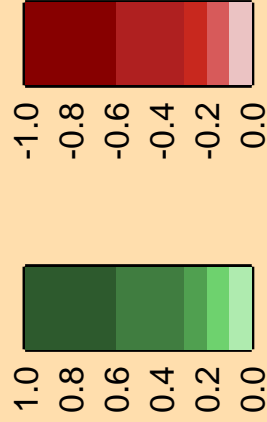



$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,nt)$

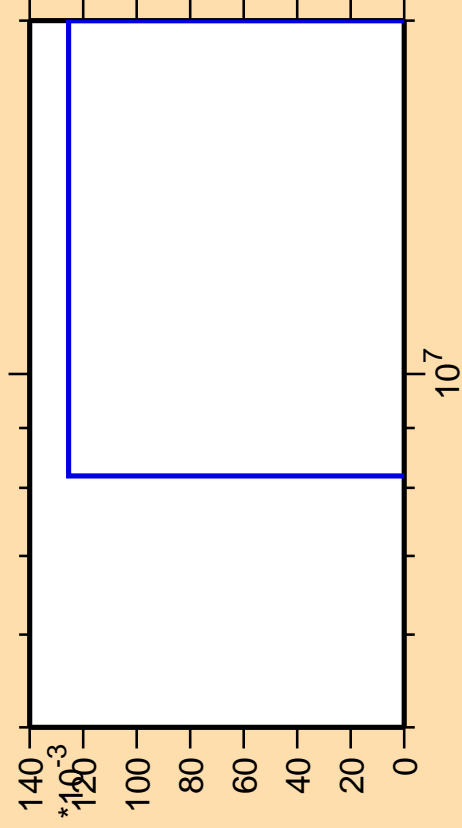

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

σ vs. E for $^{62}\text{Fe}(n,nt)$

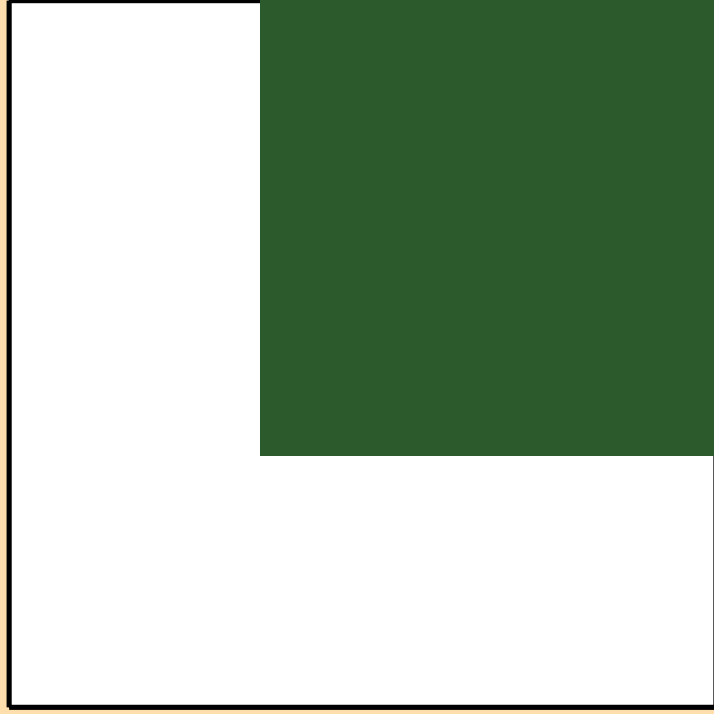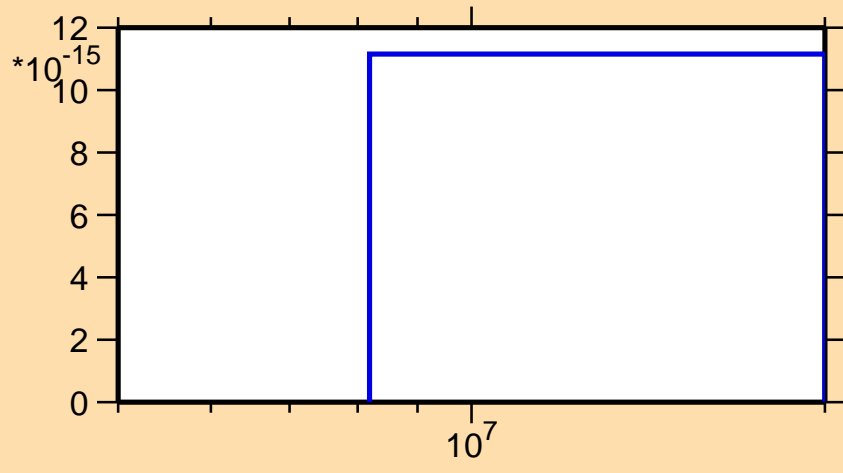

Correlation Matrix






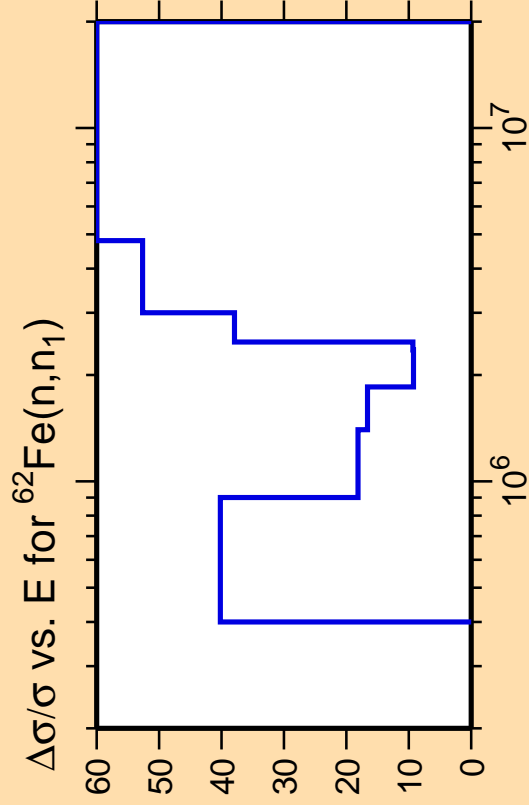


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

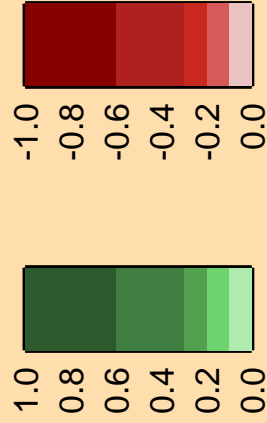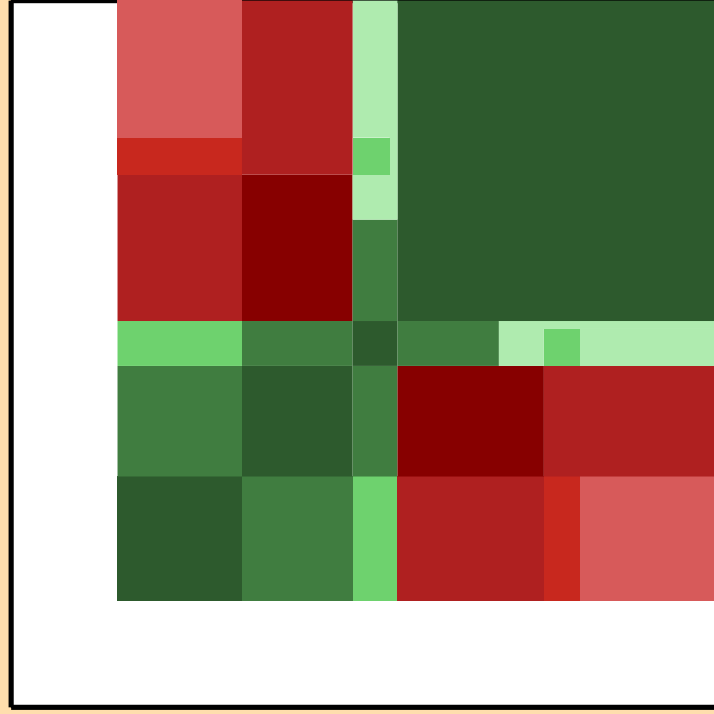
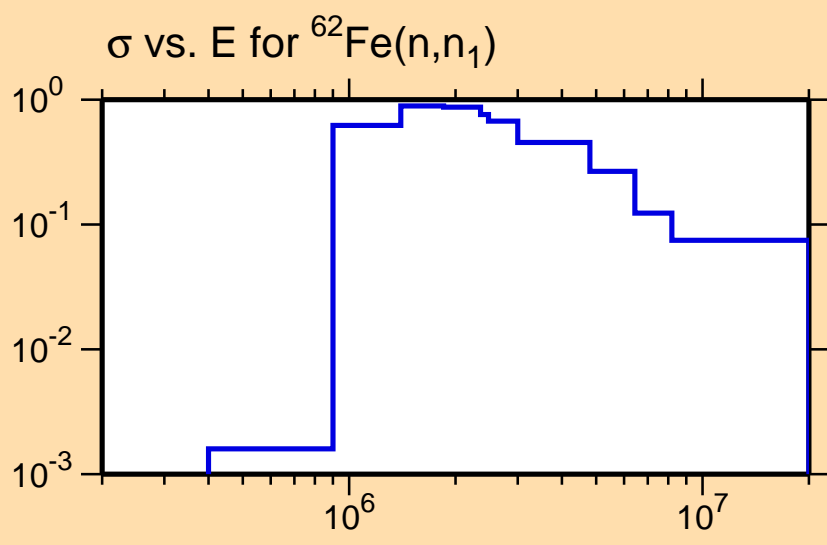


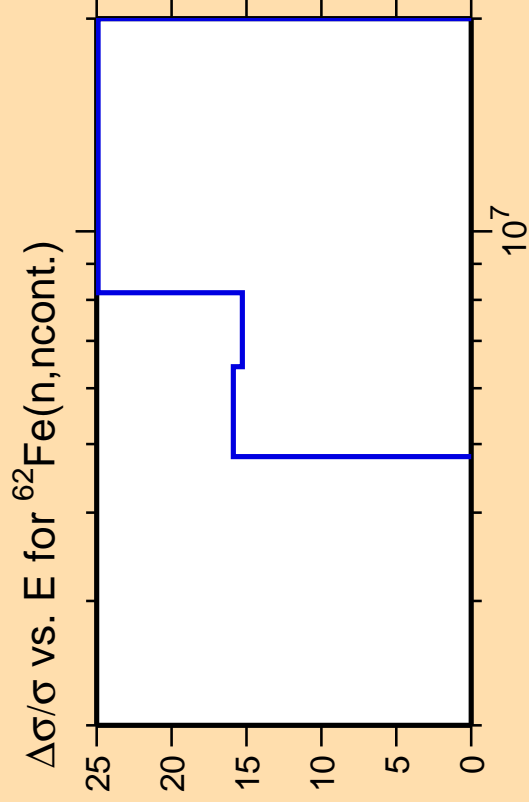


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

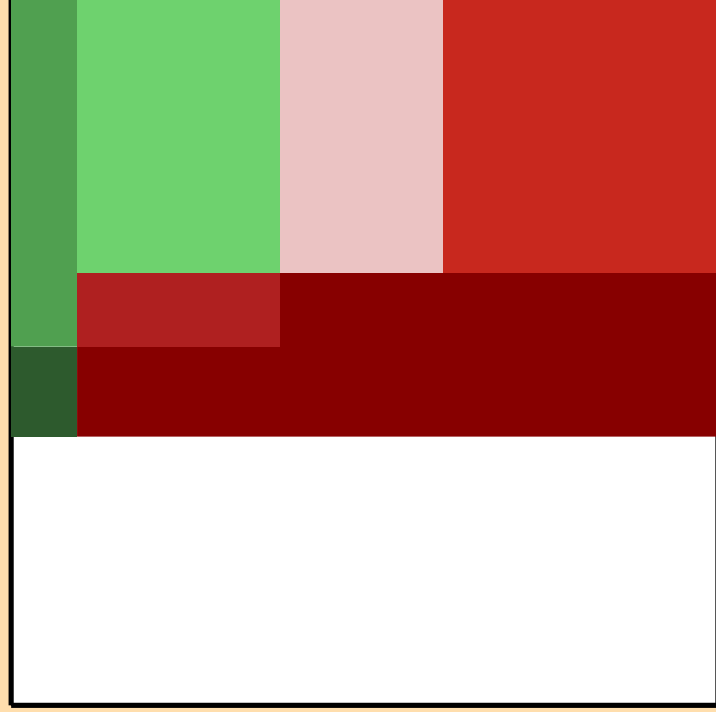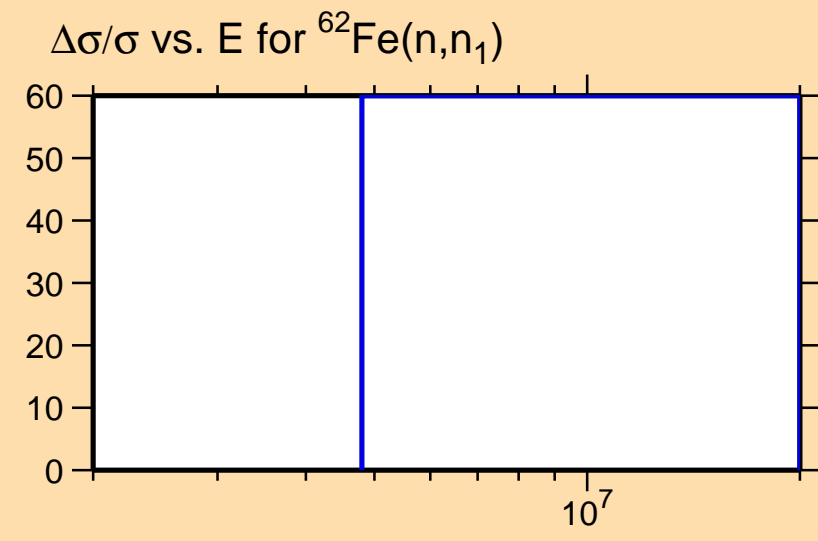

Correlation Matrix

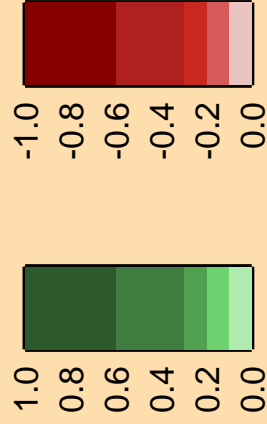


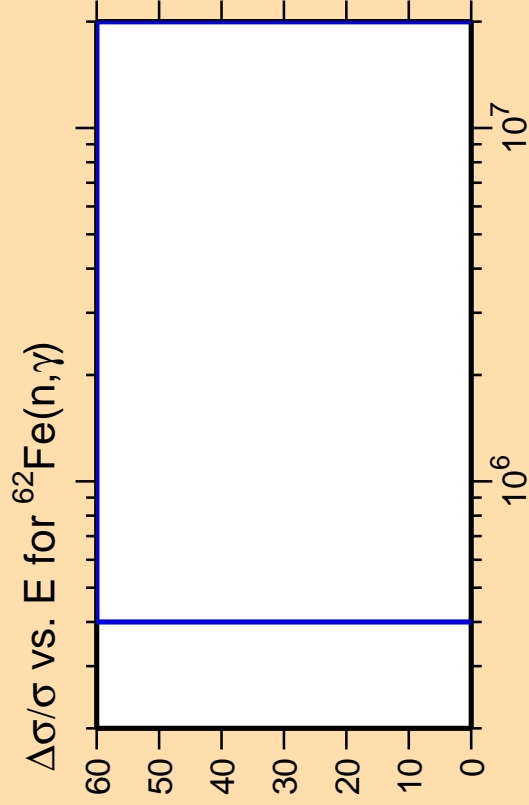


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,n_1)$

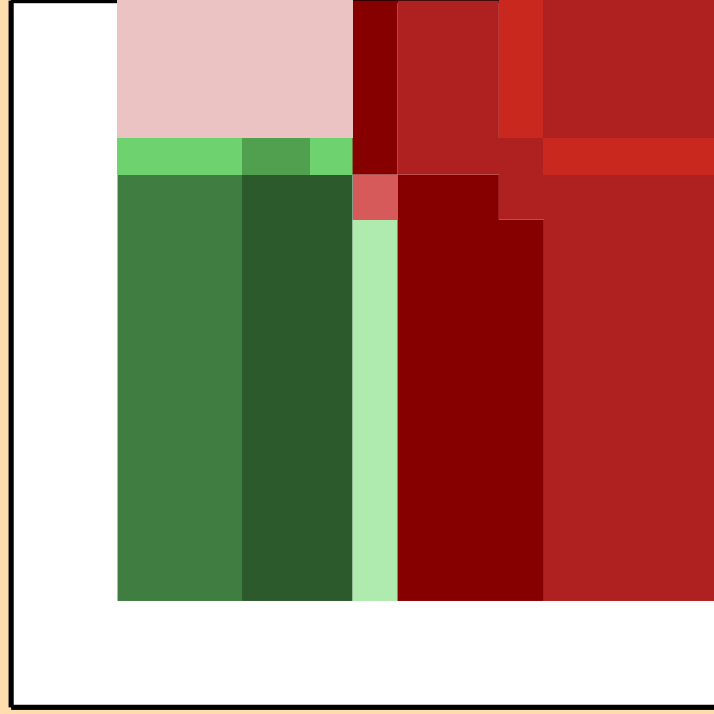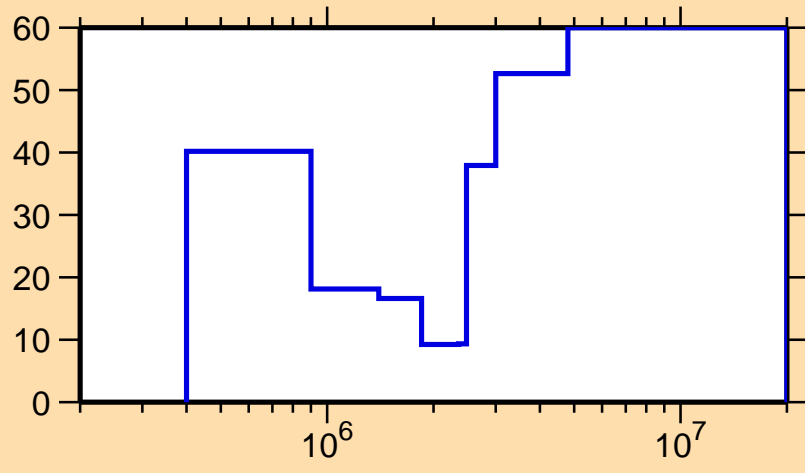

Correlation Matrix

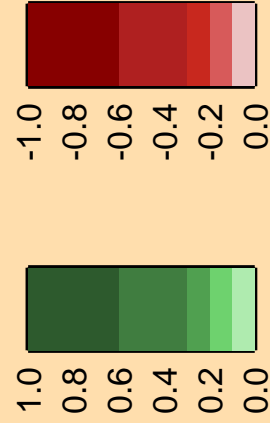

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,p)$


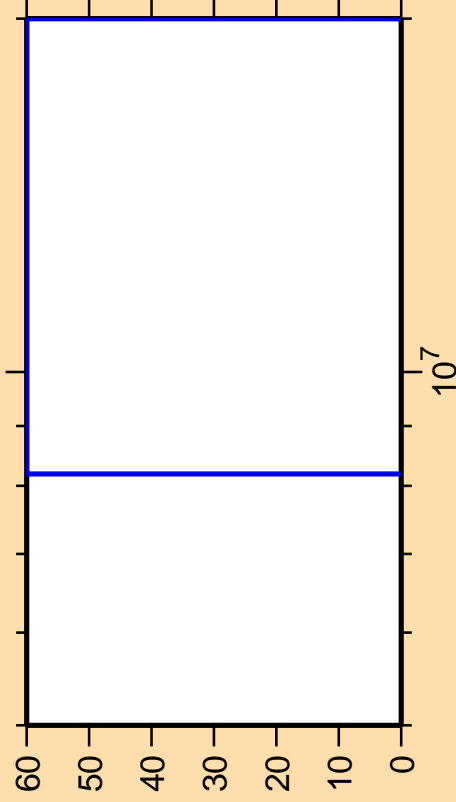


Ordinate scale is %
relative standard deviation.



Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,n_1)$

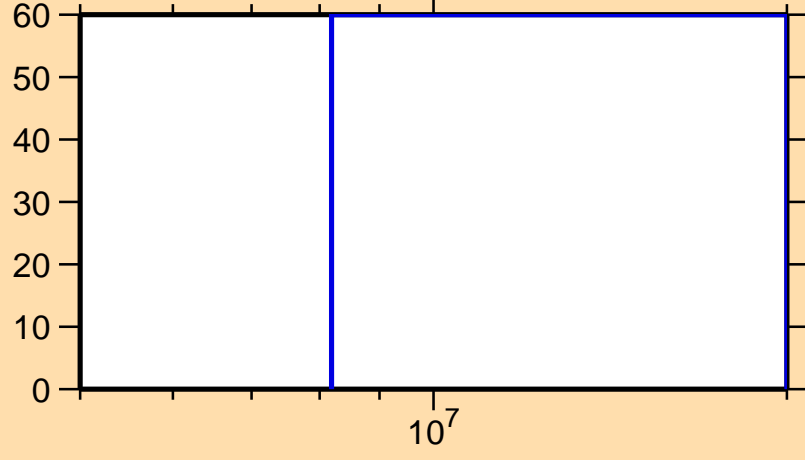

Correlation Matrix


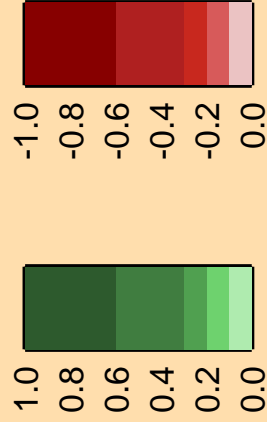


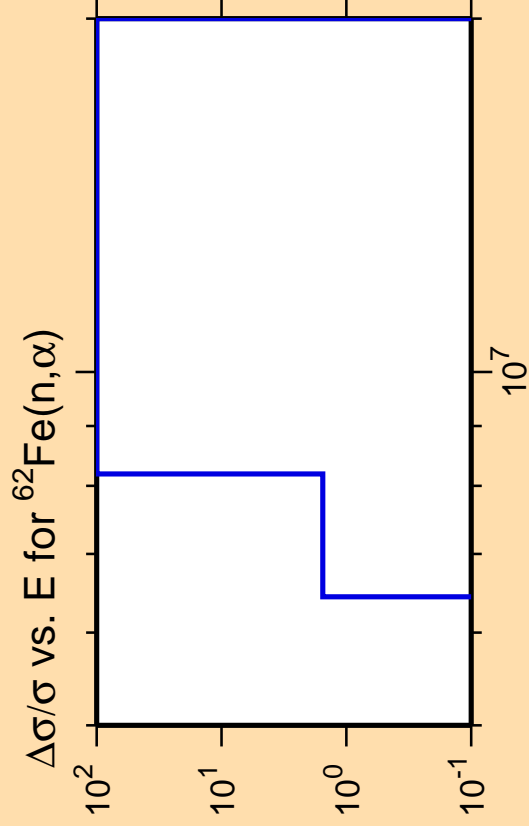


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

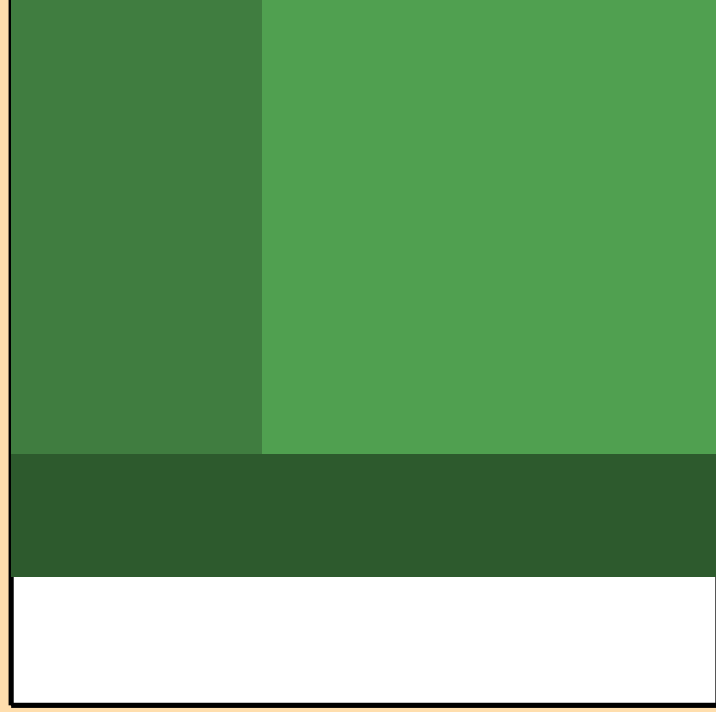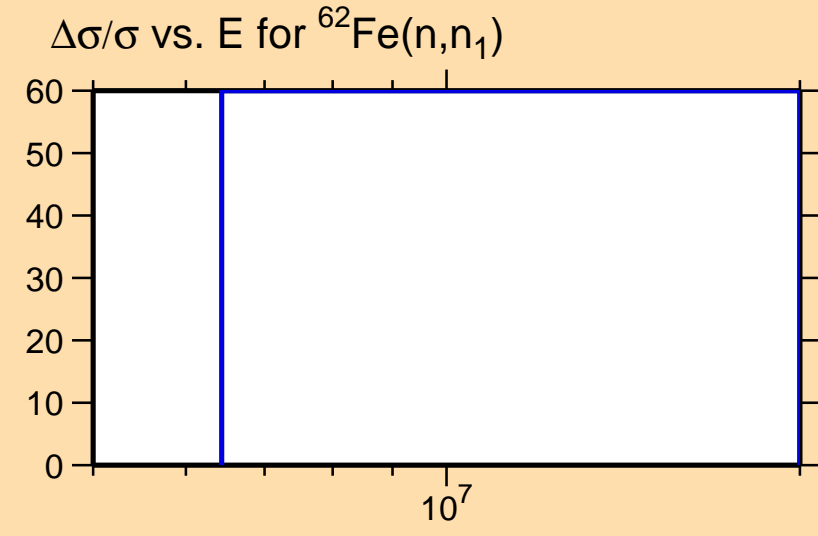

Correlation Matrix


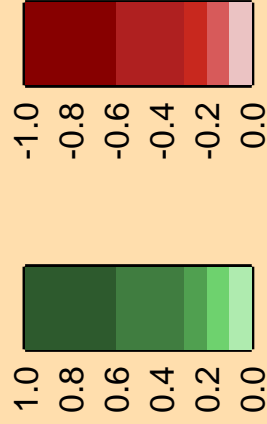


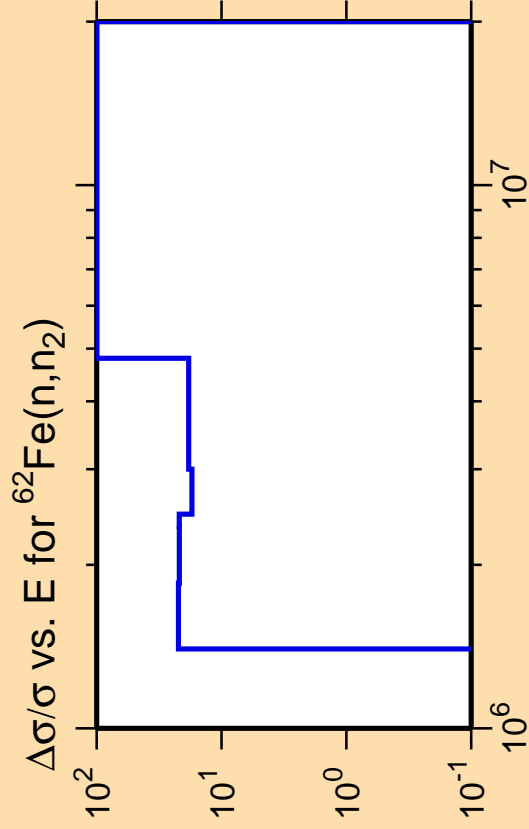

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

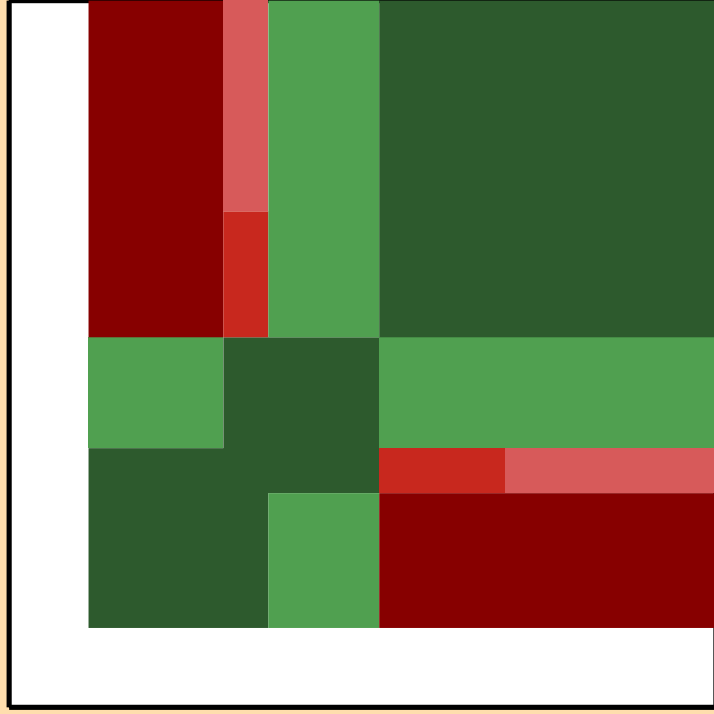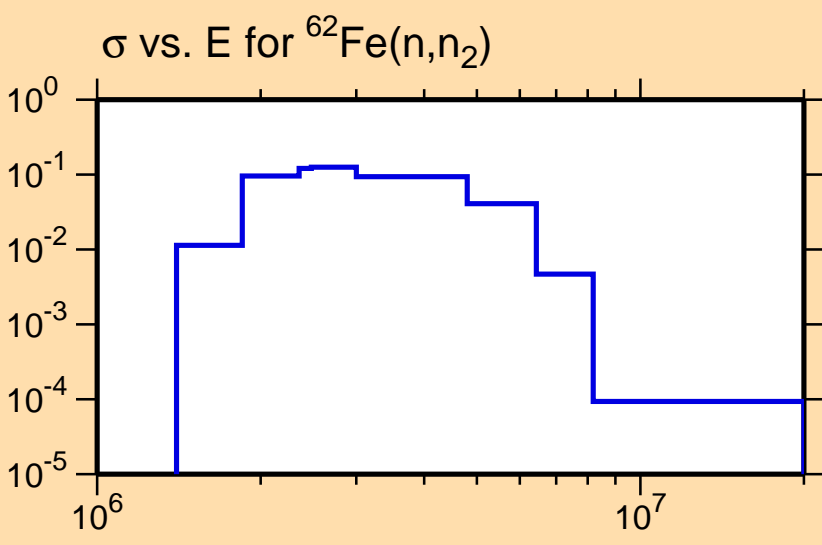

Correlation Matrix





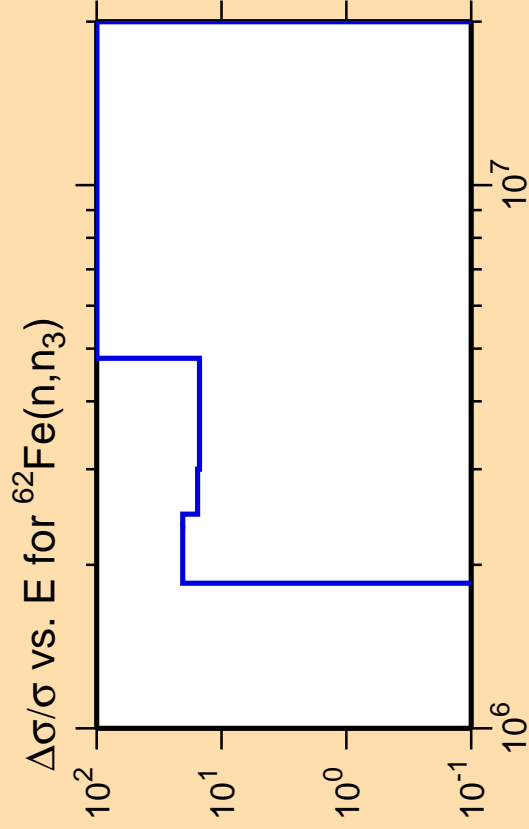

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

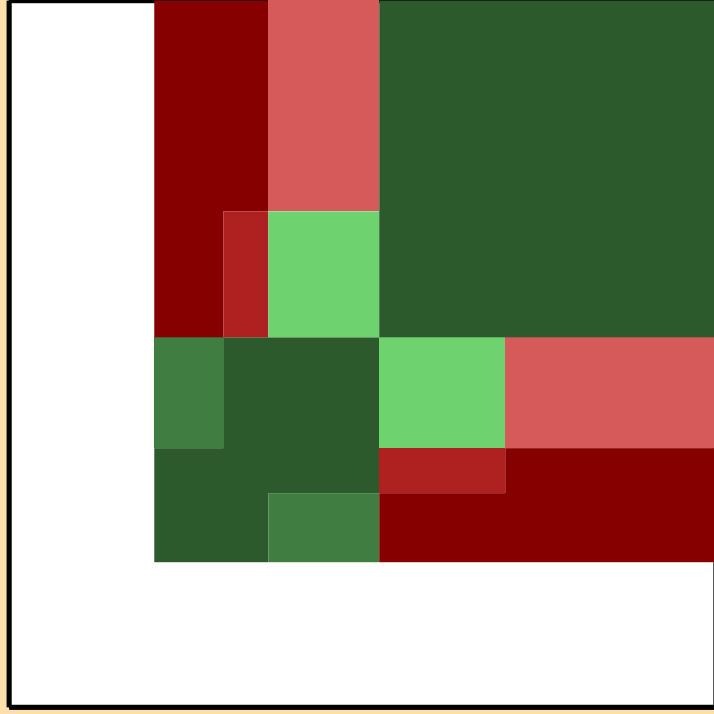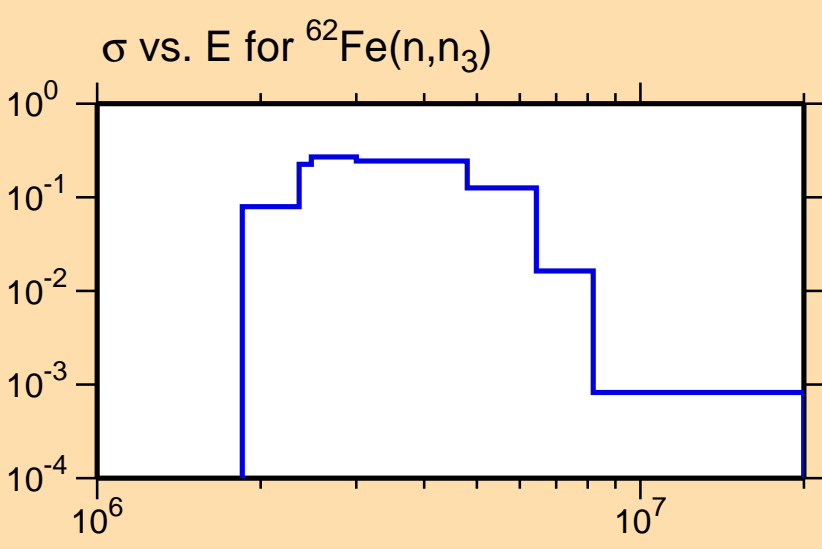

Correlation Matrix





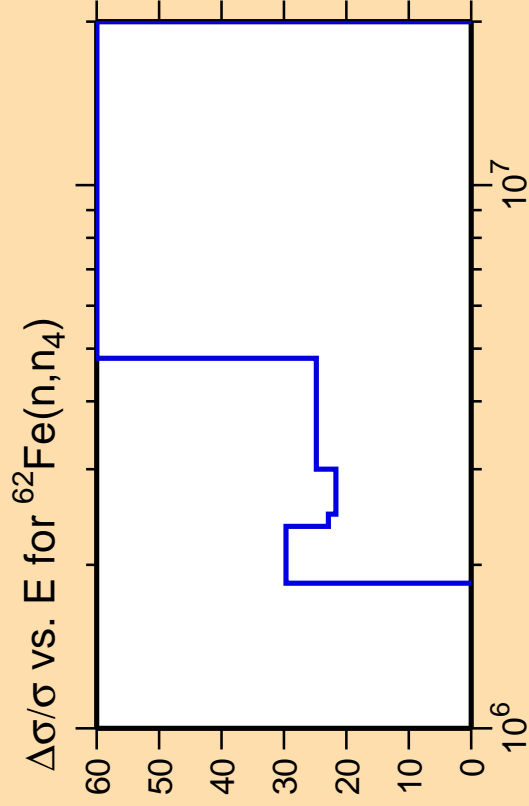


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

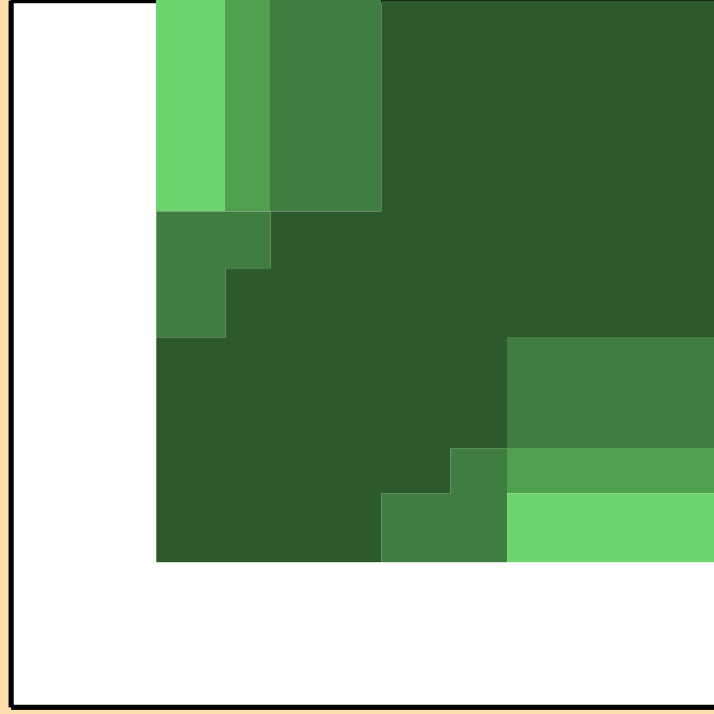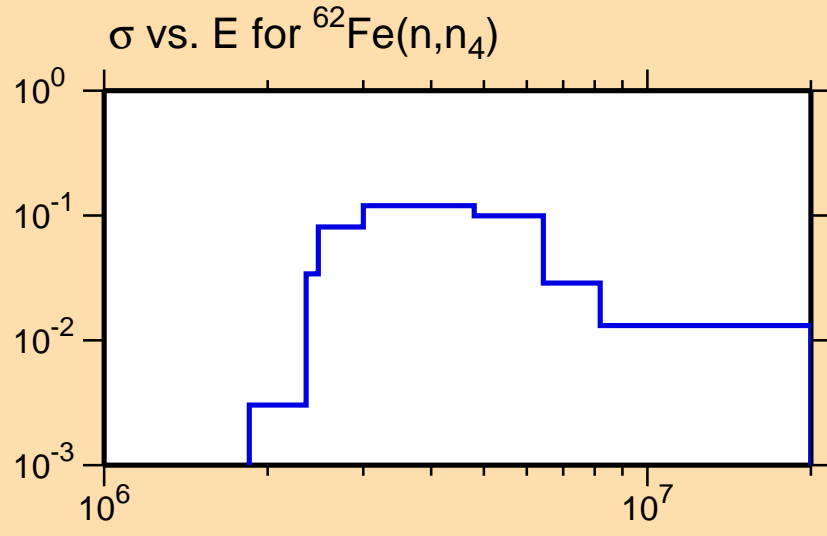

Correlation Matrix

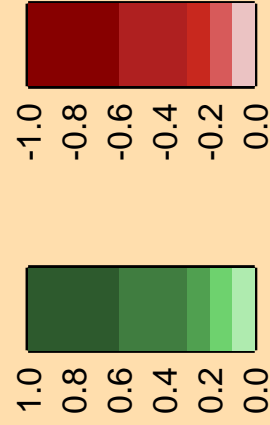



$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,n\text{cont.})$

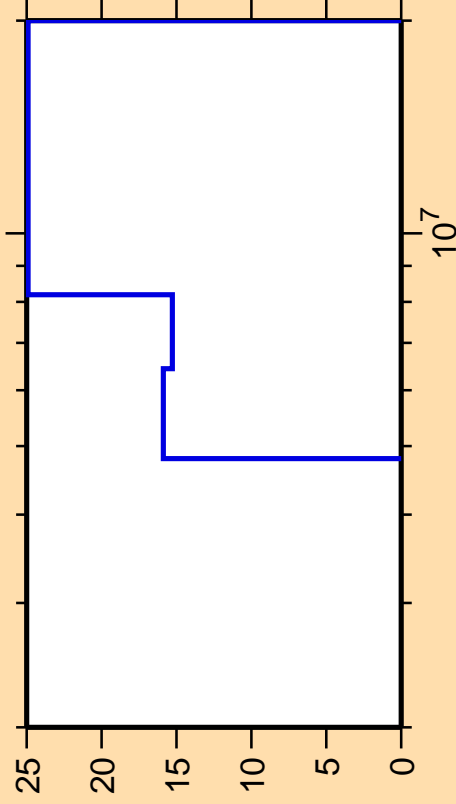

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

σ vs. E for $^{62}\text{Fe}(n,n\text{cont.})$

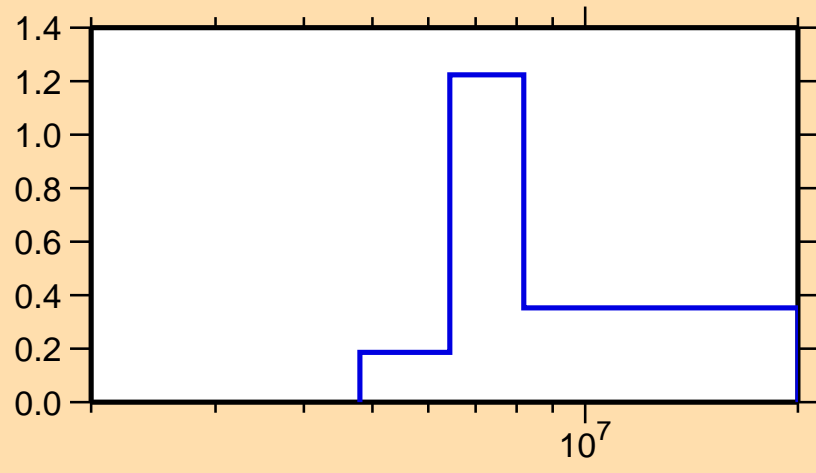

Correlation Matrix





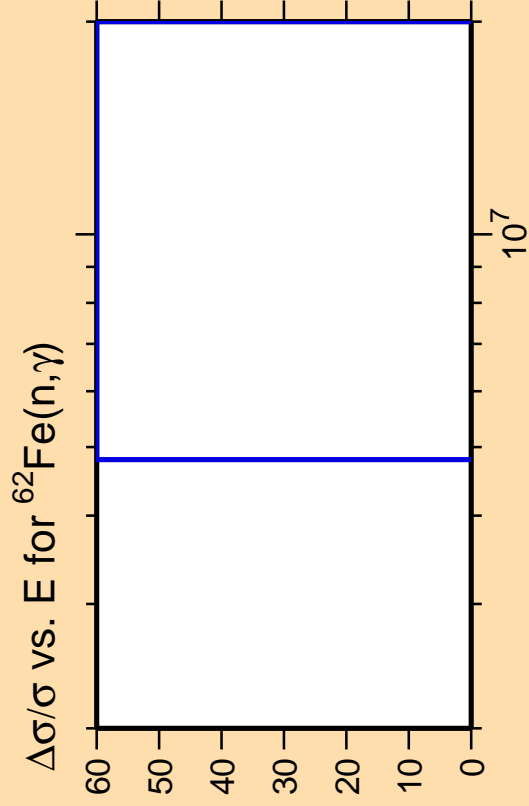

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

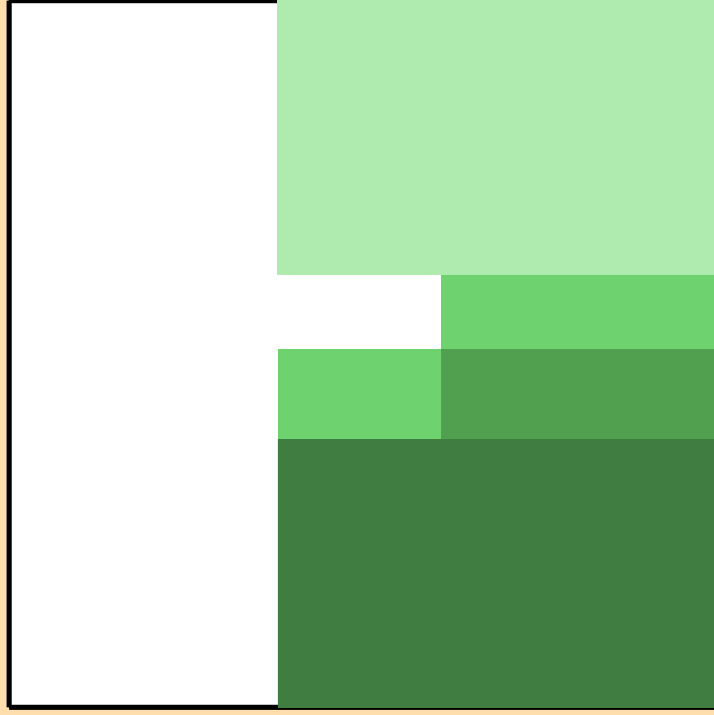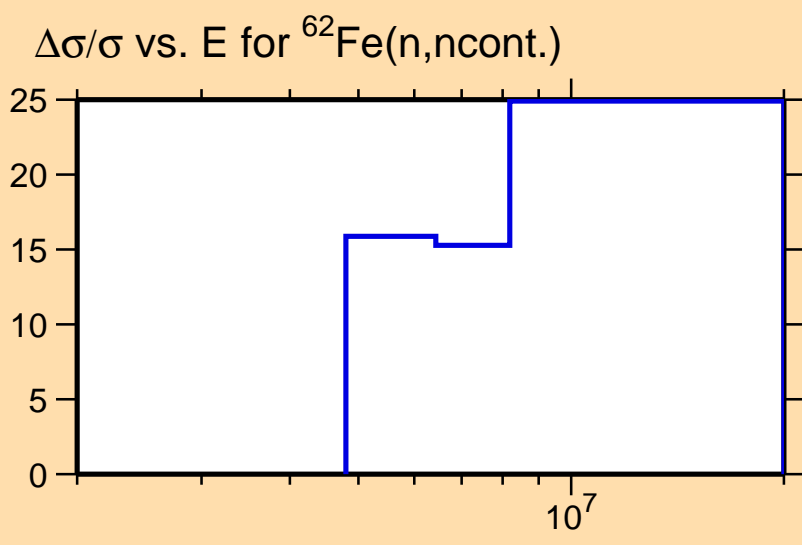

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,p)$


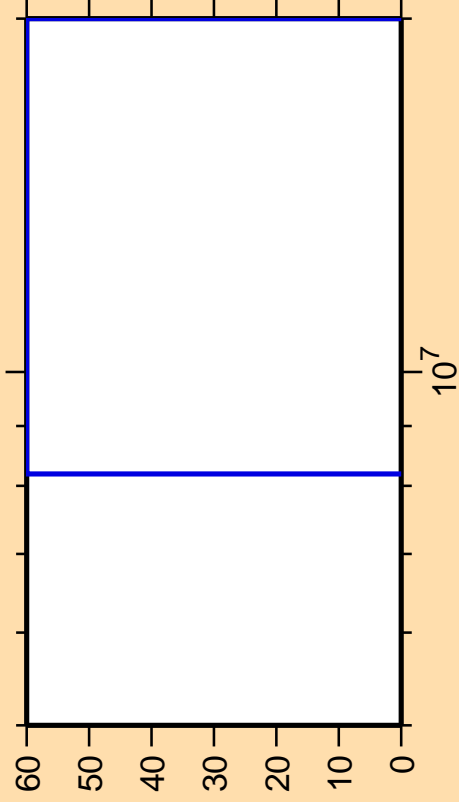


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,ncont.)$

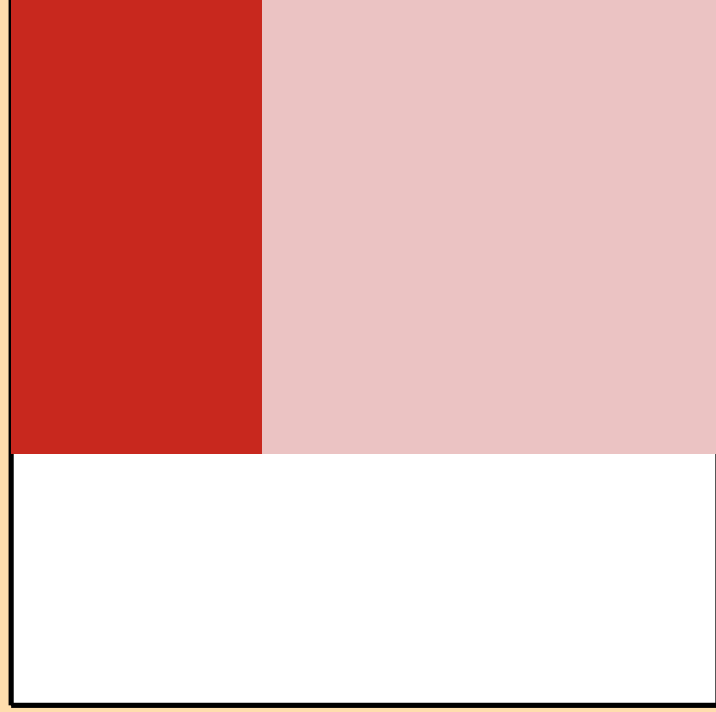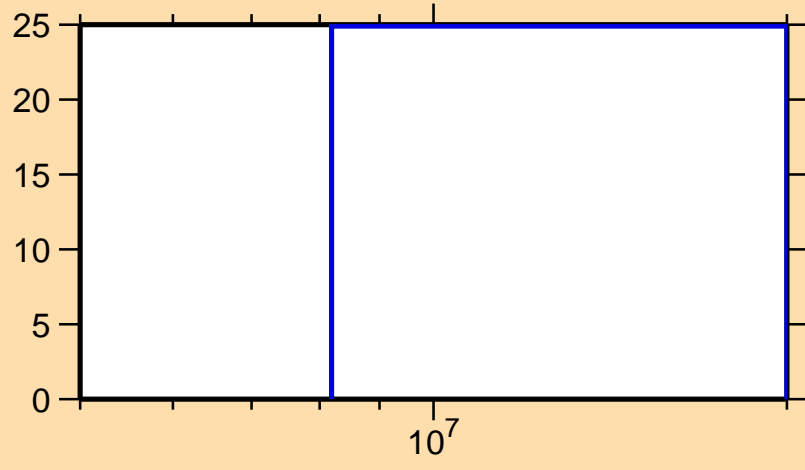

Correlation Matrix





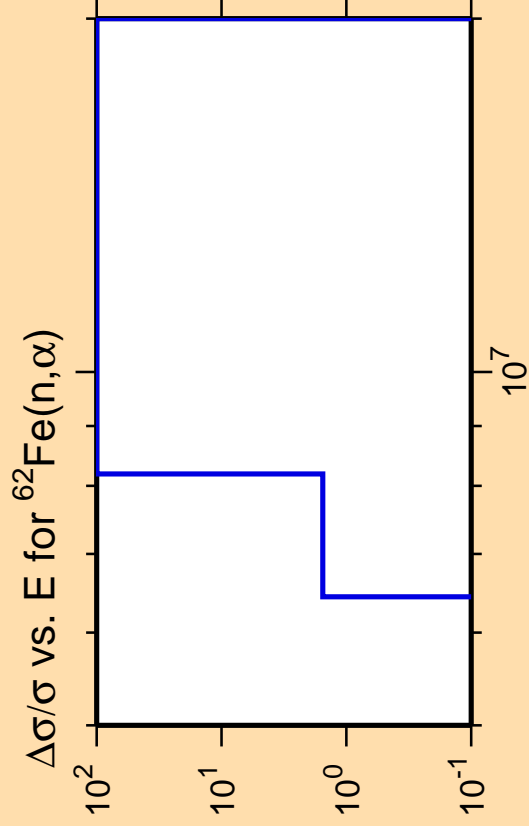

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

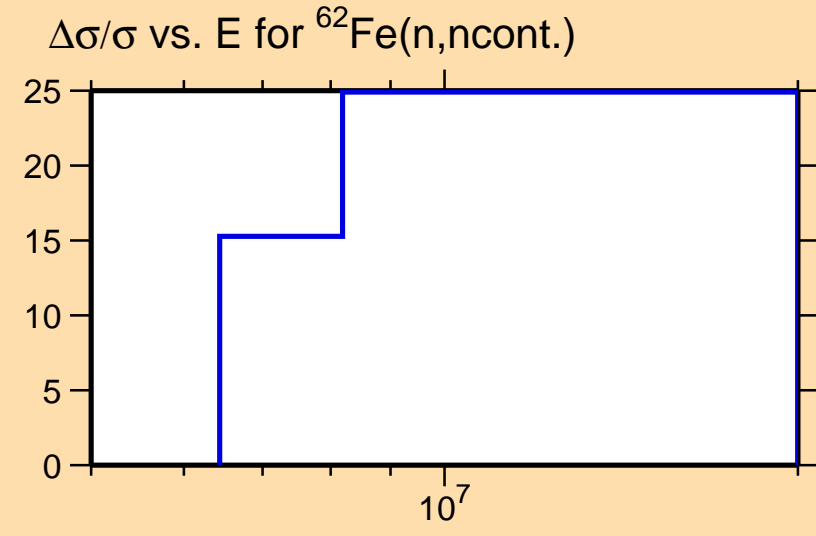

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,\gamma)$

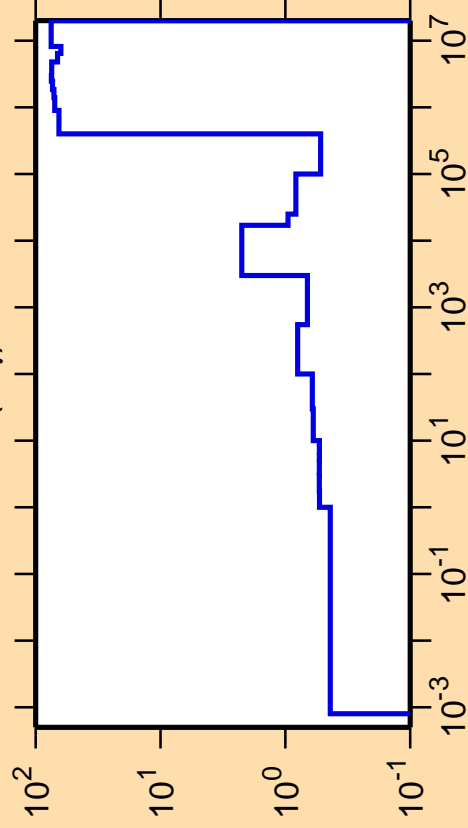

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{62}\text{Fe}(n,\gamma)$

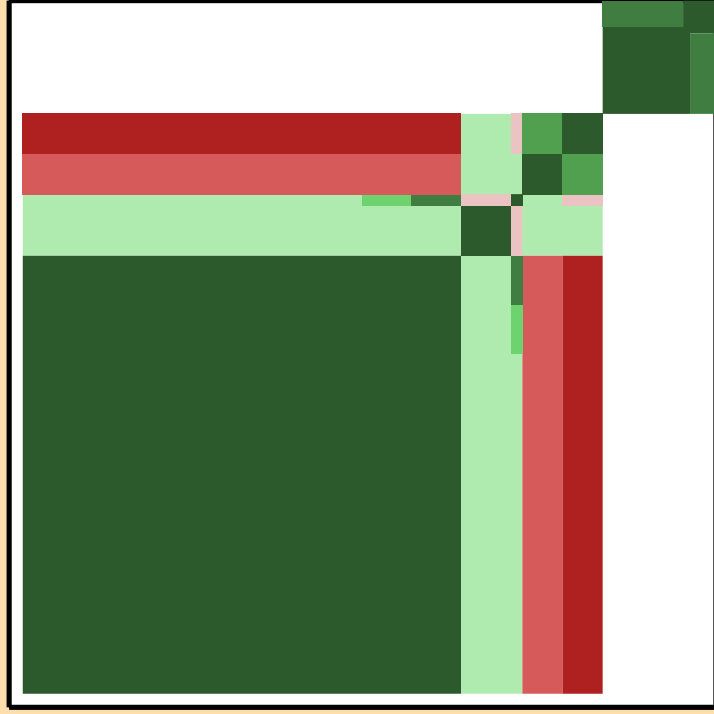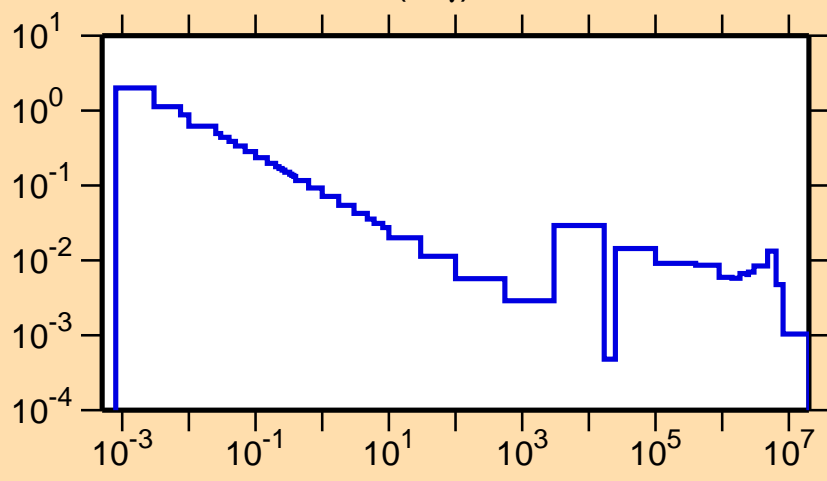

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,p)$


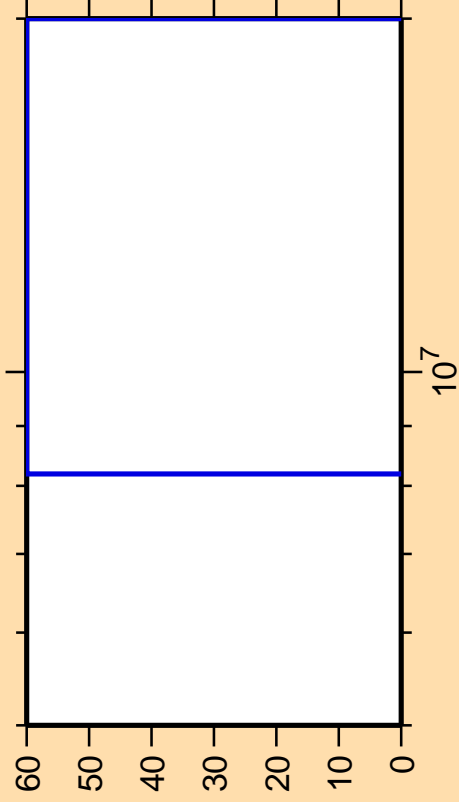


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,\gamma)$

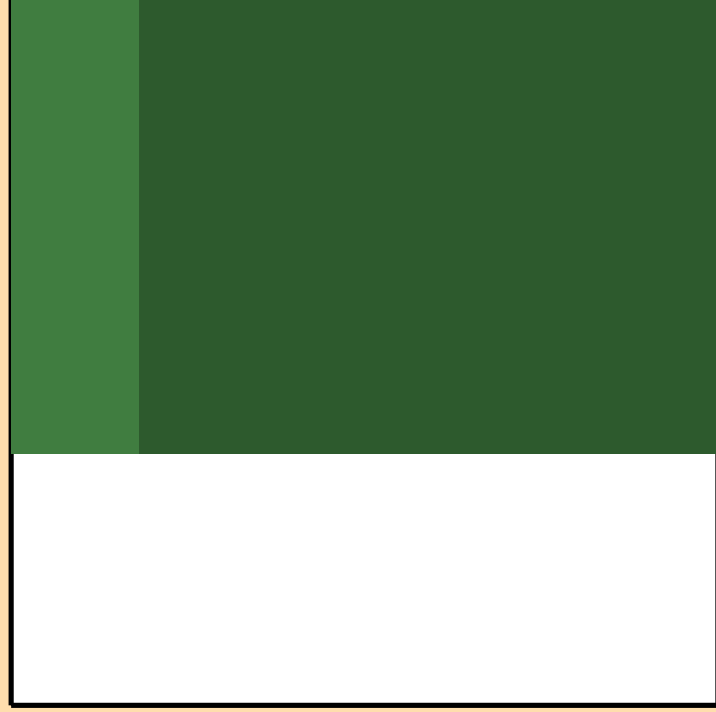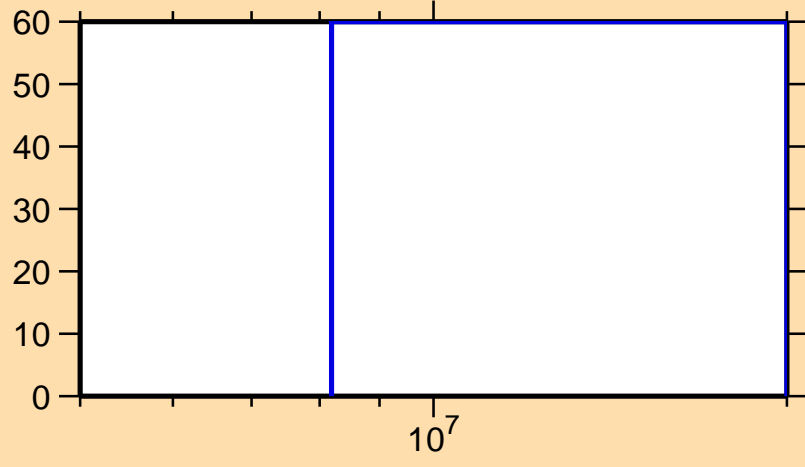

Correlation Matrix


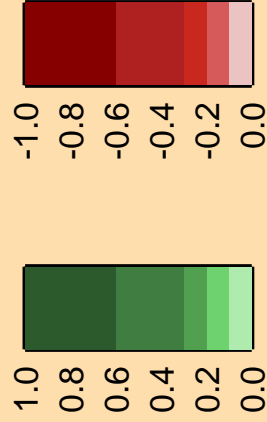


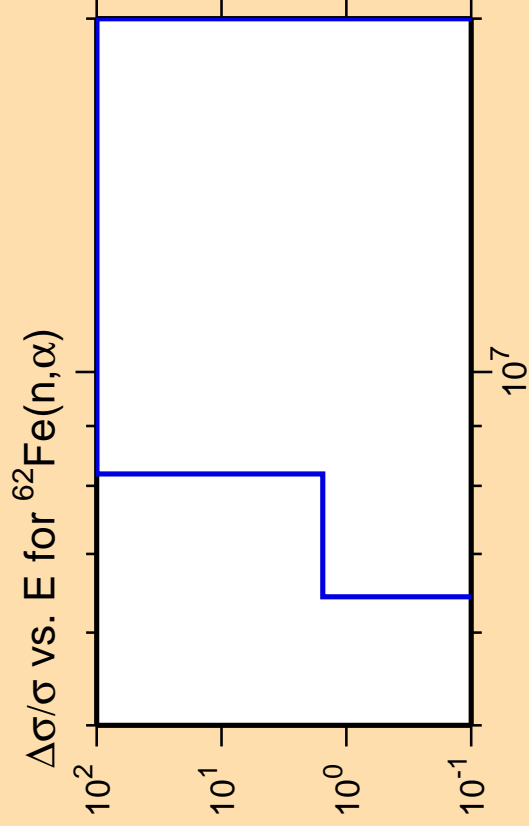


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

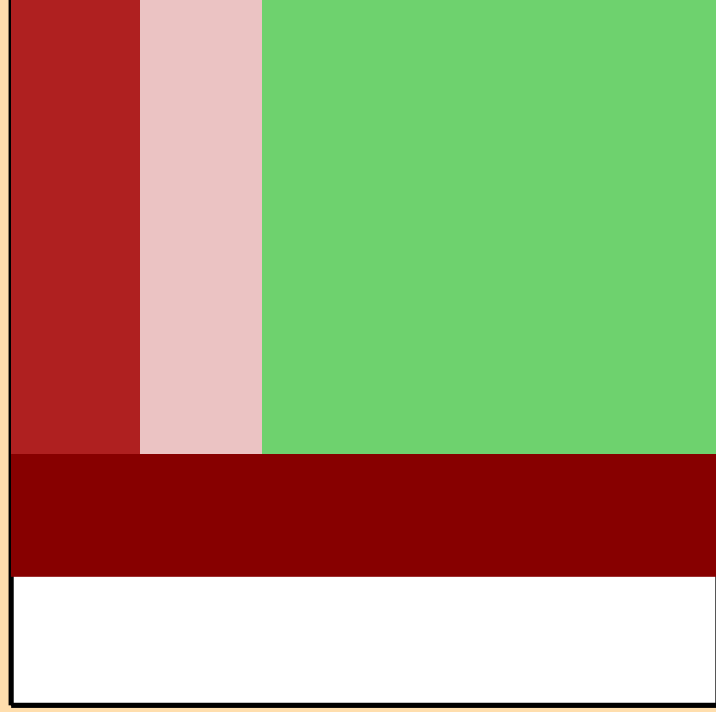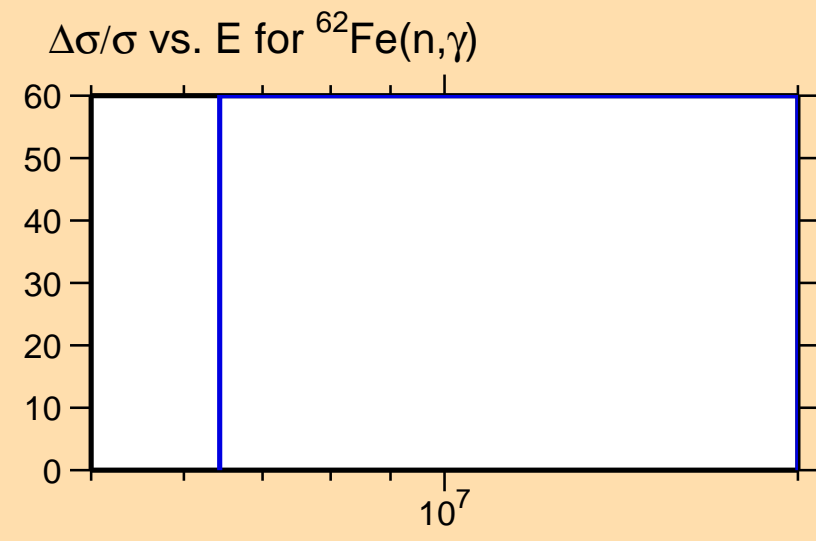

Correlation Matrix

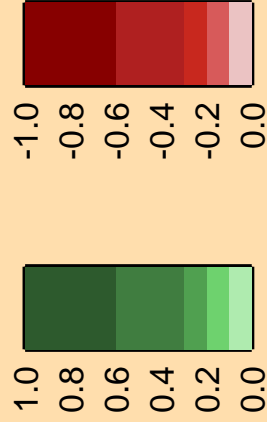

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,p)$


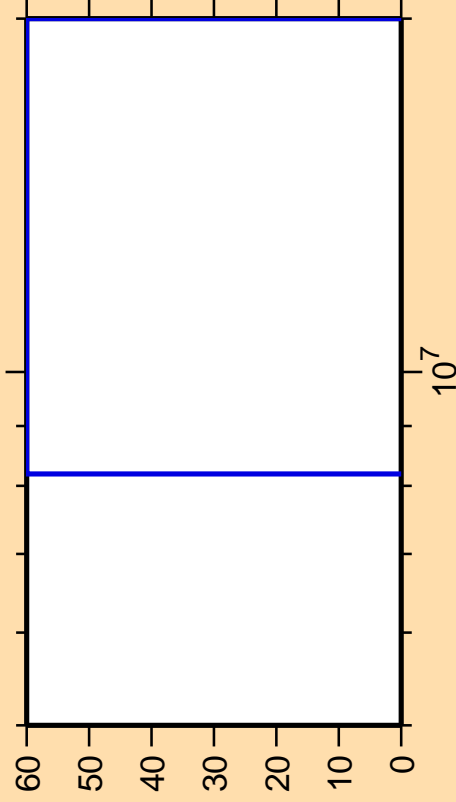


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.


σ vs. E for $^{62}\text{Fe}(n,p)$

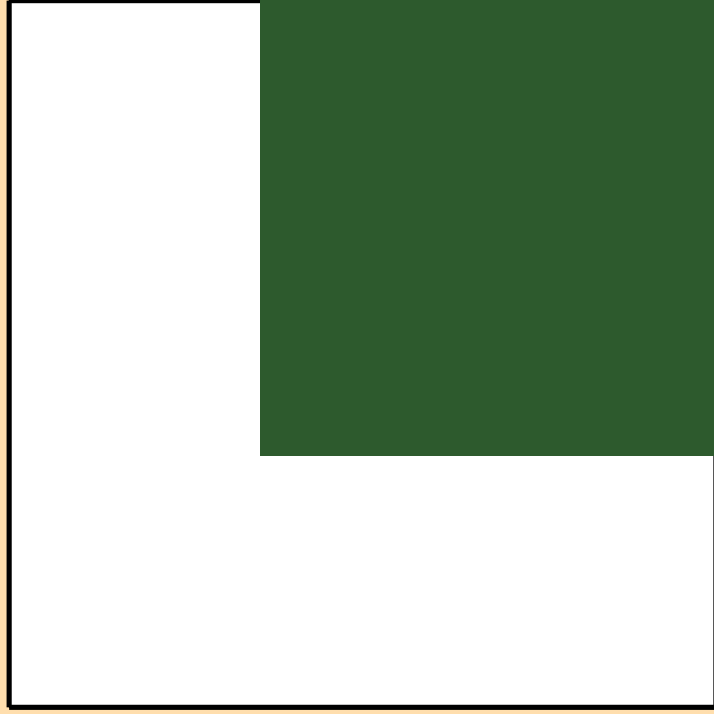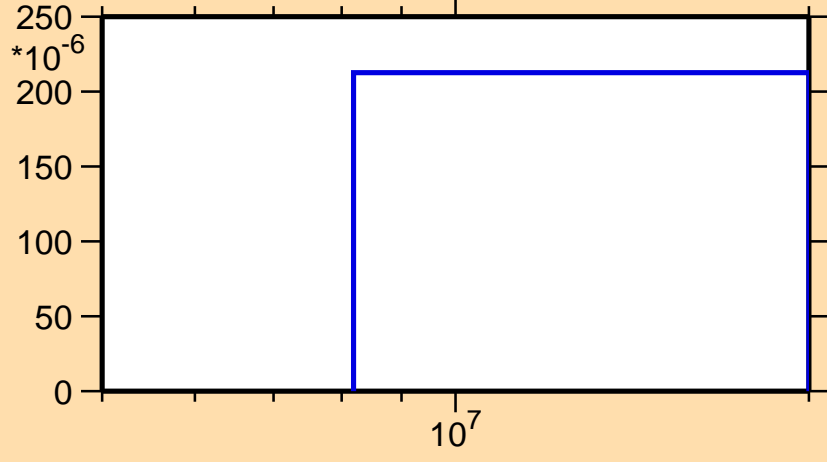

Correlation Matrix

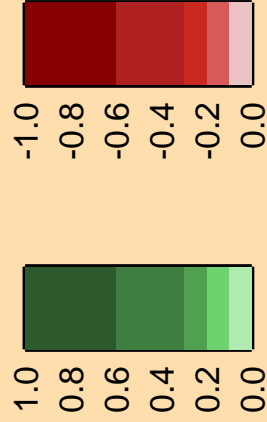

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,\alpha)$


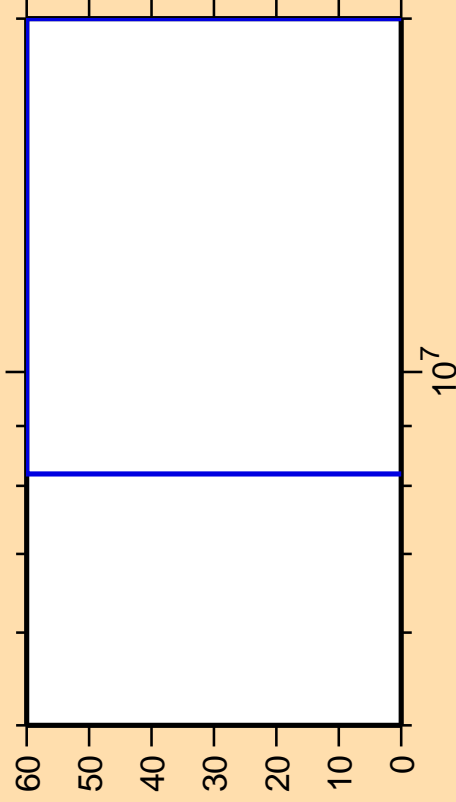


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,p)$

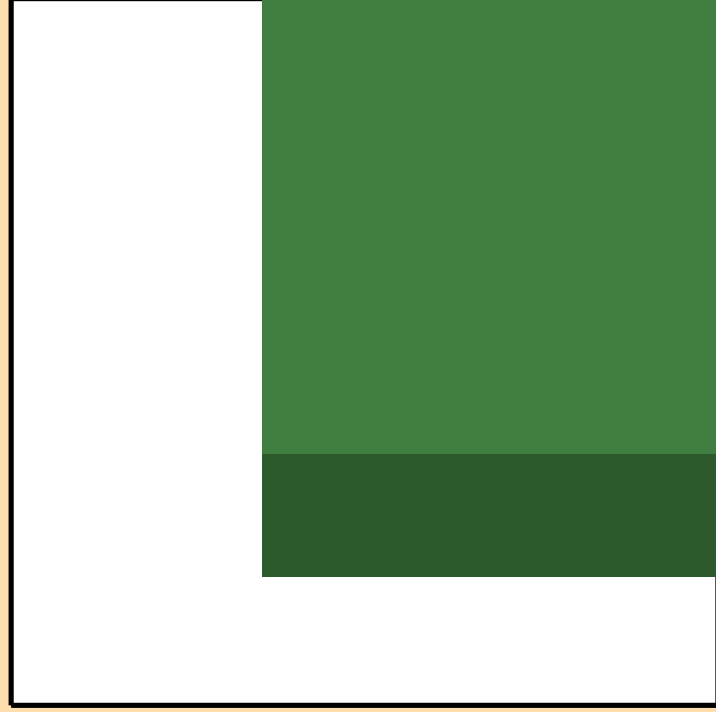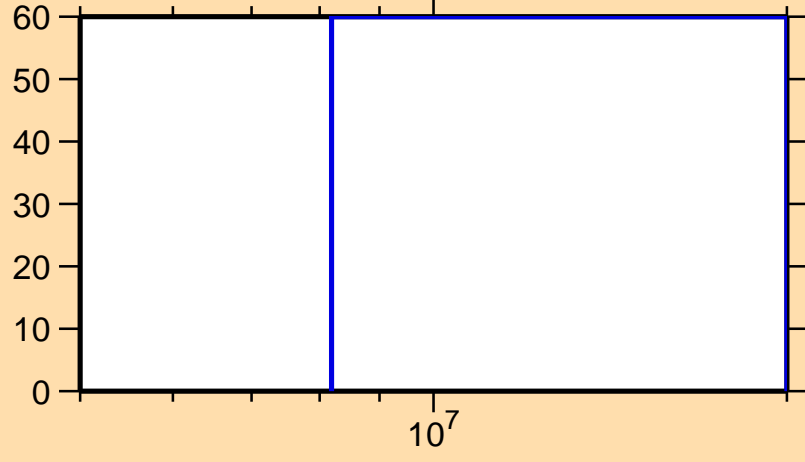

Correlation Matrix

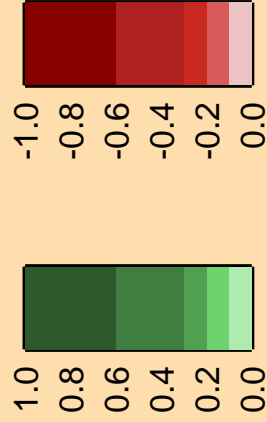

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,d)$

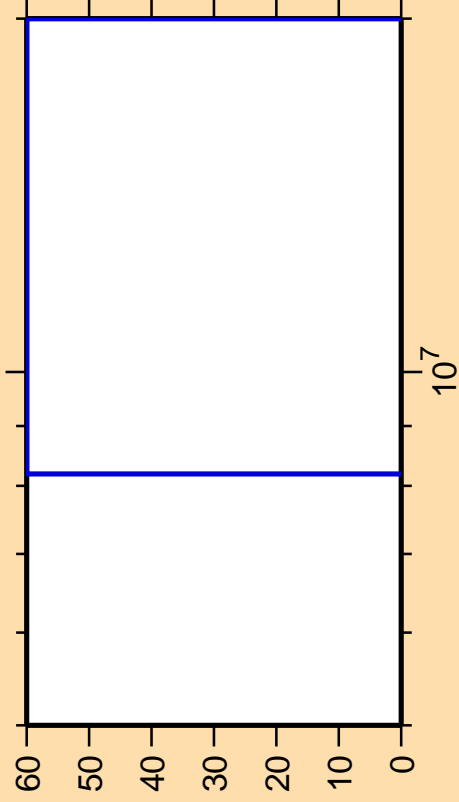


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

σ vs. E for $^{62}\text{Fe}(n,d)$

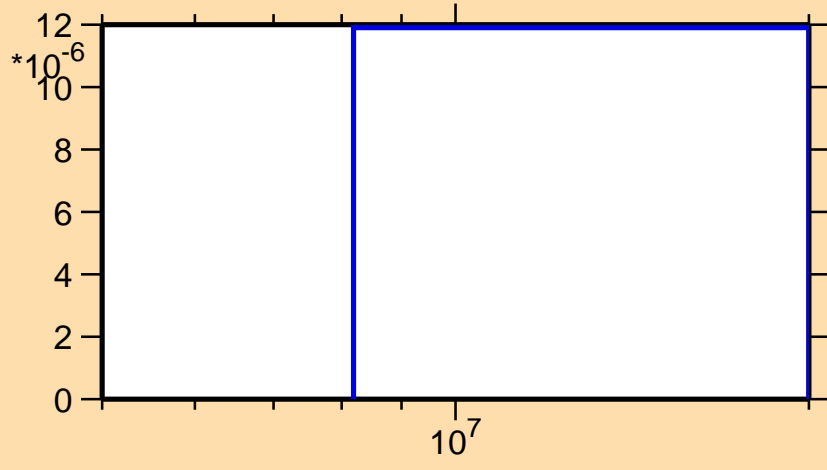


12
10
8
6
4
2
0

10^7

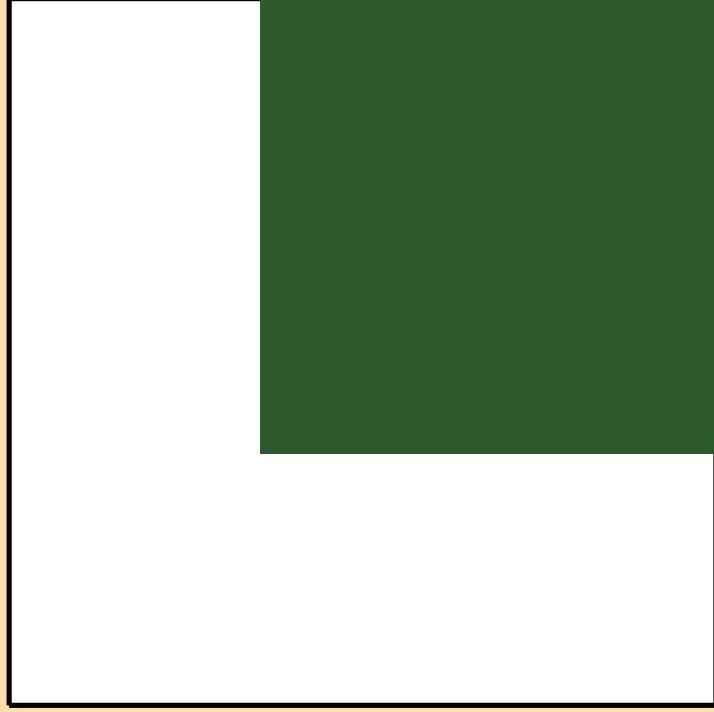


Correlation Matrix

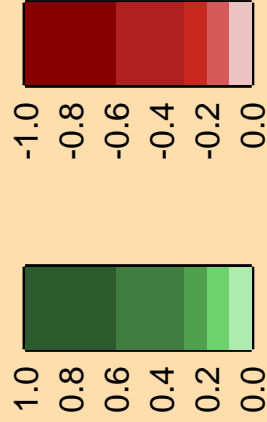

-1.0
-0.8
-0.6
-0.4
-0.2
0.0

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,t)$

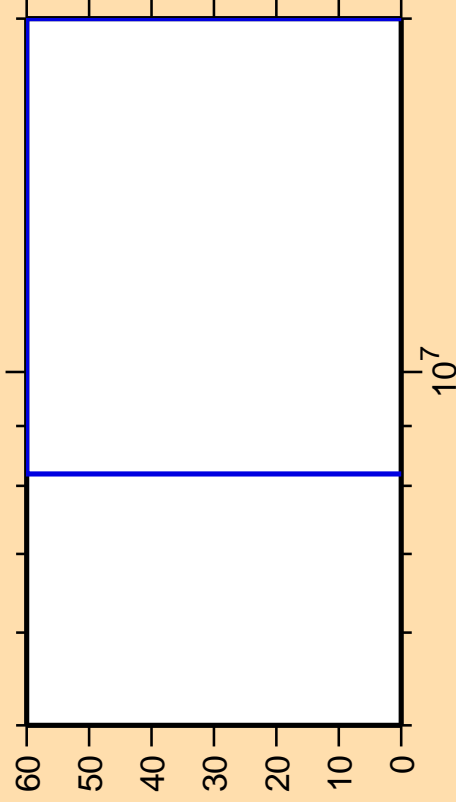


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

σ vs. E for $^{62}\text{Fe}(n,t)$

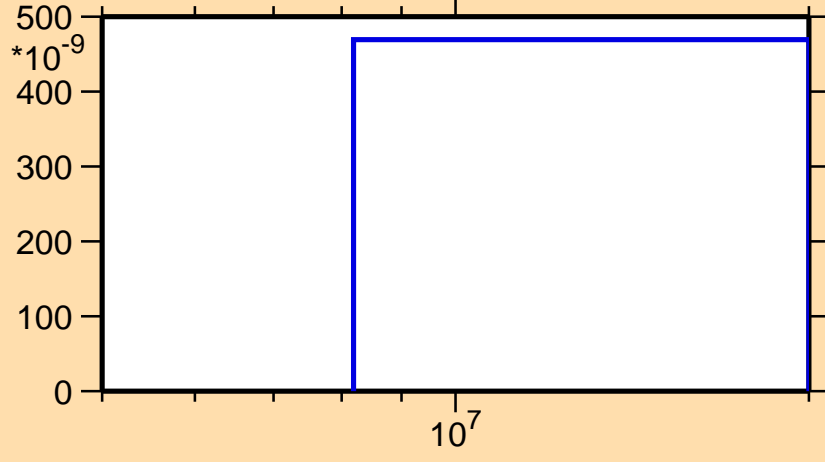


500
* 10^{-9}
400
300
200
100
0


10^7

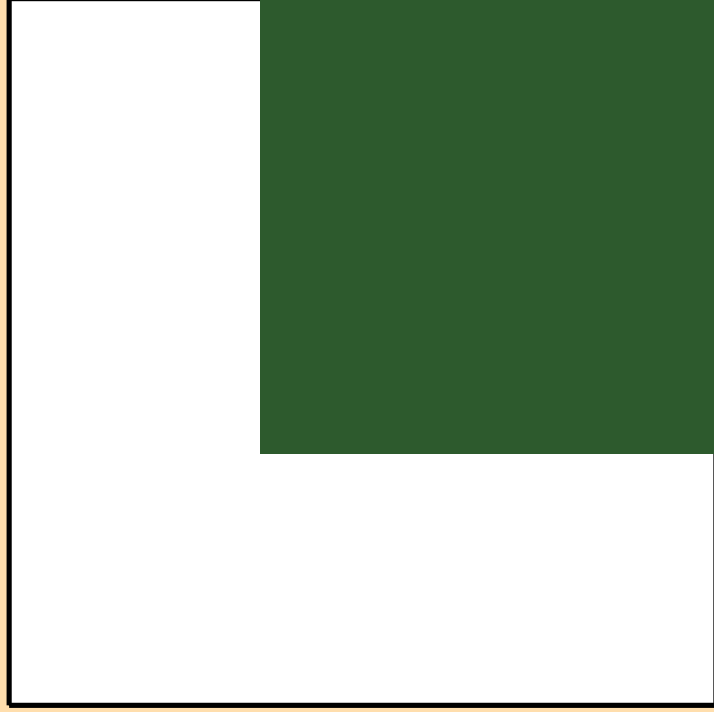

Correlation Matrix

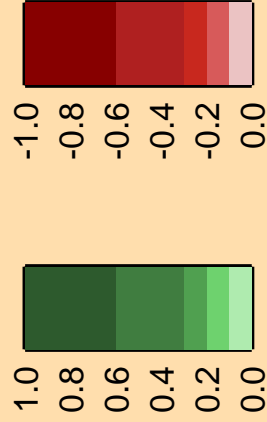



$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Fe}(n,\text{He}3)$

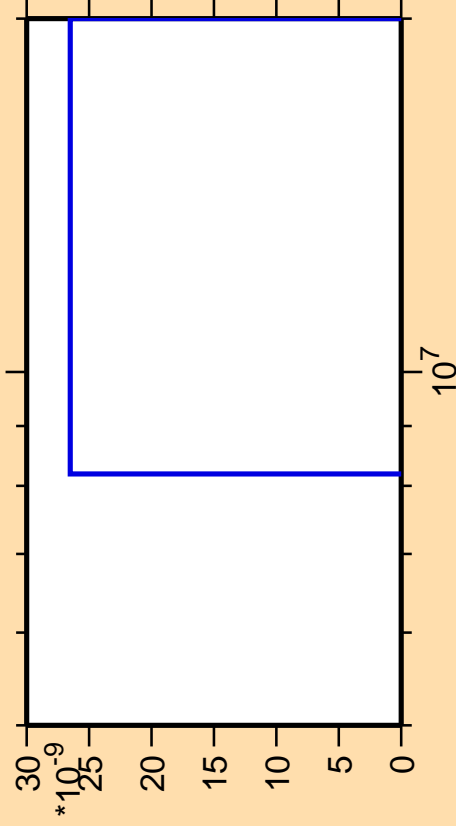


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

σ vs. E for $^{62}\text{Fe}(n,\text{He}3)$

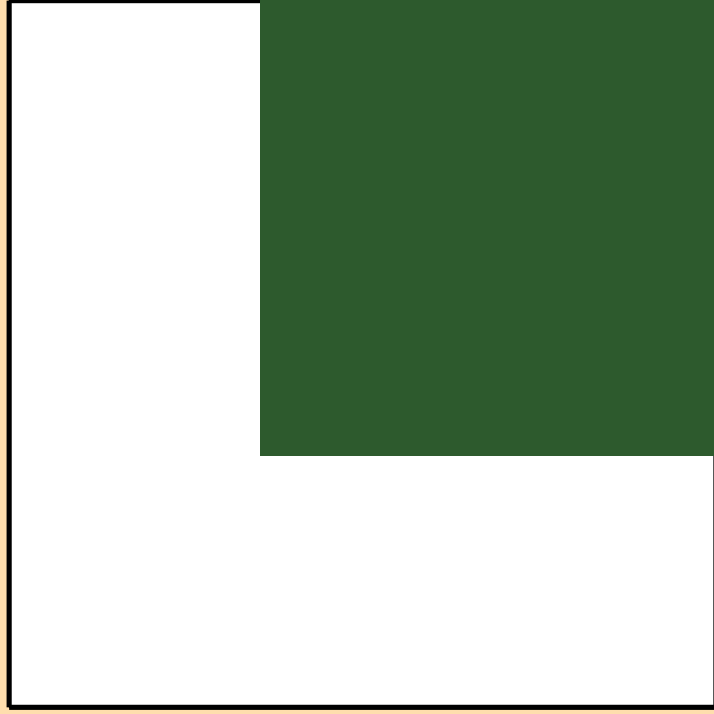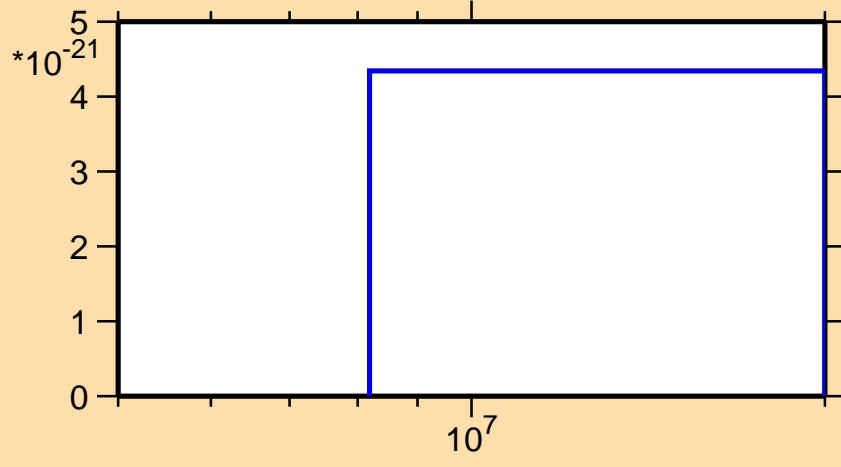

Correlation Matrix

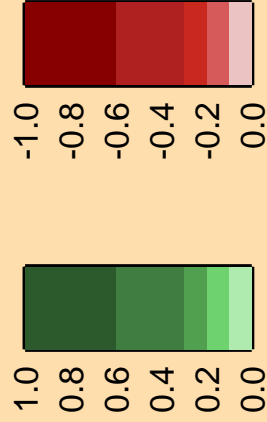


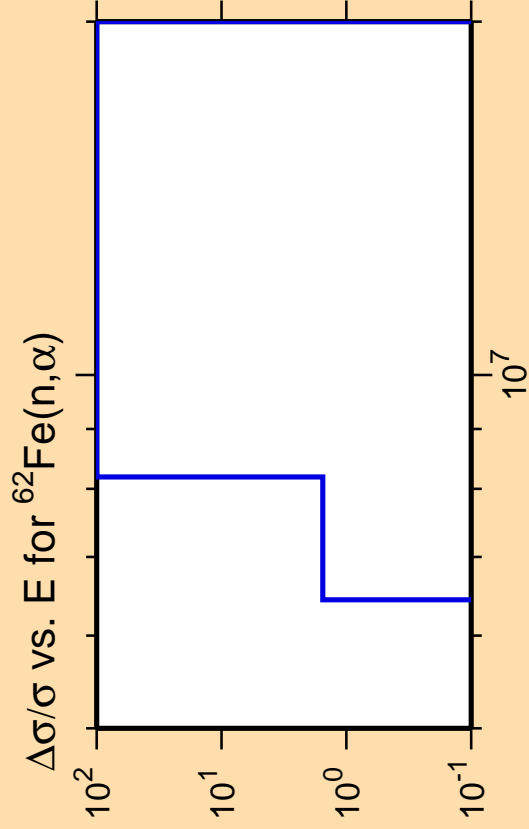


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

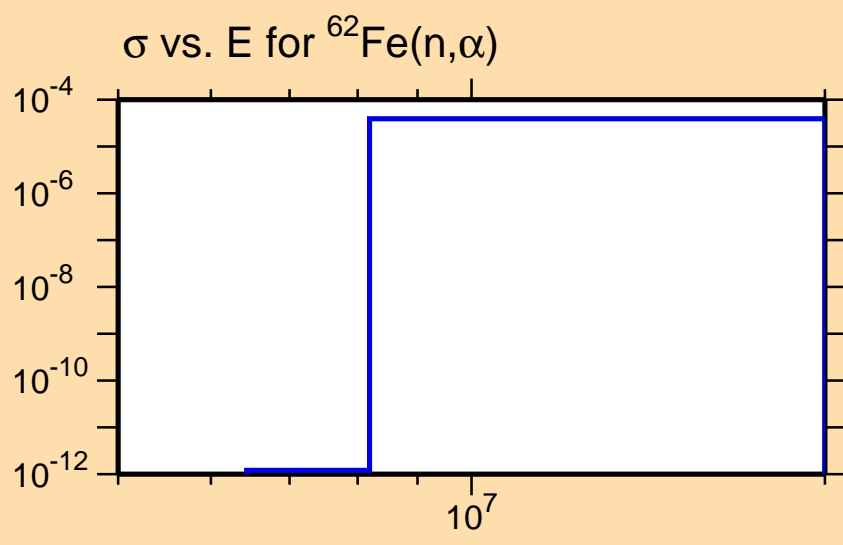

σ vs. E for $^{62}\text{Fe}(n,\alpha)$

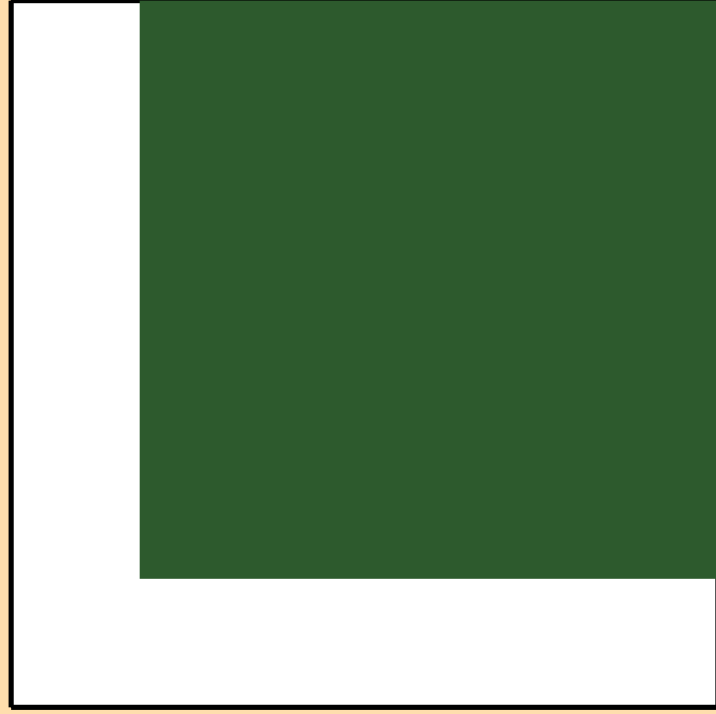

Correlation Matrix

